



Your **definitive** source
for quality pre-owned
equipment.

Artisan Technology Group

(217) 352-9330 | sales@artisantg.com | artisantg.com

Full-service, independent repair center

with experienced engineers and technicians on staff.

We buy your excess, underutilized, and idle equipment

along with credit for buybacks and trade-ins.

Custom engineering

so your equipment works exactly as you specify.

- Critical and expedited services
- In stock / Ready-to-ship
- Leasing / Rentals / Demos
- ITAR-certified secure asset solutions

Expert team | Trust guarantee | 100% satisfaction

All trademarks, brand names, and brands appearing herein are the property of their respective owners.


Find the *GE / Bently Nevada 3300/50-02-02-00-00* at our website: ***Click HERE***

3300/50 TACHOMETER

INCLUDES DUAL SETPOINT, ZERO SPEED, AND
ROTOR ACCELERATION TACHOMETERS.


OPERATION MANUAL

**BENTLY
NEVADA** 

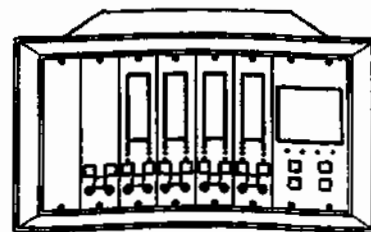

NOTICE**READ THE FOLLOWING BEFORE INSTALLING OR OPERATING EQUIPMENT**

Bently Nevada Corporation has attempted to identify areas of risk created by improper installation and/or operation of this product. These areas of information are noted as **WARNING** or **CAUTION** for your protection and for the safe and effective operation of this equipment. Read all instructions before installing or operating this product. Pay particular attention to those areas designated by the following symbols.

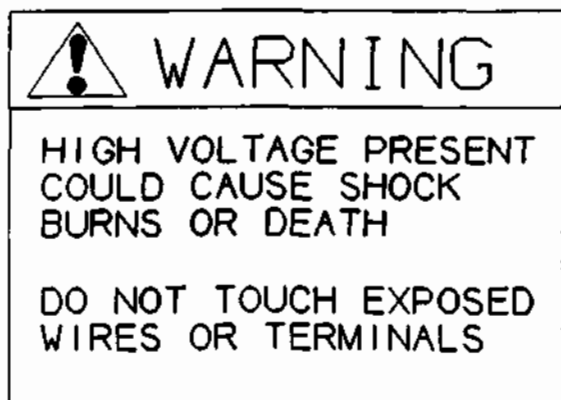**CAUTION**

Machine Protection
Will Be Lost

SYMBOLS

Special symbols are used in the manual to illustrate specifics in the step-by-step processes. For example:



PRESS



FLASHING



CONNECT



DISCONNECT



OBSERVE



SCREWDRIVER

NOTICE**WARNING !**

Bently Nevada Tachometers are not designed for use independently as, or a component of, a speed control or overspeed protection system.

Bently Nevada Tachometers do not provide protective redundancy and the response speed needed for reliable operation as a speed control or overspeed protection system.

Where provided, the analog proportional output is suitable for data logging or chart recording purposes only. Also, where provided, speed Alert setpoints are suitable for annunciation purposes only.

Failure to take the above warnings into account constitutes a misuse of the product and may result in property damage and/or bodily injury.

Blank Page

FORWARD

This document is for control room personnel who operate the 3300 Monitoring System. The procedures are presented in step-by-step, graphic format.

RELATED DOCUMENTS

3300 System Overview, 80177

3300 System Installation Instructions, 80172

3300 System Troubleshooting, 80173

3300/10 Power Supply, 80174

3300/01 System Monitor, 80175

3300/50 Tachometer Maintenance, 83871-01

Dynamic Data Manager System, 46390-01

Keyphasor® is a registered trademark of Bently Nevada Corporation

Proximitar® is a registered trademark of Bently Nevada Corporation

Document No. 83870-01 First Printing: March 1989 Revision NC: March 1989

Copyright© 1989 Bently Nevada Corporation

All Rights reserved

No part of this publication may be reproduced, transmitted, stored in a retrieval system nor translated into any human or computer language, in any form or by any means, electronic, mechanical, magnetic, optical, chemical, manual, or otherwise, without the prior written permission of the copyright owner,

Bently Nevada Corporation
P.O. Box 157
Minden, Nevada 89423 USA
Telephone 800-227-5514 702-782-3611
Telex 7400983 BNC UC
Fax 702-782-9253

Copyright infringement is a serious matter under
United States of America and Foreign Copyright Laws

Blank Page


CONTENTS

SECTION	TITLE	PAGE
	SYSTEM OVERVIEW	
1	DUAL SETPOINT TACHOMETER	1
2	ZERO SPEED TACHOMETER	2
3	ROTOR ACCELERATION TACHOMETER	3
4	MONITOR OPTIONS	4
5	PROGRAMMABLE OPTIONS	5
6	MONITOR FUNCTIONS	6
7	OK	9
	BYPASS	
8	DUAL SETPOINT TACHOMETER	10
9	ZERO SPEED TACHOMETER	11
10	ROTOR ACCELERATION TACHOMETER	12
	ALERT	
11	DUAL SETPOINT TACHOMETER	13
12	ZERO SPEED TACHOMETER	14
13	ROTOR ACCELERATION TACHOMETER	15
14	READ GAP VOLTAGE	16
	READ SETPOINTS	
15	DUAL SETPOINT TACHOMETER	17
16	ZERO SPEED TACHOMETER	18
17	ROTOR ACCELERATION TACHOMETER	19
18	READ PEAK HOLD	20
19	RESET PEAK HOLD	21
20	ENABLE (ZERO SPEED TACHOMETER)	22
21	SELF TEST	23
22	INDEX	27

Blank Page


1

DUAL SETPOINT TACHOMETER SYSTEM

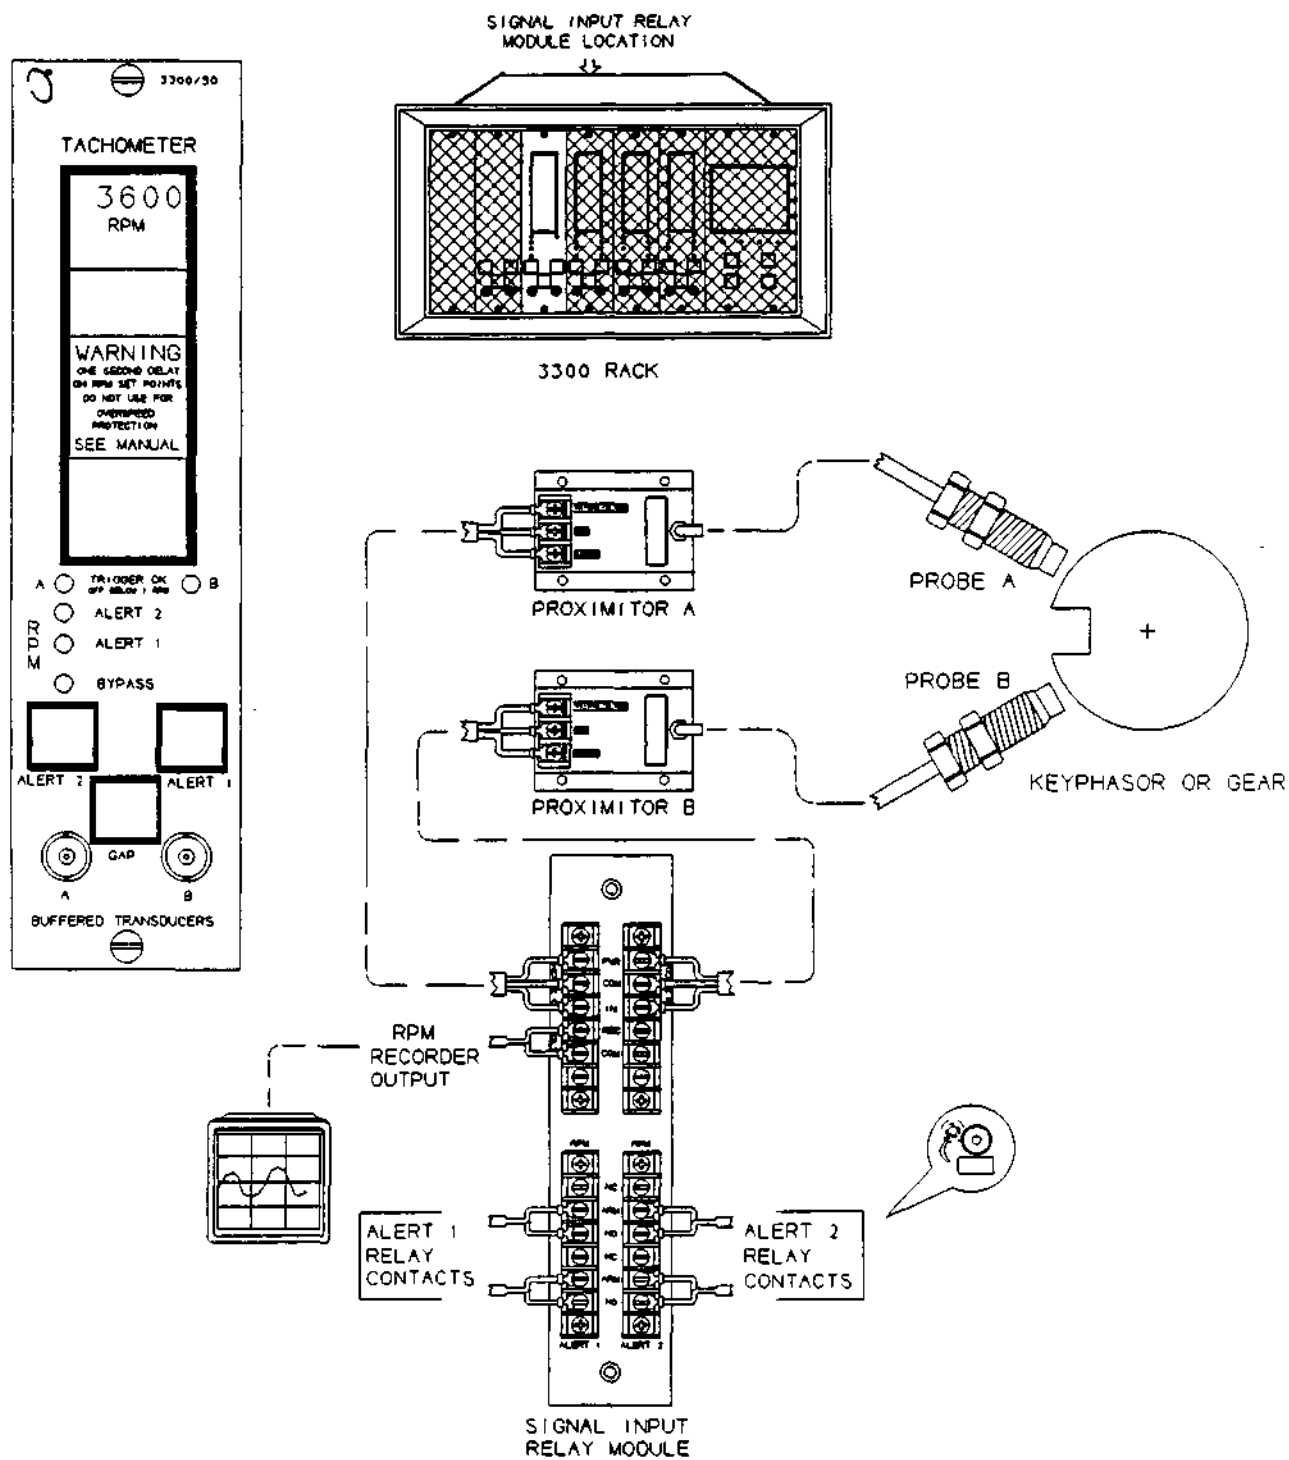


2

ZERO SPEED TACHOMETER SYSTEM

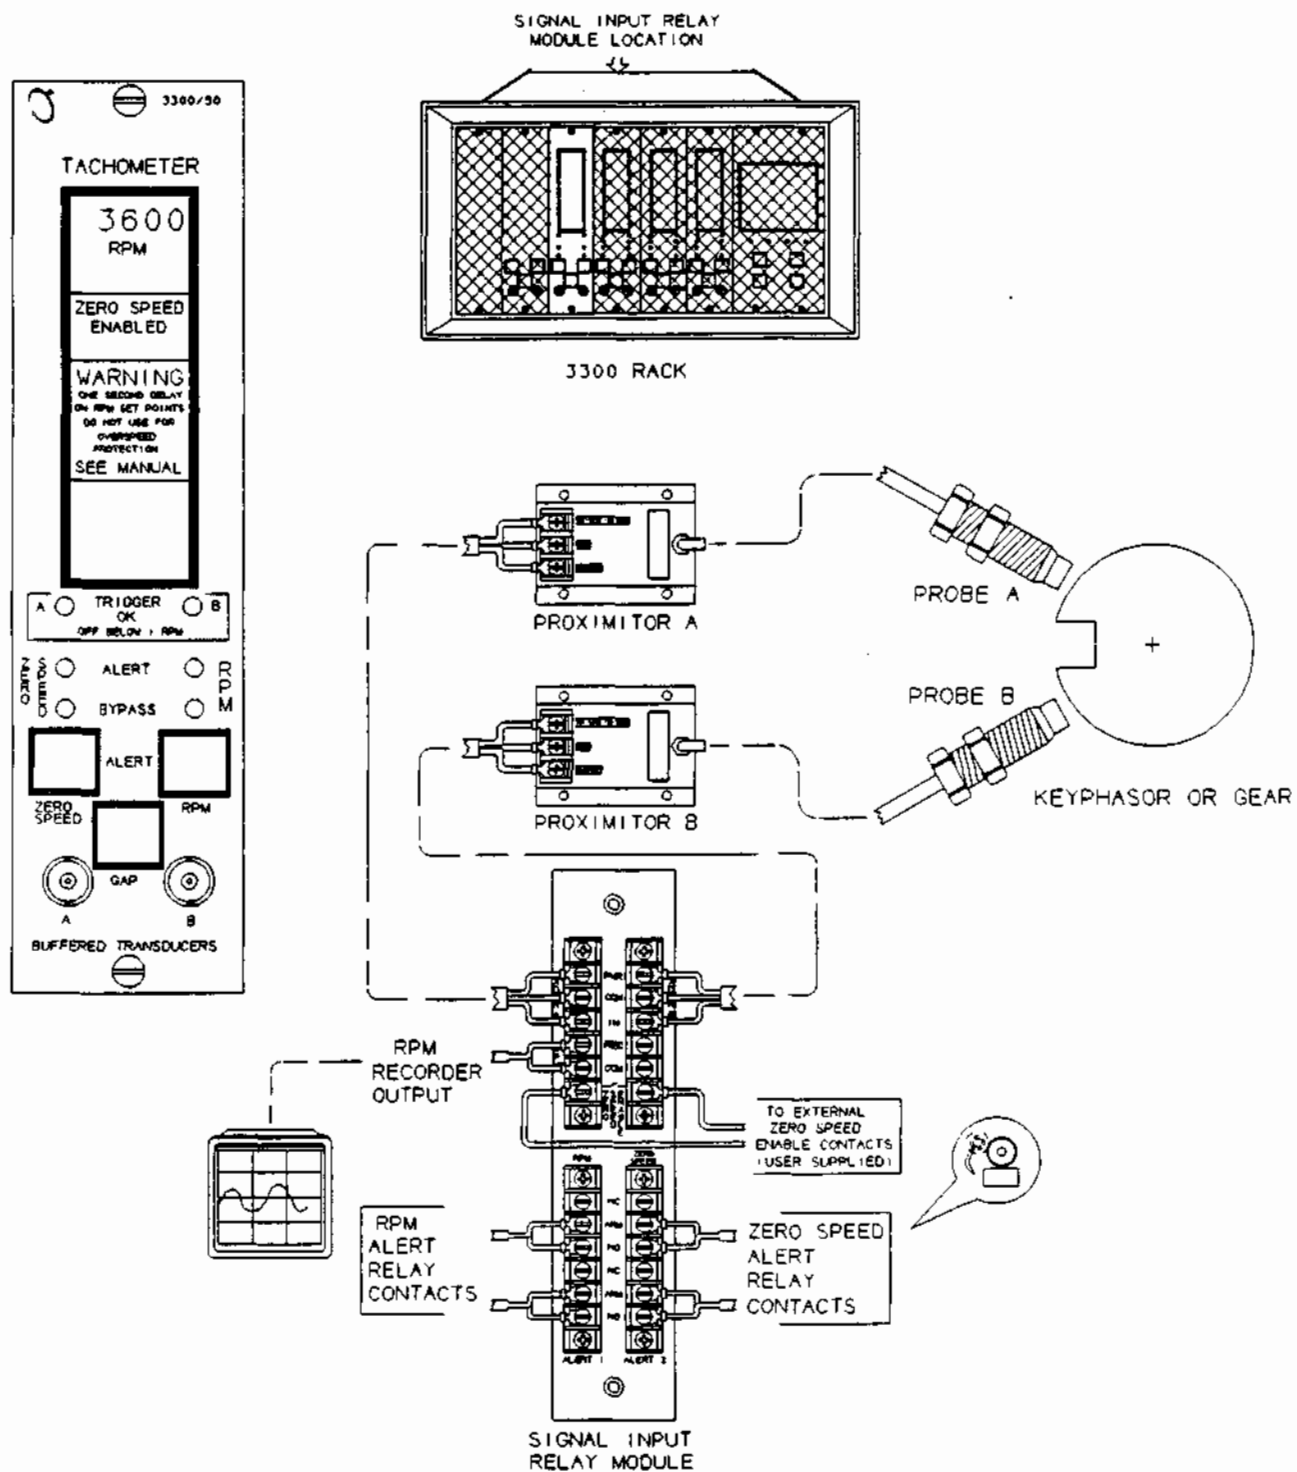

3

ROTOR ACCELERATION TACHOMETER SYSTEM

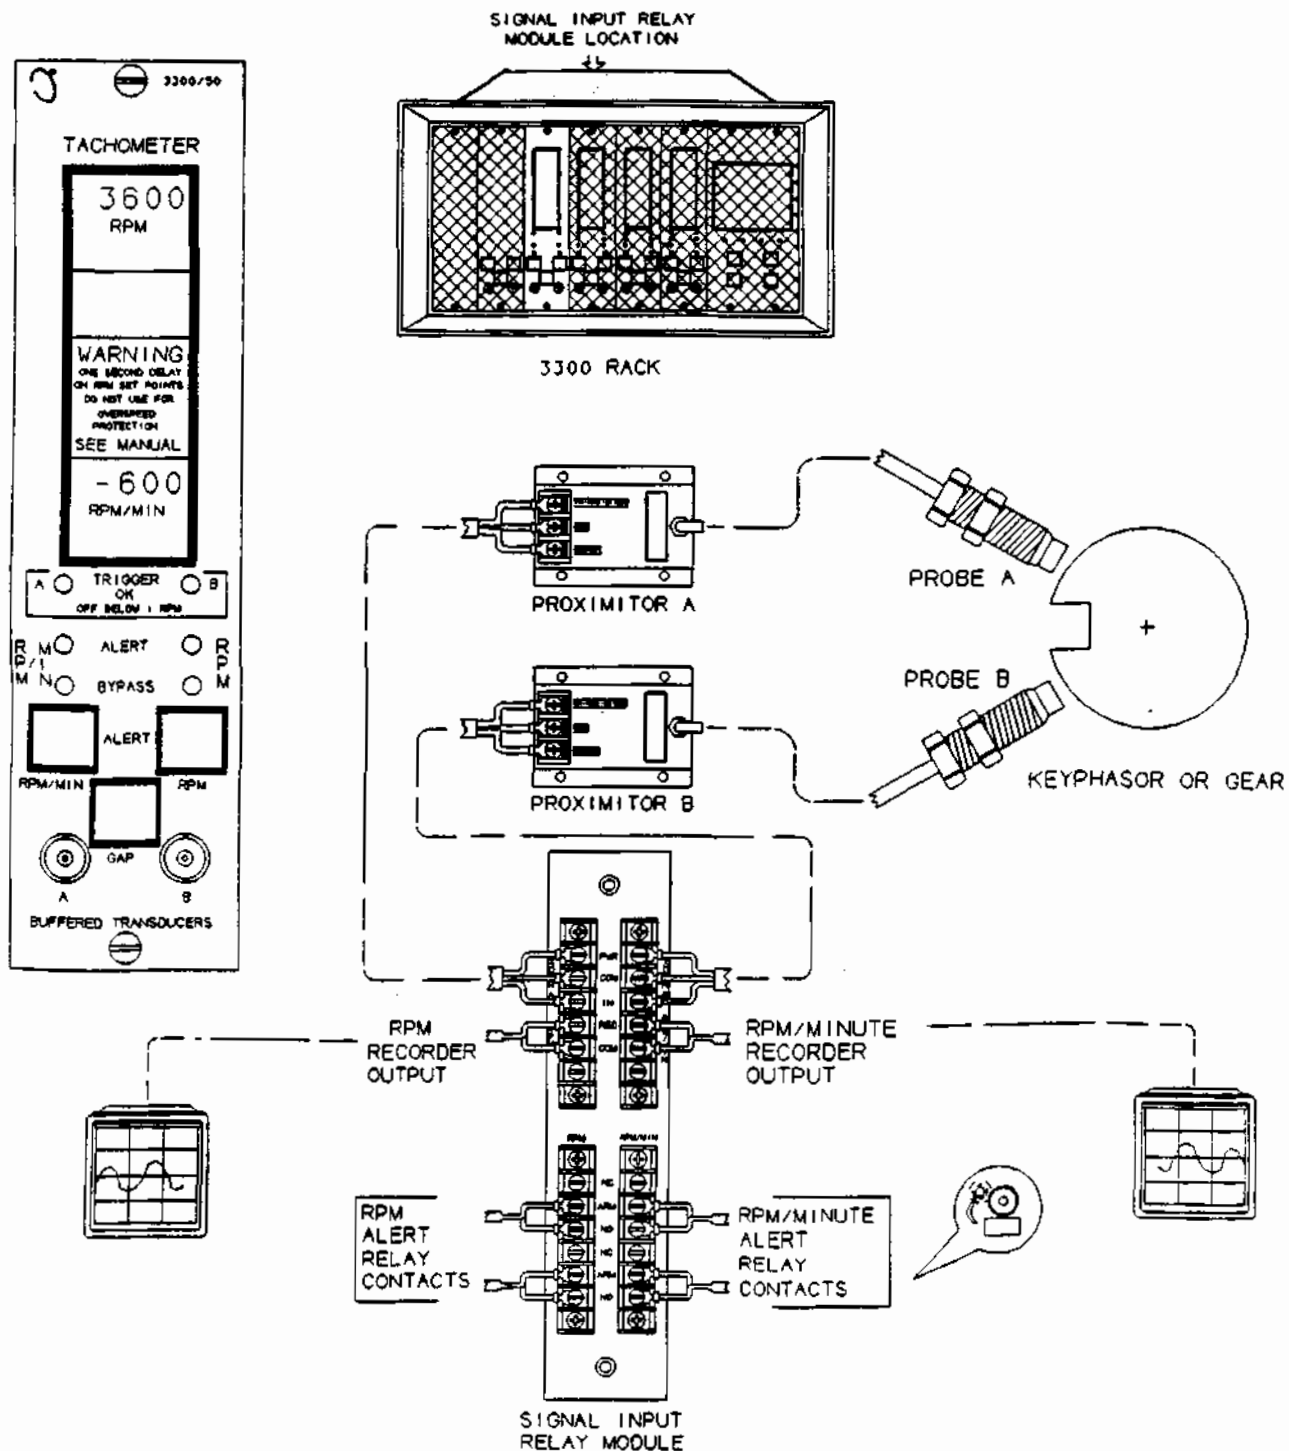

4

MONITOR OPTIONS

TACHOMETER
PART NUMBER

TACHOMETER TYPE	ALERT RELAYS	AGENCY APPROVAL	BARRIERS
3300/50 ——— AA ———	BB ———	CC ———	DD
01 = DUAL SETPOINT TACHOMETER	00 = NONE	00 = NOT REQ'D	00 = NOT REQ'D
02 = ZERO SPEED TACHOMETER	01 = 5 AMP EPOXY SEALED	01 = CSA	01 = WITH BARRIERS
03 = ROTOR ACCELERATION TACHOMETER	02 = 5 AMP HERMETICALLY SEALED	02 = BASEEFA	
		03 = FACTORY MUTUAL	

5

PROGRAMMABLE OPTIONS

TRANSducer INPUT (NOTE 1)	SYSTEM KEYPHASORS * 7200/3000 PROXIMITOR MAGNETIC PICKUP	TRANSducer THRESHOLD MODE (NOTE 3)	MANUAL * AUTOMATIC
TRANSducer CONDITIONING HYSTERESIS	0.2 VOLTS * 0.5 VOLTS 1.0 VOLTS 2.0 VOLTS	ALERT MODES	* OVER ALERT UNDER ALERT * LATCHING NON-LATCHING
FIRST OUT ALERT (NOTE 2)	* ENABLED DISABLED	ALERT BYPASS	ENABLED * DISABLED
RECORDER OUTPUTS	* +4 TO +20 mA +1 TO +5 Vdc 0 TO -10 Vdc		

* OPTIONS SHIPPED FROM BENTLY NEVADA

NOTE 1: MAGNETIC PICKUPS ARE NOT ALLOWED FOR ZERO SPEED APPLICATIONS.

NOTE 2: ALL VERSIONS OF THE TACHOMETER DRIVE ONLY THE RACK FIRST OUT ALERT BUS.
THIS MONITOR DOES NOT DRIVE THE RACK FIRST OUT DANGER BUS.

NOTE 3: THE ZERO SPEED TACHOMETER IS SHIPPED IN THE MANUAL THRESHOLD MODE. AUTO THRESHOLD IS NOT ALLOWED IN THE ZERO SPEED MONITOR. AUTO THRESHOLD WILL NOT WORK BELOW 5 Hz (300 RPM AT ONE EVENT PER REVOLUTION).

6**MONITOR FUNCTIONS**

ROTOR SPEED MONITORING - The Tachometer function provides continuous monitoring of shaft rotative speed. The Tachometer accepts input from either a proximity probe or magnetic pickup (not recommended). The Tachometer measures the time between Keyphasor pulses and calculates the rotor speed in revolutions per minute (RPM). The monitor displays the rotor speed on the front panel and provides a proportional voltage or current recorder output. The Tachometer also outputs Alert status via rear panel relay contacts for external annunciation.

ZERO SPEED - The 3300 Tachometer provides, as a factory installed option, a Zero Speed function. Zero Speed measurements are generally taken on turbines, generators and other rotating machinery with large rotors.

Zero Speed is a preselected shaft rotative speed that allows for proper engagement of the turning gear. Continuous shaft rotation during machine shutdown is imperative to prevent shaft bow that could lead to possible machine damage during startup.

The Zero Speed function requires inputs from two transducers. Voting logic between the two transducers minimizes false Zero Speed indication in the event of a transducer failure. When the Zero Speed function is enabled, and the preselected Zero Speed is reached, an Alert LED indicates the condition. Alert relay contacts are also provided for use with an external indicator such as an annunciator panel.

ROTOR ACCELERATION - The 3300 Tachometer provides, as a factory installed option, a Rotor Acceleration indicator. The Rotor Acceleration function provides an indication of a machine's rotative acceleration. The acceleration/deceleration information is displayed on the front panel. A recorder output, as well as Alert relay outputs are provided.

Rotor Acceleration is used with machinery during startup or shutdown. The original machine manufacturer's recommended ramp up or ramp down rate must be maintained to minimize possible damage.

PROBE GAP VOLTAGE - Probe gap is measured in negative DC voltage and is directly proportional to the gap between the face of a proximity probe and the surface being monitored. Probe gap voltage for each transducer is displayed on the front panel by pressing the GAP switch.

TRIGGER OK - The TRIGGER OK LEDs indicate the status of the transducer input signal, and the monitor. The TRIGGER OK LEDs remain on as long as the Tachometer is receiving valid input signals and the monitor is OK. The LEDs will extinguish when the input is less than 1 RPM or greater than 99,999 RPM. An invalid trigger will not cause the system OK relay to go NOT OK.

OK RELAY - The OK Relay is located on the Power Input Module. Every monitor in the rack must be OK or bypassed to energize the OK Relay.

6 MONITOR FUNCTIONS (CONT)

ALERT - Pressing one of the Alert switches on the front panel of the monitor causes the corresponding Alert setpoint to be displayed on the front panel. When the particular Alert setpoint conditions have been met, the Alert LEDs will illuminate and the Alert relay contacts are activated.

FIRST OUT ALERT - A monitor with the First Out option selected flashes an Alert LED if that Alert was the first in the rack. Pressing the RESET switch acknowledges the First Out.

ALERT RELAYS - Monitor Alerts can be programmed for either latching or nonlatching modes. In the nonlatching mode, the alert resets automatically when the Alert no longer exists. In the latching mode, the Alert condition must be reset manually by pressing the RESET switch on the front panel of the System Monitor (or by closing the external reset contacts). The Alert will not reset if the Alert condition still exists.

ALERT BYPASS - An Alert can be bypassed using a switch located behind the front panel. When bypassed, an Alert condition no longer causes the Alert LEDs to illuminate or the relay to actuate. Alert bypass can be during maintenance. Alert Bypass is indicated by the front panel BYPASS LED. Other front panel functions are not affected by Alert Bypass. This function can be disabled using a programmable jumper within the monitor.

MONITOR BYPASS - The monitor can be completely bypassed using the Monitor Bypass switch located behind the front panel. When bypassed, the monitor is completely nonfunctional, and can be removed from the system monitoring loop. After this function is activated, the normal system OK operation (OK Relay) will be restored for the remaining active monitors in the rack.

PEAK HOLD - The PEAK HOLD function allows recall of the maximum RPM value obtained since the last PEAK HOLD reset. The PEAK HOLD value is read by pressing both Alert buttons simultaneously. The Tachometer retains the PEAK HOLD value even after loss of monitor power. PEAK HOLD is cleared by shorting two adjacent testpoints located behind the front panel.

BUFFERED OUTPUTS - The BUFFERED TRANSDUCER A and B coaxial cable connectors on the front panel of the monitor provide buffered signals both redundant transducers. These connectors can be used to connect external equipment to the monitor.

RECORDER OUTPUT - Depending on the option selected, the recorder output levels proportional to RPM (and RPM/MIN with the Rotor Accel. Tach.) are either 0 to -10Vdc, +1 to +5Vdc, or +4 to +20mA.

6**MONITOR FUNCTIONS (CONT)**

SELF TEST - The monitor has three categories of self test: power-up, cyclic, and user-invoked.

A power-up self test, consisting of a series of basic monitor OK tests, is performed automatically each time the monitor is turned on.




A cyclic self test is performed automatically while the monitor is operating. Errors encountered during cyclic tests disable the monitor and flash an error code on the front panel display. If the error is intermittent, the monitor will begin operating again, and the error codes will be stored for retrieval during user-invoked self tests. Stored error codes are indicated by the TRIGGER OK LEDs flashing at 5 Hz (5 times per second) provided that the monitor (or trigger) is OK.

A user-invoked test performs a power-up self test and allows error messages stored during cyclic tests to be read and cleared. Stored errors are annunciated by flashing the TRIGGER OK LEDs at 5 Hz and displaying the error codes on the front panel LCD display.

MONITOR OK - A MONITOR NOT OK condition resulting from failing self test will drive the system OK relay into its NOT OK state and extinguish the front panel TRIGGER OK LEDs.

7

OK

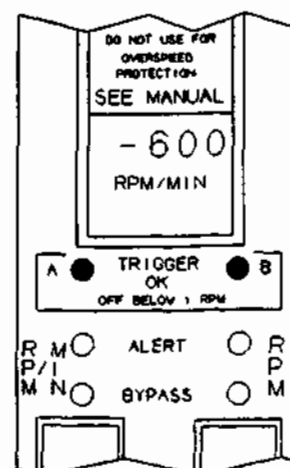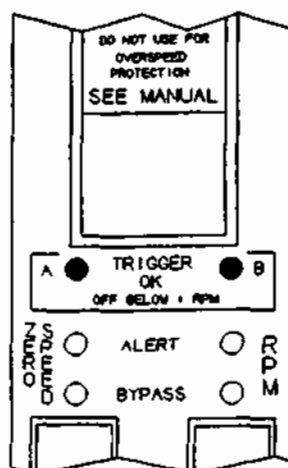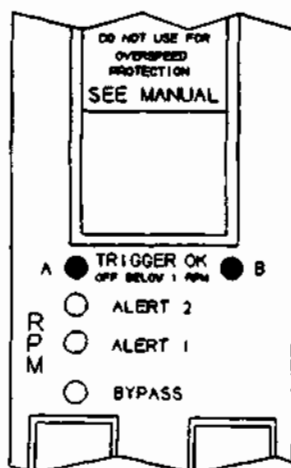


NOTE: EACH MONITOR IN THE SYSTEM CONTROLS THE OK RELAY. THE TACHOMETER CAN CAUSE A NOT OK RELAY CONDITION (DE-ENERGIZED RELAY) ONLY WITH A MONITOR NOT OK. A TRIGGER NOT OK WILL NOT AFFECT THE SYSTEM OK RELAY.

LED DISPLAY		CONDITION	OK RELAY DRIVE **
A	B		
● TRIGGER OK ●	●	MONITOR OK AND TRIGGER A AND B OK *	ON
● TRIGGER OK ○	○	RESPECTIVE TRIGGER A OR B NOT OK, AND MONITOR OK	ON
○ TRIGGER OK ○	○	BOTH TRIGGER A AND B NOT OK, AND/OR MONITOR NOT OK	OFF **
● TRIGGER OK ●	●	FLASHING AT 5 Hz = ERROR ENCOUNTERED DURING CYCLIC TEST. READ ERROR MESSAGE SEE SECTION ON ERROR CODES	ON

* 'TRIGGER OK' MEANS THE RPM VALUE IS BETWEEN 1 AND 100,000 RPM AND THAT THE RPM VALUE HAS NOT CHANGED MORE THAN 50% BETWEEN TWO INPUT TRIGGERS.

** A NOT OK MONITOR CAN BE BYPASSED TO RESTORE RELAY OK CONDITIONS. IF THE MONITOR IS OK, BUT THE TRIGGERS ARE NOT, THE OK RELAY WILL BE ON (OK).

8 BYPASS (DUAL SETPOINT TACHOMETER)

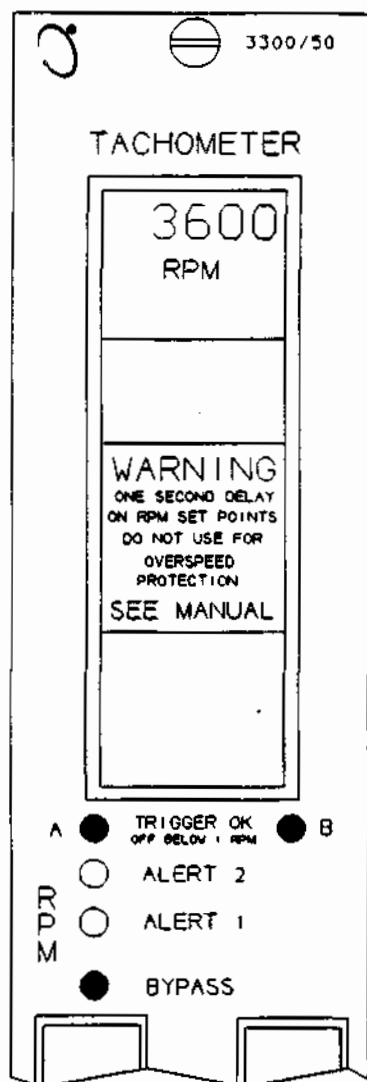

ALERT 2 RELAY BYPASSED

MONITOR ON LINE
ALERT 1 RELAY FUNCTIONAL




MONITOR BYPASSED

MONITOR OFF LINE
DISPLAY AT ZERO


NOTE: THE ALERT 1 RELAY CANNOT BE BYPASSED IN THE DUAL SETPOINT TACHOMETER.

9

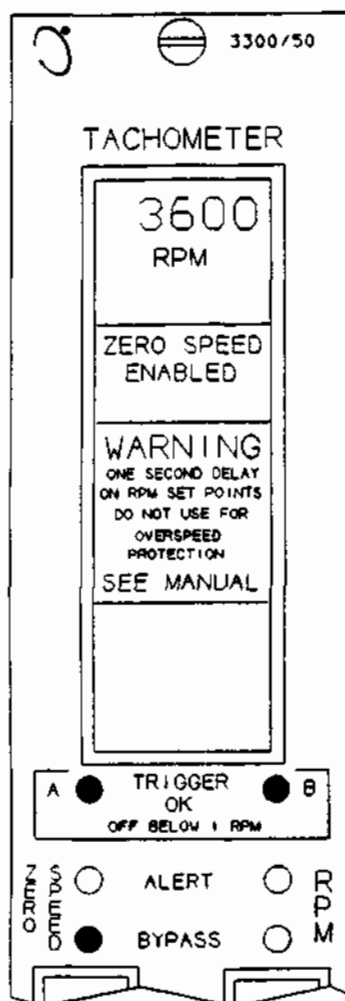BYPASS (ZERO SPEED TACHOMETER)


**ZERO SPEED ALERT
RELAY BYPASSED**

**MONITOR ON LINE
RPM ALERT RELAY
FUNCTIONAL**

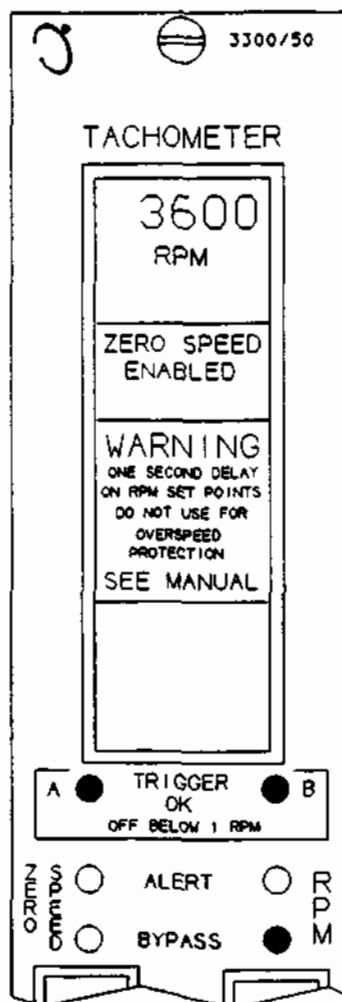

**RPM ALERT RELAY
BYPASSED**


**MONITOR ON LINE
ZERO SPEED ALERT
RELAY FUNCTIONAL**

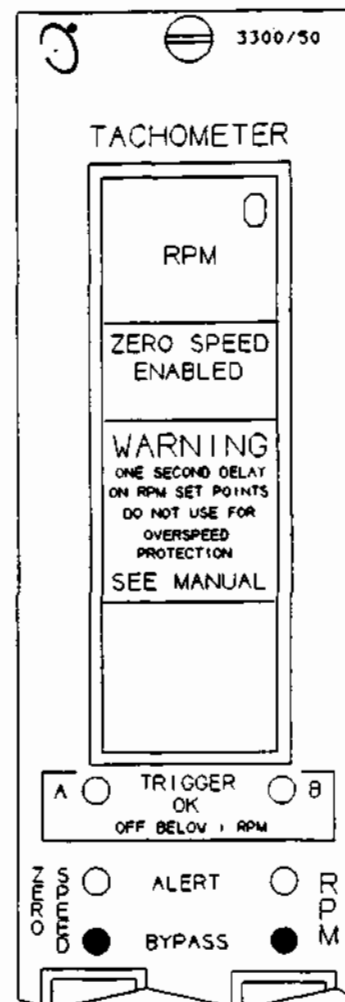

MONITOR BYPASSED


**MONITOR OFF LINE
RPM DISPLAY AT ZERO**

10

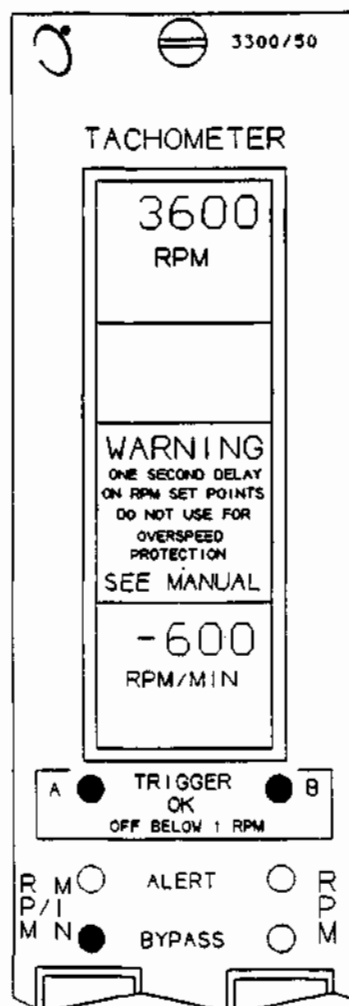BYPASS (ROTOR ACCEL. TACHOMETER)


**ROTOR ACCEL ALERT
RELAY BYPASSED**

MONITOR ON LINE
RPM ALERT RELAY
FUNCTIONAL

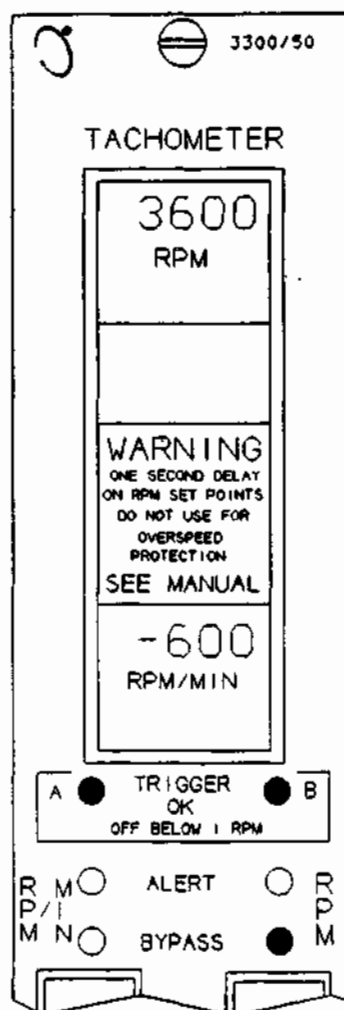

**RPM ALERT RELAY
BYPASSED**


MONITOR ON LINE
ROTOR ACCEL. ALERT
RELAY FUNCTIONAL

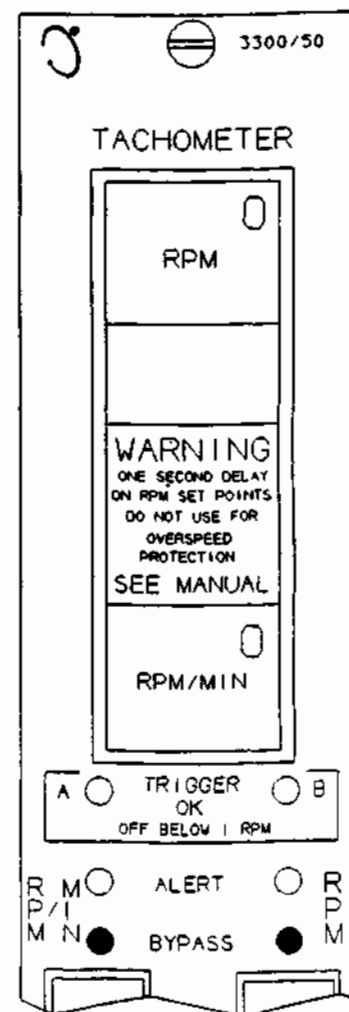

MONITOR BYPASSED

MONITOR OFF LINE
DISPLAYS AT ZERO

11 ALERT (DUAL SETPOINT TACHOMETER)

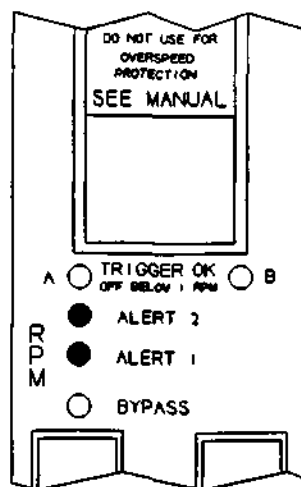


LED DISPLAY	CONDITION	RELAY DRIVE	
		ALERT 1	ALERT 2
● ALERT 1 ○ ALERT 2	THE ALERT 1 SETPOINT HAS BEEN EXCEEDED. *	ON	OFF
○ ALERT 1 ● ALERT 2	THE ALERT 2 SETPOINT HAS BEEN EXCEEDED. *	OFF	ON
● ALERT 1 ● ALERT 2	BOTH ALERT SETPOINTS HAVE BEEN EXCEEDED. *	ON	ON
⊙ ALERT 1 ○ ALERT 2	THE ALERT 1 SETPOINT HAS BEEN EXCEEDED. ALERT 1 IS THE FIRST OUT ALERT. **	ON	OFF
○ ALERT 1 ⊙ ALERT 2	THE ALERT 2 SETPOINT HAS BEEN EXCEEDED. ALERT 2 IS THE FIRST OUT ALERT. **	OFF	ON

* AN RPM ALERT REQUIRES AT LEAST ONE TRANSDUCER TO OBSERVE THE ROTOR SPEED (RPM) RISE ABOVE AN OVER SPEED SETPOINT OR FALL BELOW AN UNDER SPEED SETPOINT FOR AT LEAST ONE SECOND.

** FIRST OUT RESOLUTION IS BETTER THAN 50 MILLISECONDS. IF TWO ALERTS OCCUR WITHIN 50 MILLISECONDS OR LESS, BOTH LEDS COULD FLASH. BOTH ALERTS MAY FLASH TO INDICATE FIRST OUT FOLLOWING SELF TEST.

12 ALERT (ZERO SPEED TACHOMETER)

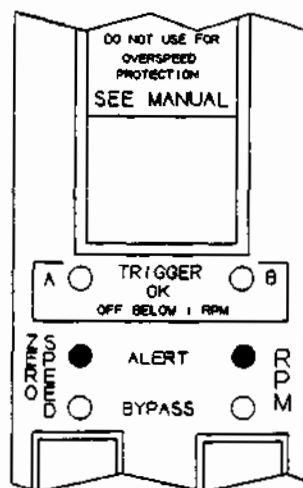

LED DISPLAY ALERT		CONDITION	RELAY DRIVE ALERT	
ZERO SPEED	RPM		ZERO SPEED	RPM
●	○	THE ZERO SPEED ALERT CONDITIONS HAVE BEEN MET. *	ON	OFF
○	●	THE RPM ALERT CONDITIONS HAVE BEEN MET. **	OFF	ON
●	●	BOTH THE ZERO SPEED AND RPM ALERT CONDITIONS HAVE BEEN MET. * **	ON	ON
◎	○	THE ZERO SPEED ALERT CONDITIONS HAVE BEEN MET. ZERO SPEED IS THE FIRST OUT ALERT. ***	ON	OFF
○	◎	THE RPM ALERT CONDITIONS HAVE BEEN MET. THE RPM ALERT IS THE FIRST OUT ALERT. ***	OFF	ON

* THE ZERO SPEED ALERT CONDITIONS ARE AS FOLLOWS:


1. THE TRIGGER OK CONDITIONS (SECTION 7) MUST BE MET FOR BOTH TRANSDUCERS BELOW 500 RPM.
2. BOTH TRANSDUCERS MUST OBSERVE THE ROTOR SPEED (RPM) FALL BELOW THE ZERO SPEED ALERT SETPOINT FOR AT LEAST ONE SECOND.

** AN RPM ALERT REQUIRES AT LEAST ONE TRANSDUCER TO OBSERVE THE ROTOR SPEED (RPM) RISE ABOVE AN OVER SPEED SETPOINT OR FALL BELOW AN UNDER SPEED SETPOINT FOR AT LEAST ONE SECOND.

*** FIRST OUT RESOLUTION IS BETTER THAN 50 MILLISECONDS. IF TWO ALERTS OCCUR WITHIN 50 MILLISECONDS OR LESS, BOTH LEDS COULD FLASH. BOTH ALERTS MAY FLASH TO INDICATE FIRST OUT FOLLOWING SELF TEST.

13

ALERT (ROTOR ACCEL. TACHOMETER)

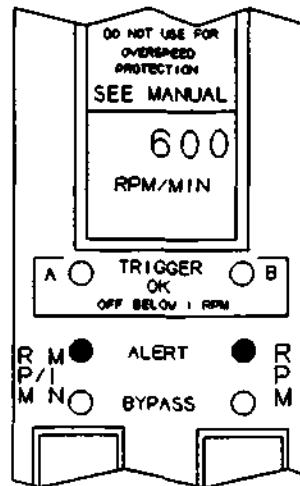

LED DISPLAY ALERT		CONDITION	RELAY DRIVE ALERT	
RPM/MIN	RPM		RPM/MIN	RPM
●	○	THE RPM/MINUTE ALERT CONDITIONS HAVE BEEN MET. *	ON	OFF
○	●	THE RPM ALERT CONDITIONS HAVE BEEN MET. **	OFF	ON
●	●	BOTH THE RPM/MINUTE AND RPM ALERT CONDITIONS HAVE BEEN MET. * **	ON	ON
⊙	○	THE RPM/MINUTE ALERT CONDITIONS HAVE BEEN MET. RPM/MINUTE IS THE FIRST OUT ALERT. ***	ON	OFF
○	⊙	THE RPM ALERT CONDITIONS HAVE BEEN MET. THE RPM ALERT IS THE FIRST OUT ALERT. ***	OFF	ON

* AN RPM/MIN ALERT REQUIRES AT LEAST ONE TRANSDUCER TO OBSERVE THE ROTOR ACCELERATION (RPM/MIN) VALUE EXCEED THE RPM/MIN SETPOINT FOR AT LEAST ONE SECOND.



** AN RPM ALERT REQUIRES AT LEAST ONE TRANSDUCER TO OBSERVE THE ROTOR SPEED (RPM) RISE ABOVE AN OVER SPEED SETPOINT OR FALL BELOW AN UNDER SPEED SETPOINT FOR AT LEAST ONE SECOND.

*** FIRST OUT RESOLUTION IS BETTER THAN 50 MILLISECONDS. IF TWO ALERTS OCCUR WITHIN 50 MILLISECONDS OR LESS, BOTH LEDS COULD FLASH. BOTH ALERTS MAY FLASH TO INDICATE FIRST OUT FOLLOWING SELF TEST.

14

READ GAP VOLTAGE

PRESS GAP SWITCH AND READ GAP VOLTAGE FOR BOTH TRANSDUCER A AND TRANSDUCER B.

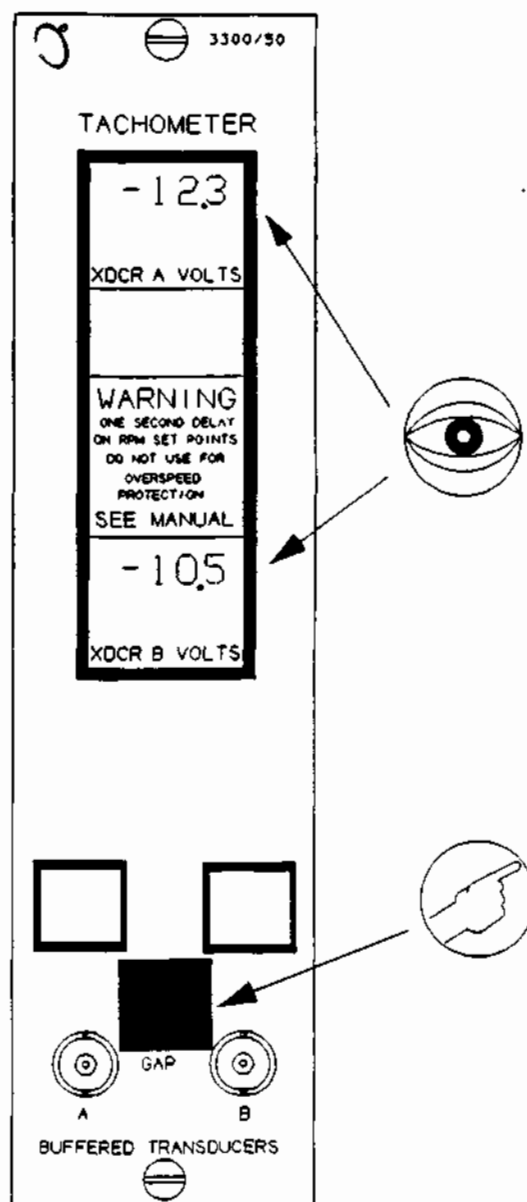
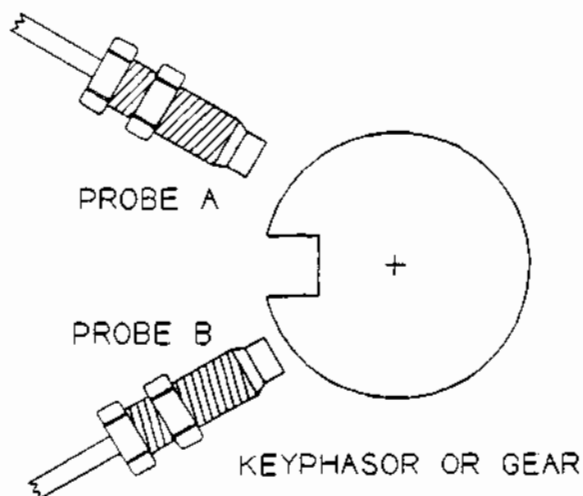


NOTE: THE GAP VOLTAGE IS INTENDED TO BE USED FOR THE INSTALLATION OF PROBES. WHILE A MACHINE IS RUNNING, THE DISPLAYED GAP VOLTAGE MAY VARY SIGNIFICANTLY.

15 READ SETPOINTS (DUAL SETPOINT TACH.)

PRESS THE ALERT 1 SWITCH AND READ THE ALERT 1 SETPOINT ON THE FRONT PANEL DISPLAY. UP ARROW INDICATES OVER SPEED SETPOINT. DOWN ARROW INDICATES UNDER SPEED SETPOINT.



PRESS THE ALERT 2 SWITCH AND READ THE ALERT 2 SETPOINT ON THE FRONT PANEL DISPLAY. UP ARROW INDICATES OVER SPEED SETPOINT. DOWN ARROW INDICATES UNDER SPEED SETPOINT.

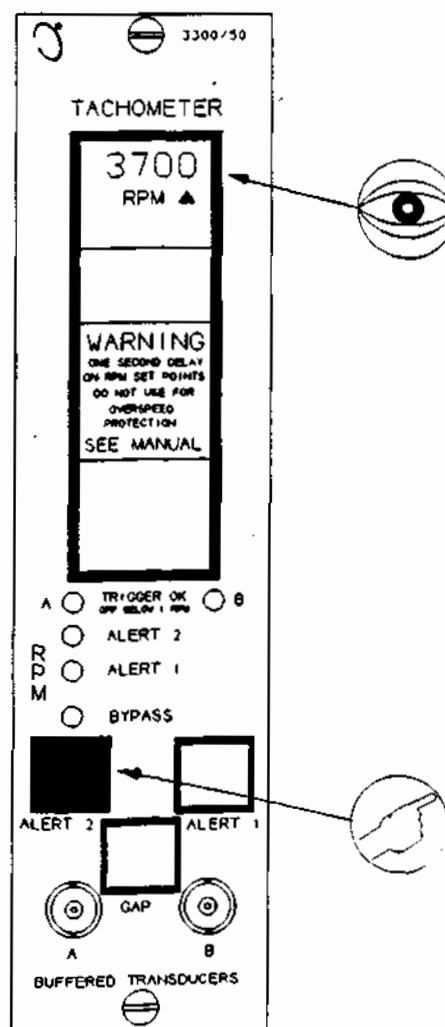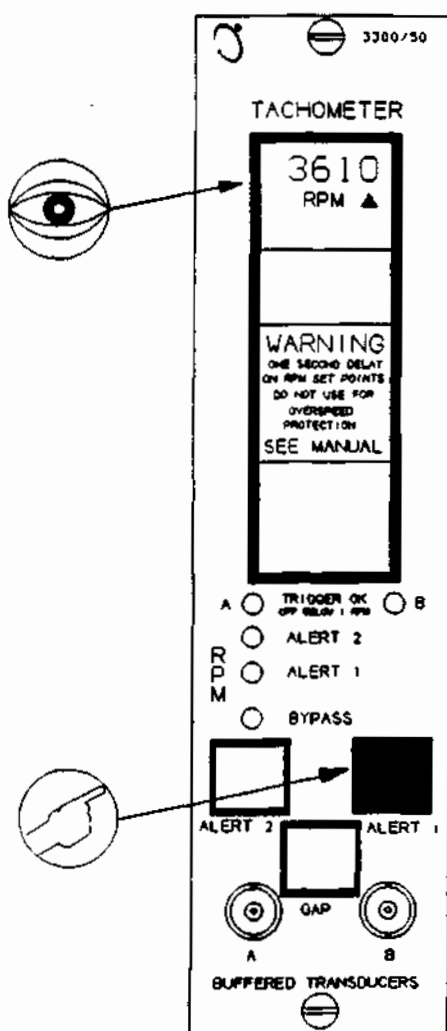

16 READ SETPOINTS (ZERO SPEED TACH.)

PRESS THE RPM ALERT SWITCH AND READ THE RPM ALERT SETPOINT ON THE FRONT PANEL DISPLAY. UP ARROW INDICATES OVER SPEED SETPOINT. DOWN ARROW INDICATES UNDER SPEED SETPOINT.



PRESS THE ZERO SPEED ALERT SWITCH AND READ THE ZERO SPEED ALERT SETPOINT ON THE FRONT PANEL DISPLAY. DOWN ARROW INDICATES UNDER SETPOINT. (ZERO SPEED IS ALWAYS AN UNDER SETPOINT.)

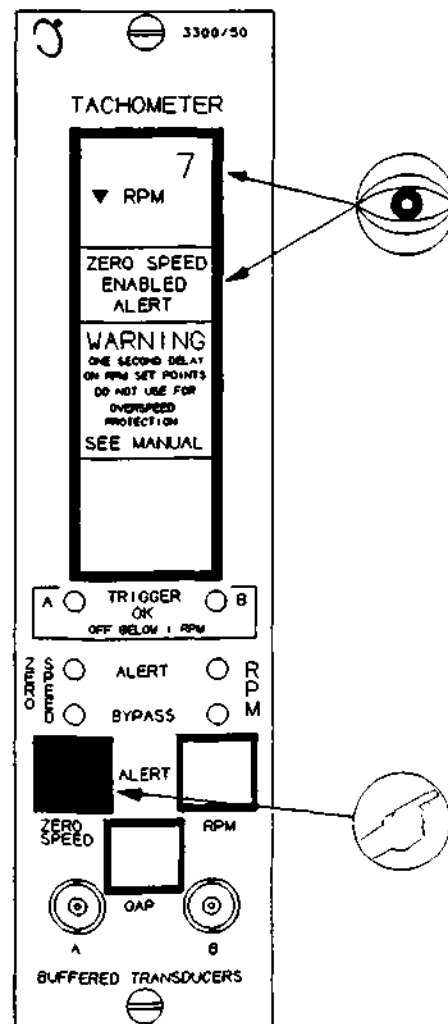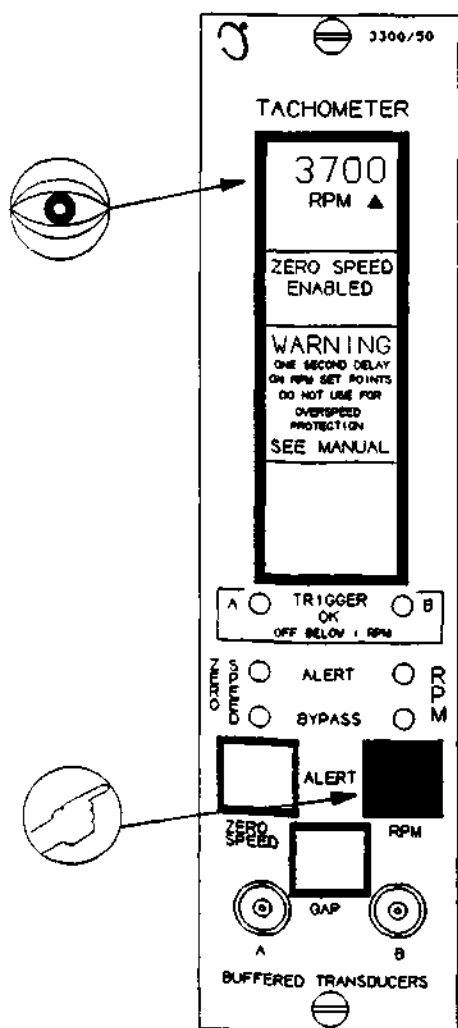

17 READ SETPOINTS (ROTOR ACCEL. TACH.)

PRESS THE RPM ALERT SWITCH AND READ THE RPM ALERT SETPOINT ON THE FRONT PANEL DISPLAY. UP ARROW INDICATES OVER SPEED SETPOINT. DOWN ARROW INDICATES UNDER SPEED SETPOINT.


PRESS THE RPM/MIN ALERT SWITCH AND READ THE RPM/MIN ALERT SETPOINT ON THE FRONT PANEL DISPLAY. UP ARROW INDICATES OVER SETPOINT. (ROTOR ACCEL IS ALWAYS AN OVER SETPOINT.)

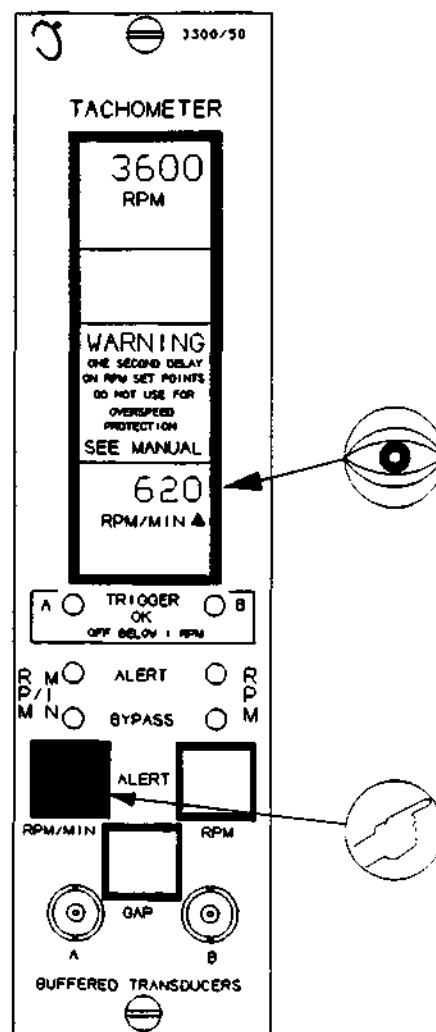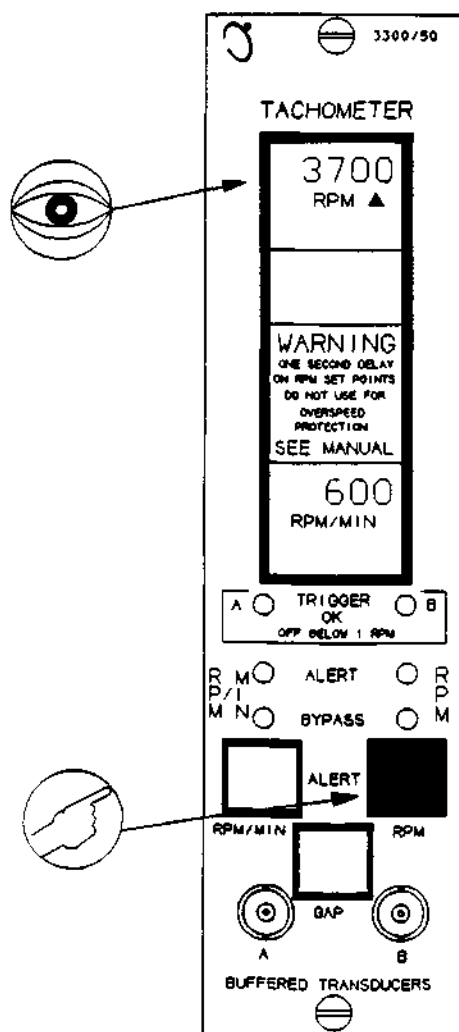

18

READ PEAK HOLD

PRESS BOTH ALERT SWITCHES SIMULTANEOUSLY AND READ THE PEAK HOLD VALUE.

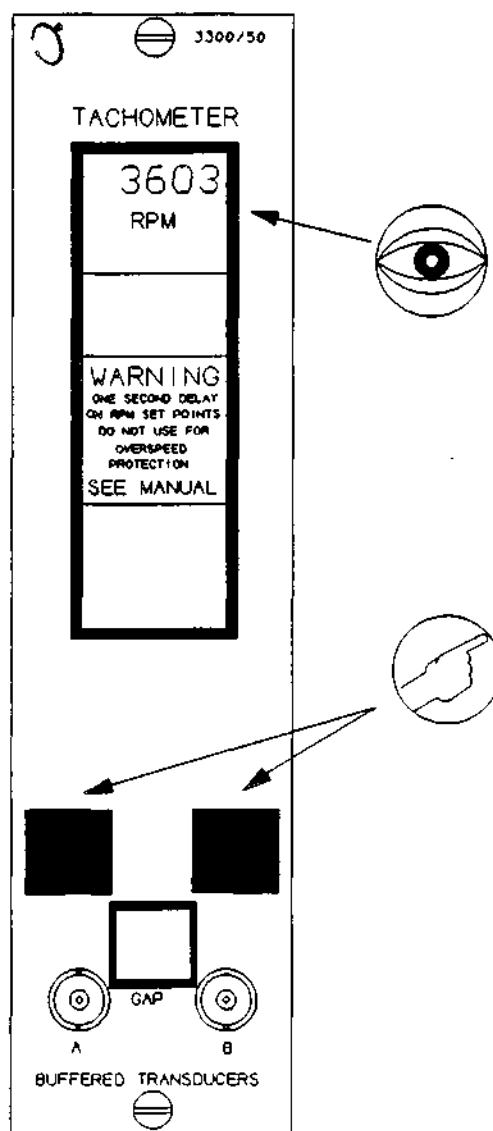


PEAK HOLD IS THE MAXIMUM RPM VALUE OBTAINED SINCE THE LAST PEAK HOLD RESET.

19

RESET PEAK HOLD

RESET THE VALUE STORED IN PEAK HOLD MEMORY BY SHORTING ACROSS PEAK HOLD (PH) PINS.

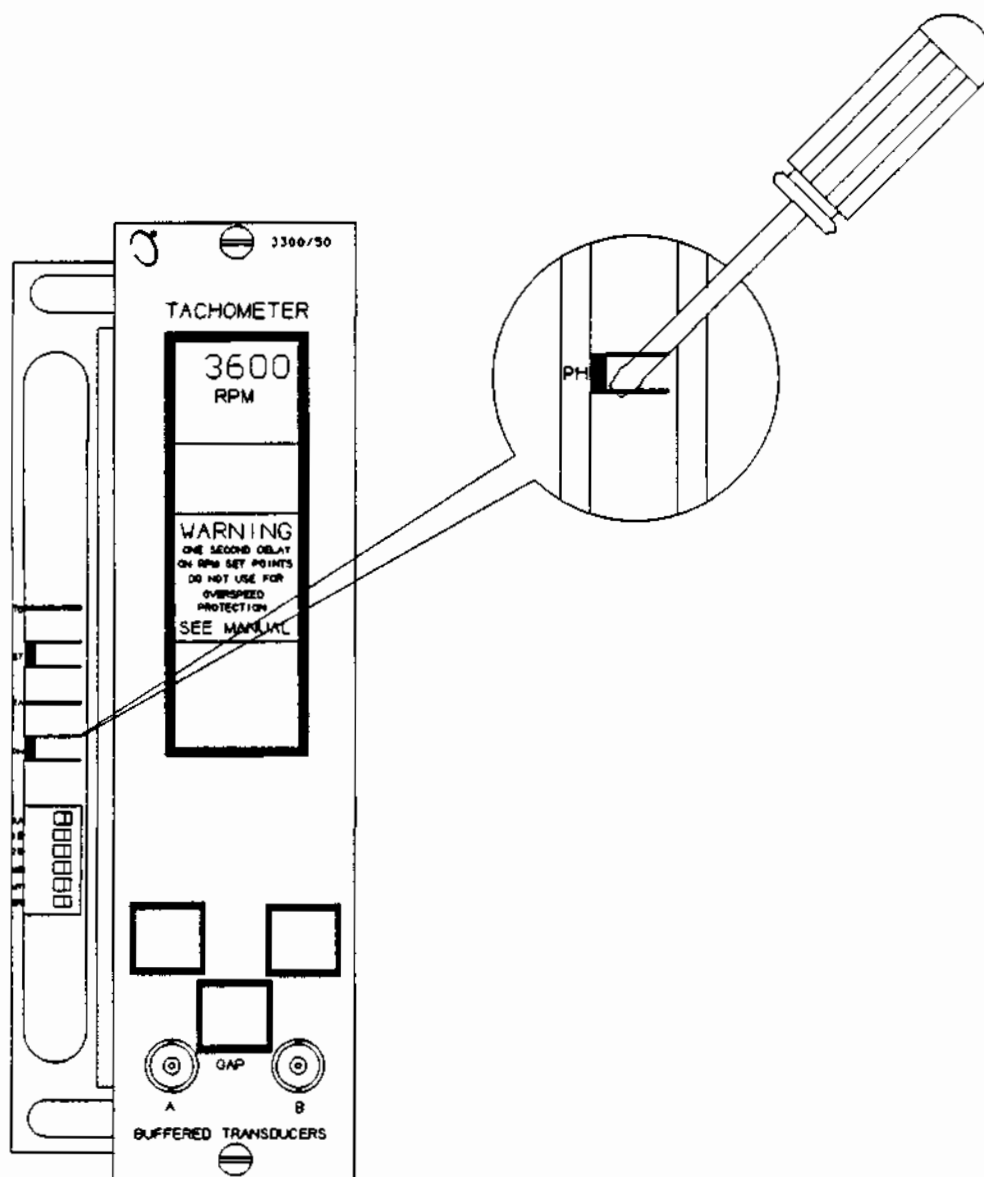





READ PEAK HOLD TO VERIFY THAT IT HAS BEEN CLEARED (SEE PREVIOUS PAGE).

20

ENABLE (ZERO SPEED TACHOMETER)

WHEN THE EXTERNAL ZERO SPEED ENABLE CONTACTS ARE OPEN, THE ENABLE INDICATOR WILL EXTINGUISH AND THE ZERO SPEED BYPASS LED WILL LIGHT. WHILE THESE CONTACTS ARE OPEN, A ZERO SPEED ALERT CANNOT OCCUR.

WHEN THE EXTERNAL ZERO SPEED ENABLE CONTACTS ARE CLOSED, THE ENABLE INDICATOR WILL SHOW AND THE BYPASS LED WILL EXTINGUISH (IF THE ZERO SPEED FUNCTION HAS NOT BEEN MANUALLY BYPASSED).

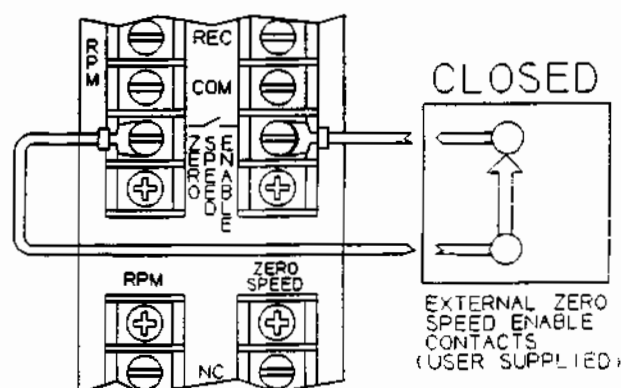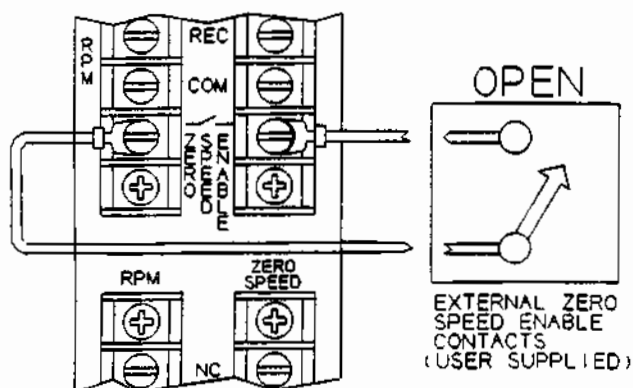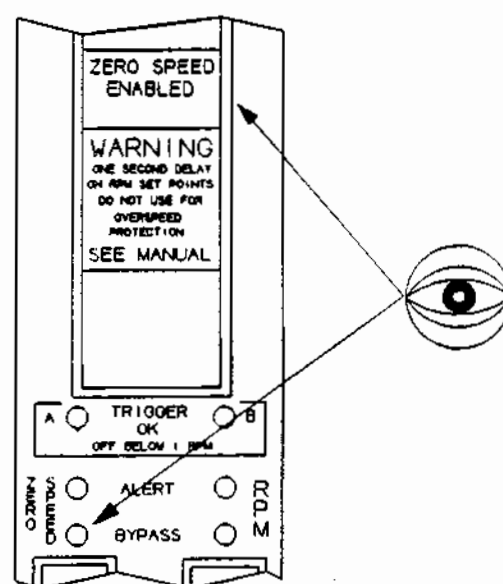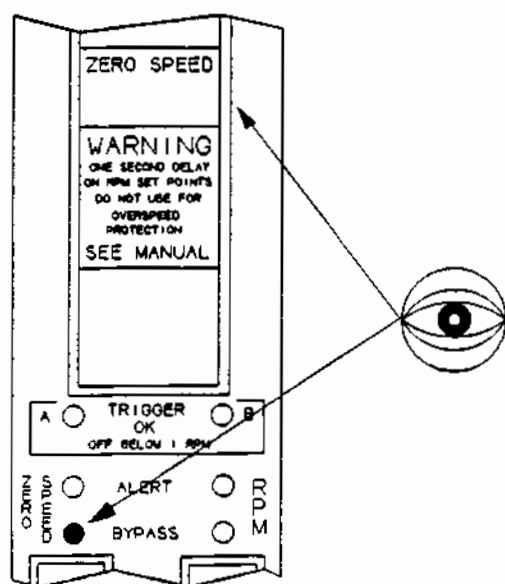


21 SELF TEST

THE MONITOR HAS THREE LEVELS OF SELF TESTS:

POWER-UP TEST: PERFORMED ONLY WHEN THE MONITOR IS TURNED ON.

CYCLIC TEST: PERFORMED CONTINUOUSLY.

USER-INVOKED TEST: PERFORMED ONLY WHEN INITIATED BY USER.

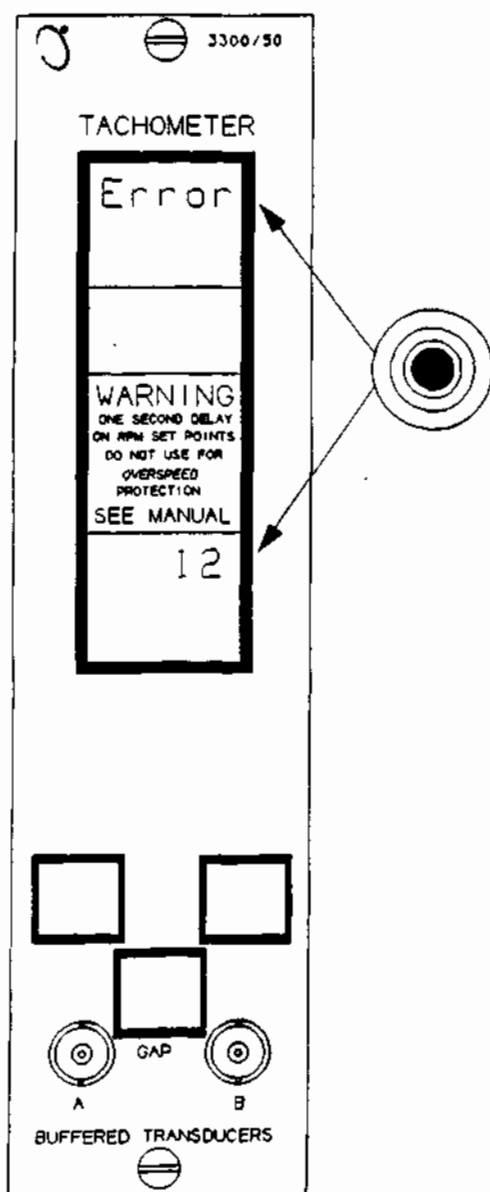

IF ERRORS ARE DETECTED DURING CYCLIC SELF TESTS:

MONITORING IS ABORTED UNTIL THE ERROR IS RESOLVED.

ERROR CODE IS STORED IN MEMORY AND FLASHED ON THE LCD DISPLAY.

BYPASS LED GOES ON AND OK LED FLASHES AT 5 HZ.

IF ERROR IS INTERMITTENT AND GOES AWAY, MONITORING IS RESUMED AND OK LED FLASHES AT 5 HZ.

ERROR CODE IS STORED. USER INVOKED-TEST DISPLAYS AND CLEARS ERROR.

IF ERRORS ARE DETECTED DURING POWER-UP TEST OR USER-INVOKED SELF TEST:


MONITORING IS ABORTED UNTIL USER ACTION RESOLVES PROBLEM.

TEST CAN BE RERUN WITH MONITOR POWER-UP OR USER-INVOKED TEST.

21

SELF TEST (CONT)


INITIATE USER-INVOKED TEST BY SHORTING ACROSS TWO SELF TEST (ST) PINS.

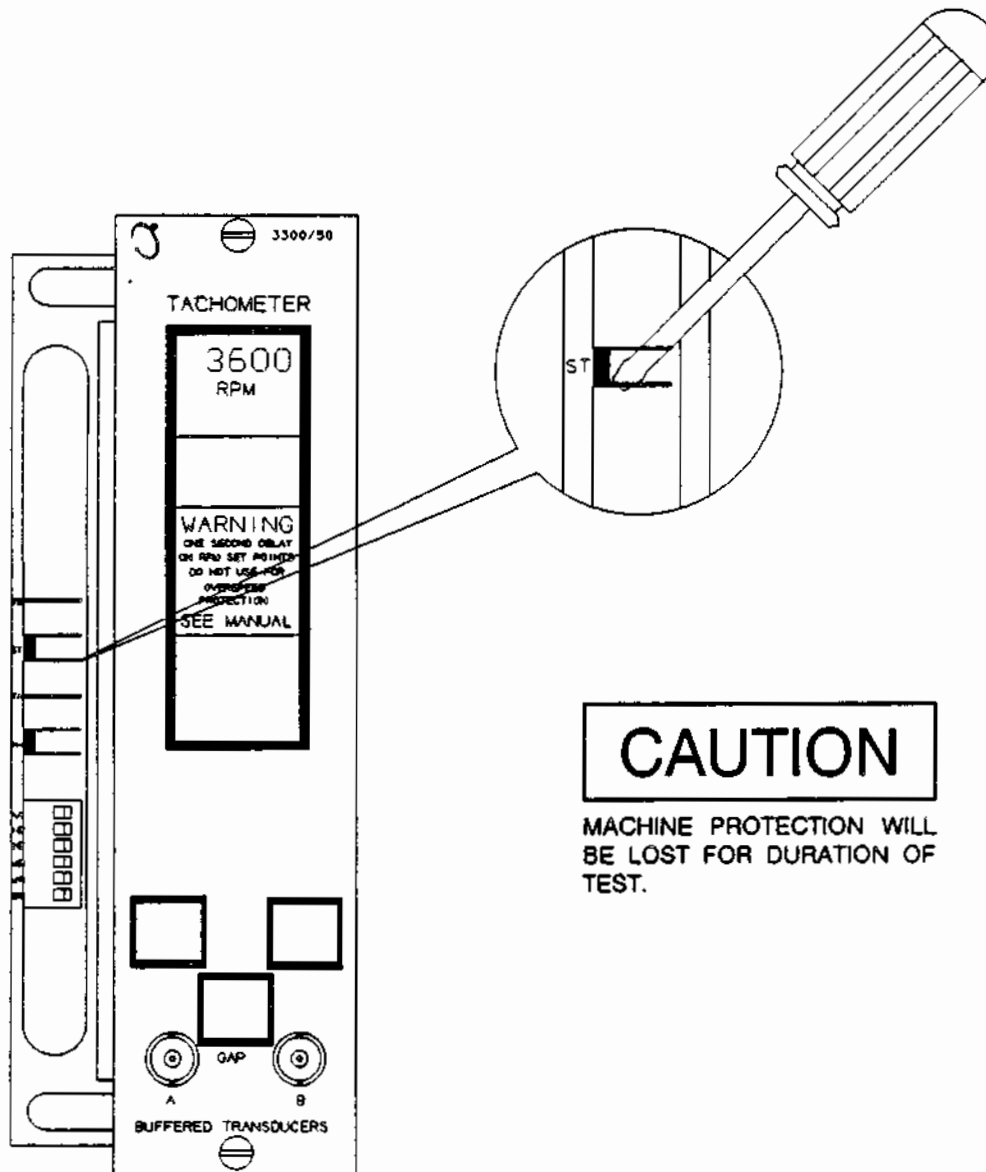


21

SELF TEST (CONT)

AT THE COMPLETION OF USER-INVOKED SELF TEST, THE MONITOR WILL RECALL STORED ERROR CODES, IF ANY. THESE ERROR CODES MUST BE READ AND CLEARED WITH USER INTERACTION TO ALLOW MONITORING TO CONTINUE.

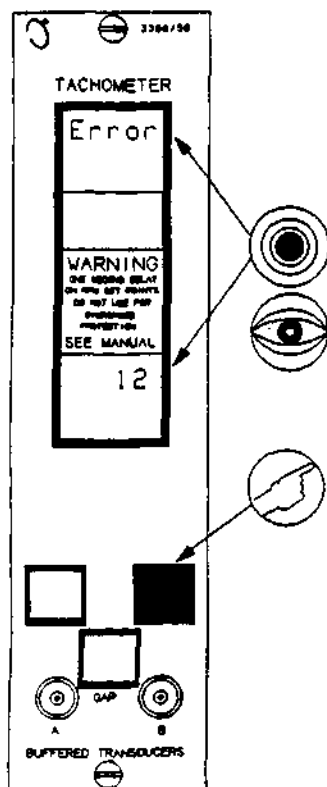


READ CODES ON LIST; STEP THROUGH EACH ERROR CODE ON LIST BY PRESSING AND HOLDING THE RIGHT ALERT SWITCH FOR APPROXIMATELY ONE SECOND.

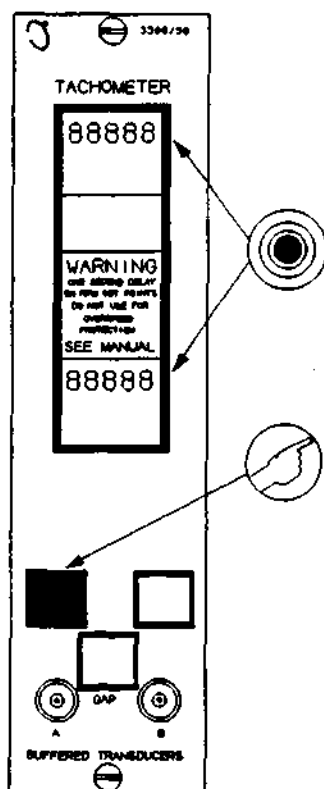

AT THE END OF THE LIST, THE LCD WILL DISPLAY ALL EIGHTS. TO REREAD THE LIST, PRESS THE RIGHT ALERT SWITCH. TO CLEAR THE LIST FROM MEMORY, PRESS AND HOLD THE LEFT ALERT SWITCH FOR APPROXIMATELY ONE SECOND.

21

SELF TEST (CONT)

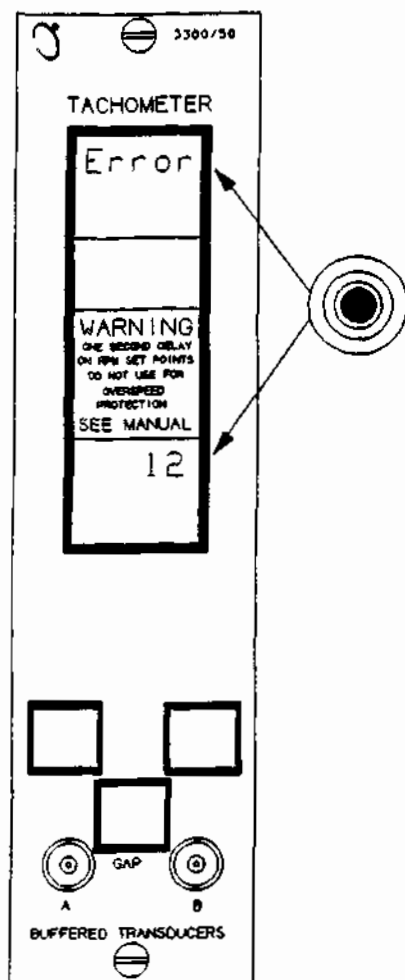

ERROR CODE

DESCRIPTION

2	ROM CHECKSUM HAS FAILED. *
3	EEPROM FAILURE NO. 1. **
4	EEPROM FAILURE NO. 2. *** ADJUST SETPOINTS
5	+7.5V/-VT NODE OUT OF TOLERANCE. **
6	+VRH NODE OUT OF TOLERANCE. **
7	+5V NODE OUT OF TOLERANCE. **
8	MVREF NODE OUT OF TOLERANCE. **
9	+7.5V NODE OUT OF TOLERANCE. **
10	+VRL NODE OUT OF TOLERANCE. **
12	+5V/-7.5V NODE OUT OF TOLERANCE. **
14	RAM FAILURE. *
17	COP WATCHDOG NOT CONFIGURED. *
21	INCORRECT SWITCH OR SWITCH COMBINATION. ****
32	AUTO THRESHOLD OR MAGNETIC PICKUP NOT ALLOWED WITH A ZERO SPEED TACHOMETER.
33	THE PROCESSOR HAS NOT BEEN PROGRAMMED FOR THE TACHOMETER TYPE. *
34	THE INPUT FREQUENCY TO THE TACHOMETER IS TOO HIGH FOR PROPER OPERATION.

- * TESTED ONLY AT POWER-UP OR USER-INVOKED SELF TEST. THIS ERROR IS DISPLAYED ON THE FRONT PANEL BUT IS NOT STORED IN MEMORY.
- ** TESTED ONLY AT CYCLIC SELF TEST. ERRORS 2, 3 AND 14 ARE NONRECOVERABLE AND ERRORS 5 THROUGH 12 COULD BE INTERMITTENT AND RECOVERABLE.
- *** ERROR 4 IS A SETPOINT FAILURE AND MAY BE CORRECTED BY ADJUSTING ALL SETPOINTS IN THE MONITOR.
- **** TESTED ONLY WHEN MONITOR IS IN SETUP MODE.

	PAGE
ALERT	7
ALERT BYPASS	7
ALERT RELAYS	7
BUFFERED OUTPUTS	7
CYCLIC TEST	23
ERROR CODE	26
FIRST OUT	13, 14, 15
FIRST OUT ALERT	7
GAP	16
MONITOR BYPASS	7
MONITOR OK	8
OK RELAY	6
PART NUMBER	4
PEAK HOLD	7, 20
PEAK HOLD RESET	21
POWER-UP TEST	23
PROBE GAP VOLTAGE	6
RECORDER OUTPUT	7
ROTOR ACCEL ALERT	15
ROTOR ACCELERATION	6
ROTOR SPEED MONITORING	6
RPM ALERT	13, 14, 15
SELF TEST	8, 23
SETPOINT	17, 18, 19
TRIGGER OK	6
USER-INVOKED TEST	23
ZERO SPEED	6
ZERO SPEED ALERT	14




3300/50 TACHOMETER

INCLUDES DUAL SETPOINT, ZERO SPEED, AND
ROTOR ACCELERATION TACHOMETERS.


MAINTENANCE MANUAL

BENTLY
NEVADA 

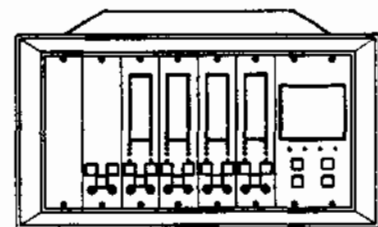

NOTICE**READ THE FOLLOWING BEFORE INSTALLING OR OPERATING EQUIPMENT**

Bently Nevada Corporation has attempted to identify areas of risk created by improper installation and/or operation of this product. These areas of information are noted as **WARNING** or **CAUTION** for your protection and for the safe and effective operation of this equipment. Read all instructions before installing or operating this product. Pay particular attention to those areas designated by the following symbols.

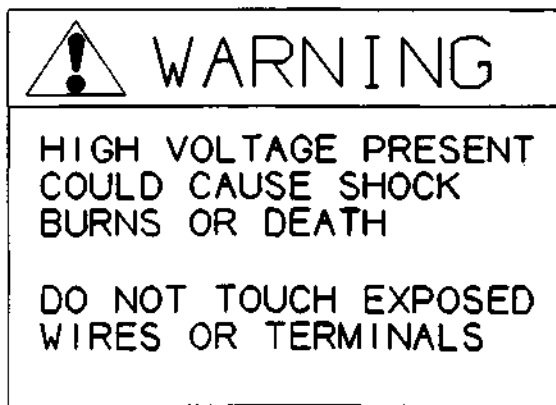**CAUTION**

Machine Protection
Will Be Lost

SYMBOLS

Special symbols are used in the manual to illustrate specifics in the step-by-step processes. For example:

**PRESS****FLASHING****CONNECT****DISCONNECT****OBSERVE****SCREWDRIVER**

NOTICE**WARNING !**

Bently Nevada Tachometers are not designed for use independently as, or a component of, a speed control or overspeed protection system.

Bently Nevada Tachometers do not provide protective redundancy and the response speed needed for reliable operation as a speed control or overspeed protection system.

Where provided, the analog proportional output is suitable for data logging or chart recording purposes only. Also, where provided, speed Alert setpoints are suitable for annunciation purposes only.

Failure to take the above warnings into account constitutes a misuse of the product and may result in property damage and/or bodily injury.

Blank Page

FORWARD

This document is intended for personnel who maintain the 3300 Monitoring System. The procedures are presented in step-by-step, graphic format.

RELATED DOCUMENTS

3300 System Overview, 80177

3300 System Installation Instructions, 80172

3300 System Troubleshooting, 80173

3300/10 Power Supply, 80174

3300/01 System Monitor, 80175

3300/50 Tachometer Operation, 83870-01

Dynamic Data Manager System, 46390-01

Keyphasor® is a registered trademark of Bently Nevada Corporation

Proximator® is a registered trademark of Bently Nevada Corporation

Document No. 83871-01 First Printing: March 1989 Revision NC: March 1989

Copyright© 1989 Bently Nevada Corporation

All Rights reserved

No part of this publication may be reproduced, transmitted, stored in a retrieval system nor translated into any human or computer language, in any form or by any means, electronic, mechanical, magnetic, optical, chemical, manual, or otherwise, without the prior written permission of the copyright owner,

Bently Nevada Corporation
P.O. Box 157
Minden, Nevada 89423 USA
Telephone 800-227-5514 702-782-3611
Telex 7400983 BNC UC
Fax 702-782-9253

Copyright infringement is a serious matter under
United States of America and Foreign Copyright Laws

Blank Page

CONTENTS


SECTION	TITLE	PAGE
	SYSTEM OVERVIEW	
1	DUAL SETPOINT TACHOMETER	1
2	ZERO SPEED TACHOMETER	2
3	ROTOR ACCELERATION TACHOMETER	3
	FRONT PANEL FEATURES	
4	DUAL SETPOINT TACHOMETER	4
5	ZERO SPEED TACHOMETER	5
6	ROTOR ACCELERATION TACHOMETER	6
7	MONITOR REMOVAL	7
8	MONITOR DISASSEMBLY	8
9	SIGNAL INPUT RELAY MODULE	10
10	MONITOR OPTIONS	11
11	MONITOR FULL SCALE RANGE ADJUSTMENT	15
12	EVENTS PER REVOLUTION ADJUSTMENT	18
13	THRESHOLD AND HYSTERESIS ADJUSTMENTS	24
	ADJUST ALERT SETPOINTS	
14	DUAL SETPOINT TACHOMETER	28
15	ZERO SPEED TACHOMETER	30
16	ROTOR ACCELERATION TACHOMETER	32
	BYPASS	
17	DUAL SETPOINT TACHOMETER	34
18	ZERO SPEED TACHOMETER	35
19	ROTOR ACCELERATION TACHOMETER	36
	MONITOR BYPASS	
20	DUAL SETPOINT TACHOMETER	37
21	ZERO SPEED TACHOMETER	38
22	ROTOR ACCELERATION TACHOMETER	39

CONTENTS

SECTION	TITLE	PAGE
	TEST ALERTS	
23	DUAL SETPOINT TACHOMETER	40
24	ZERO SPEED TACHOMETER	42
25	ROTOR ACCELERATION TACHOMETER	44
26	TEST TRIGGER OKs	46
27	SELF TEST	48
	FIELD WIRING DIAGRAMS	
28	DUAL SETPOINT TACHOMETER	52
29	ZERO SPEED TACHOMETER	54
30	ROTOR ACCELERATION TACHOMETER	56
31	RECOMMENDED SPARE PARTS	58
32	SPECIFICATIONS	59
33	INDEX	62
34	SCHEMATICS AND TECHNICAL DRAWINGS	63


1

DUAL SETPOINT TACHOMETER SYSTEM

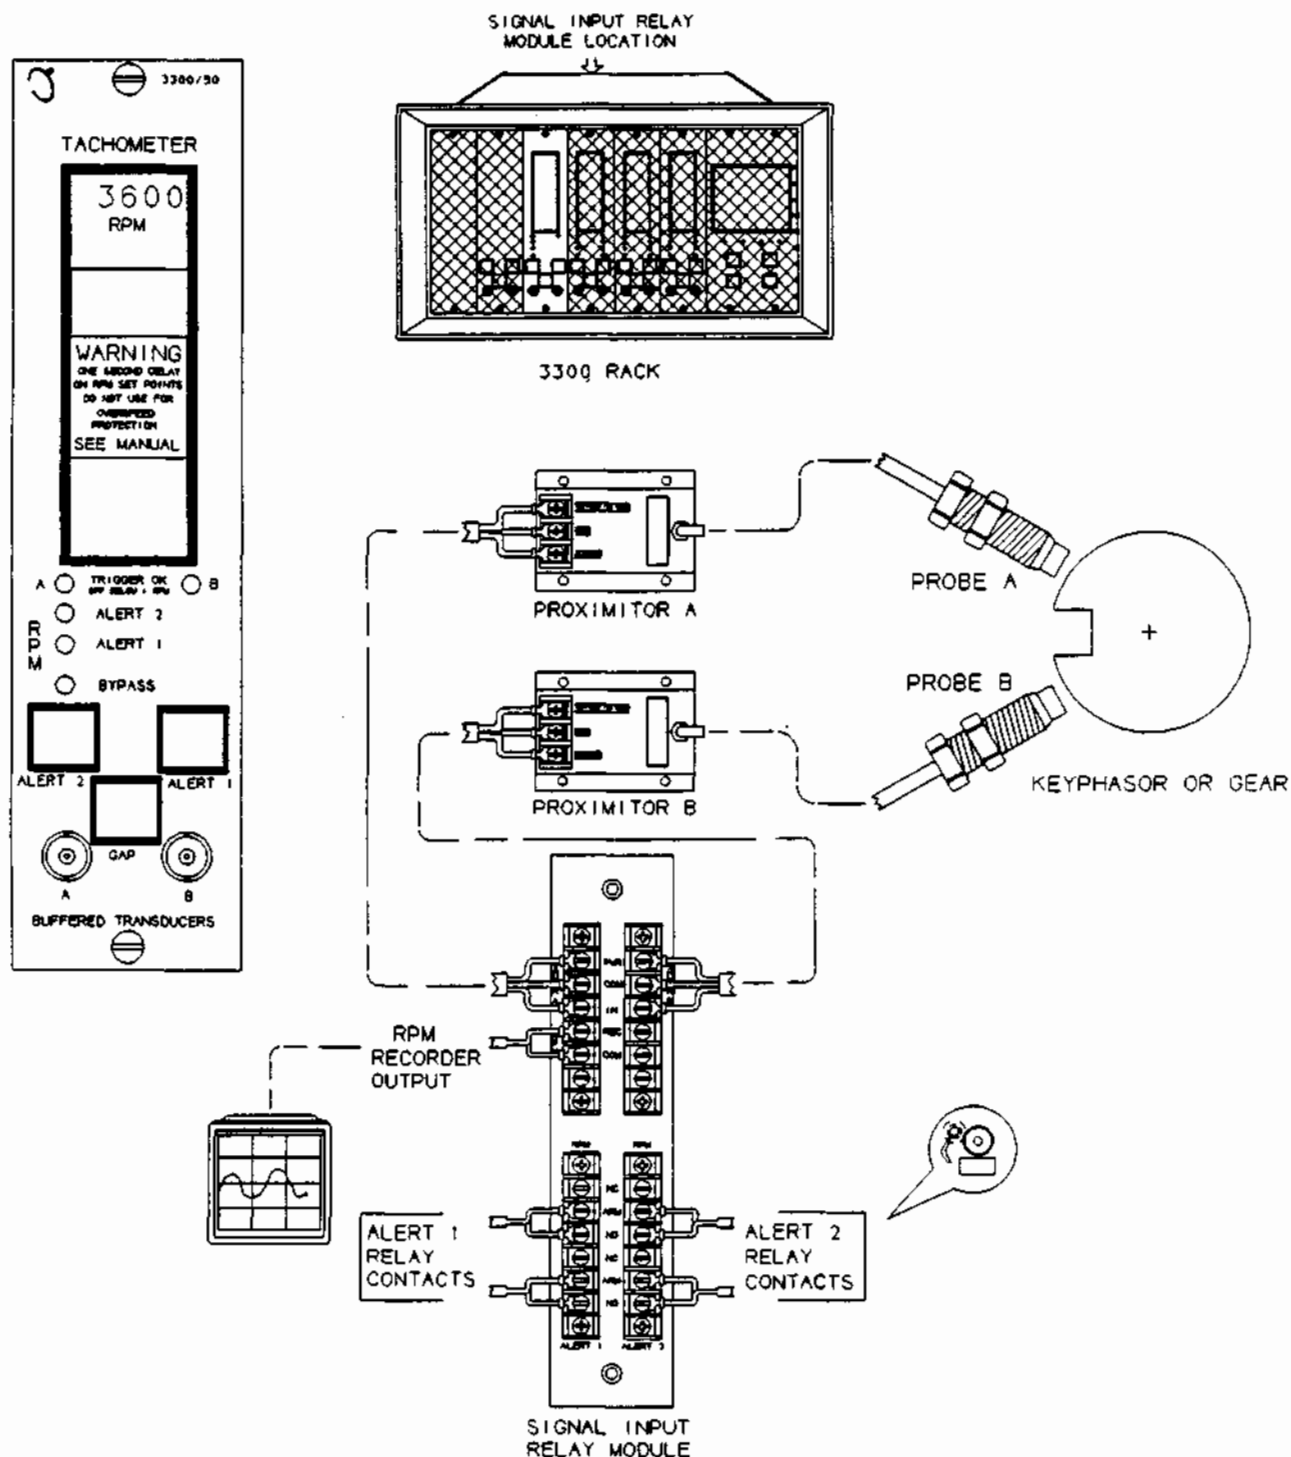


2

ZERO SPEED TACHOMETER SYSTEM

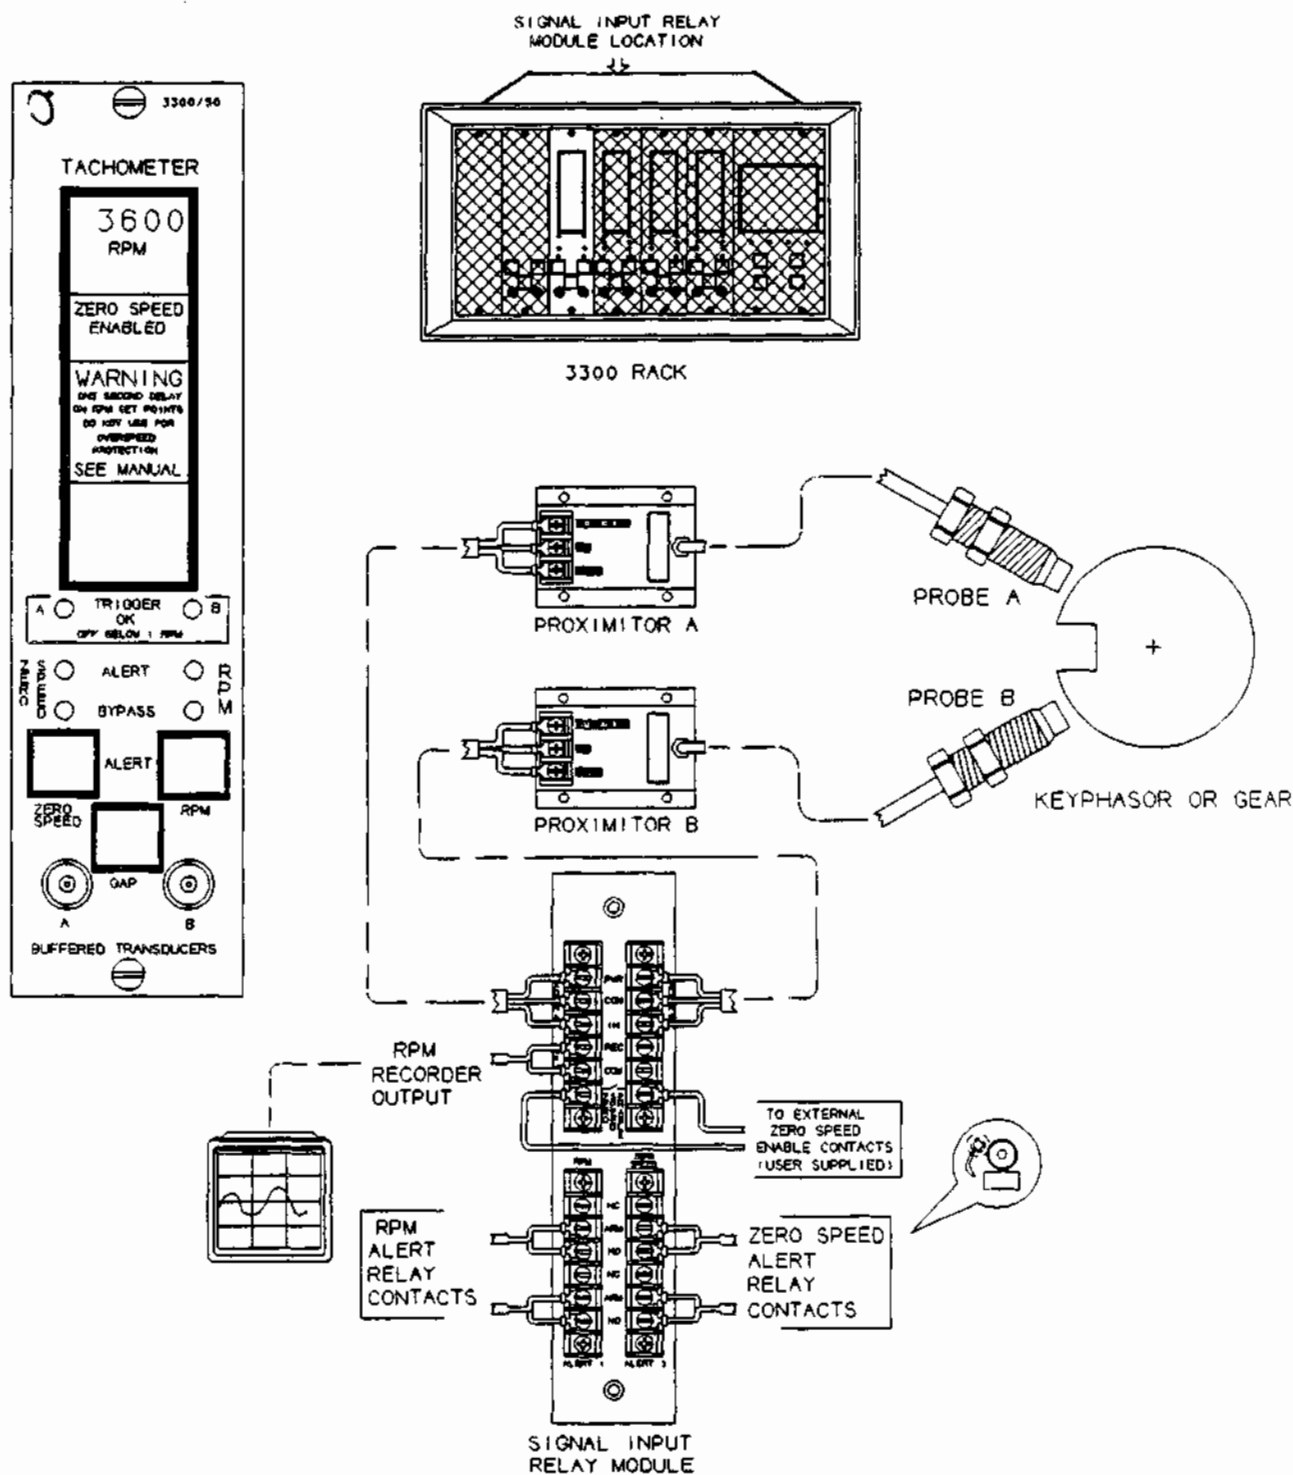


3

ROTOR ACCELERATION TACHOMETER SYSTEM

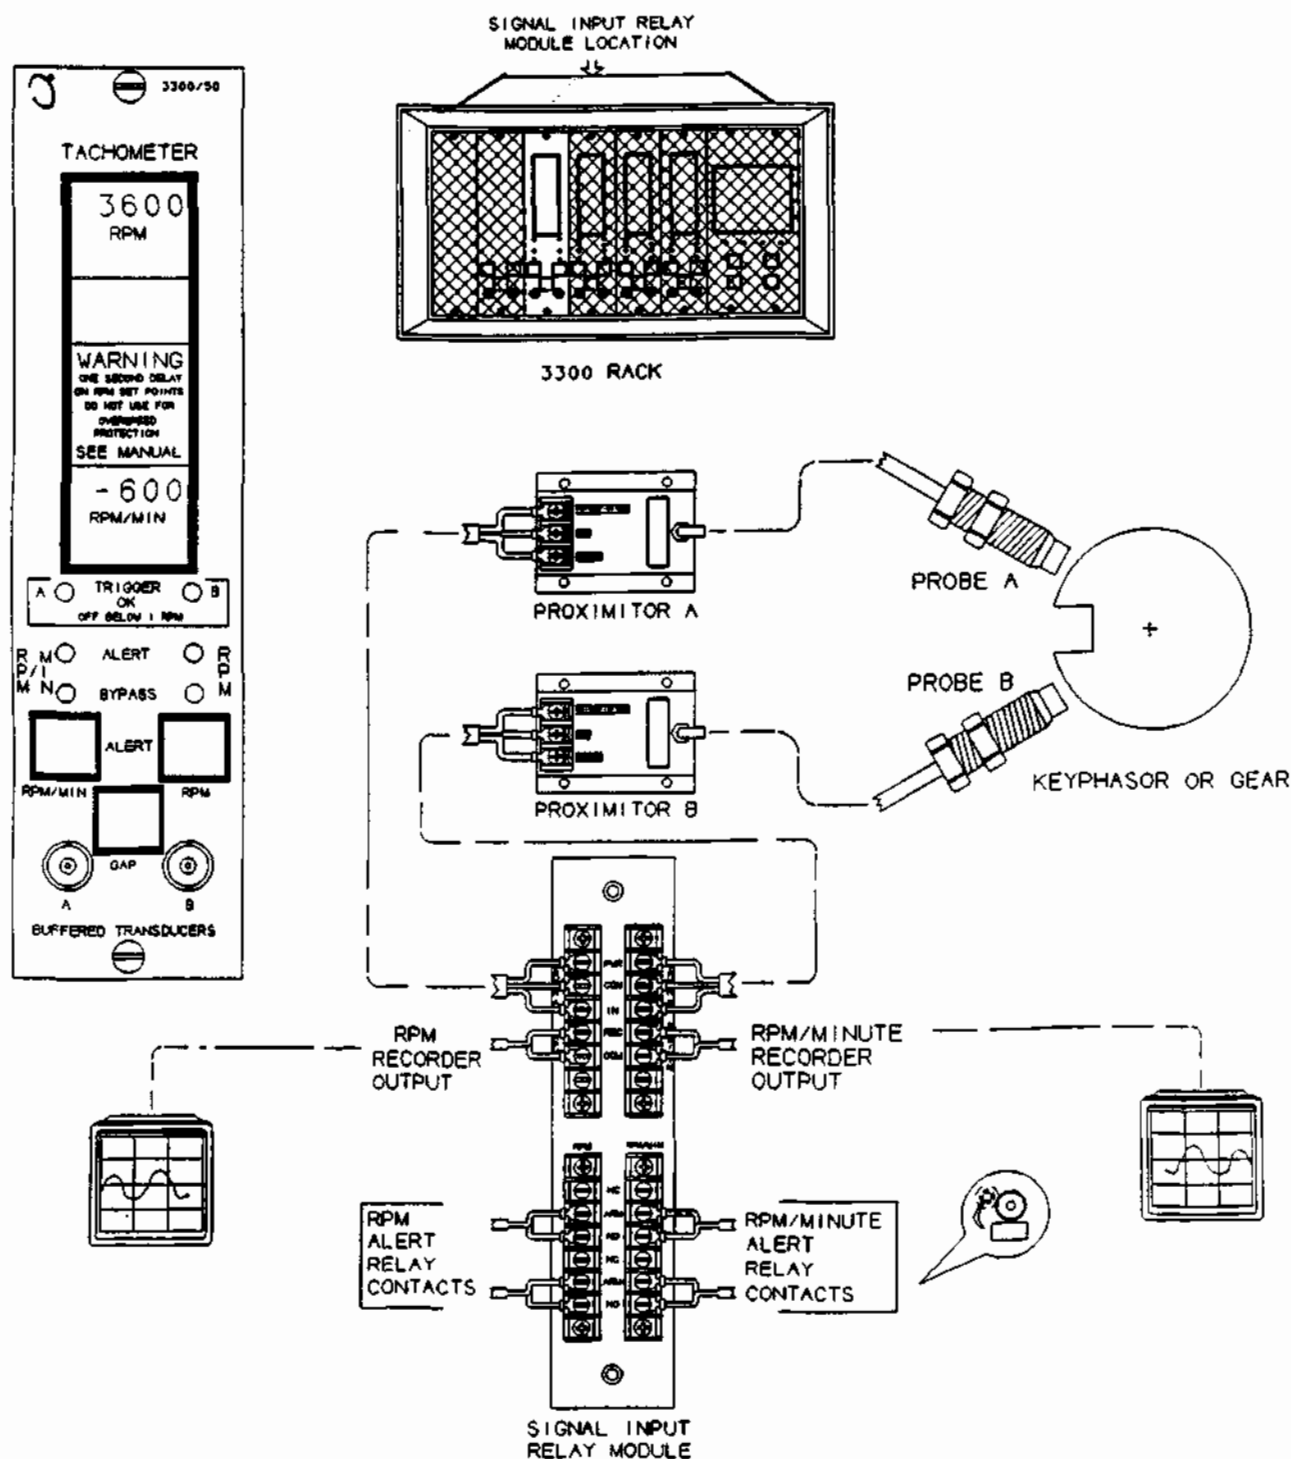


4

FRONT PANEL (DUAL SETPOINT TACHOMETER)

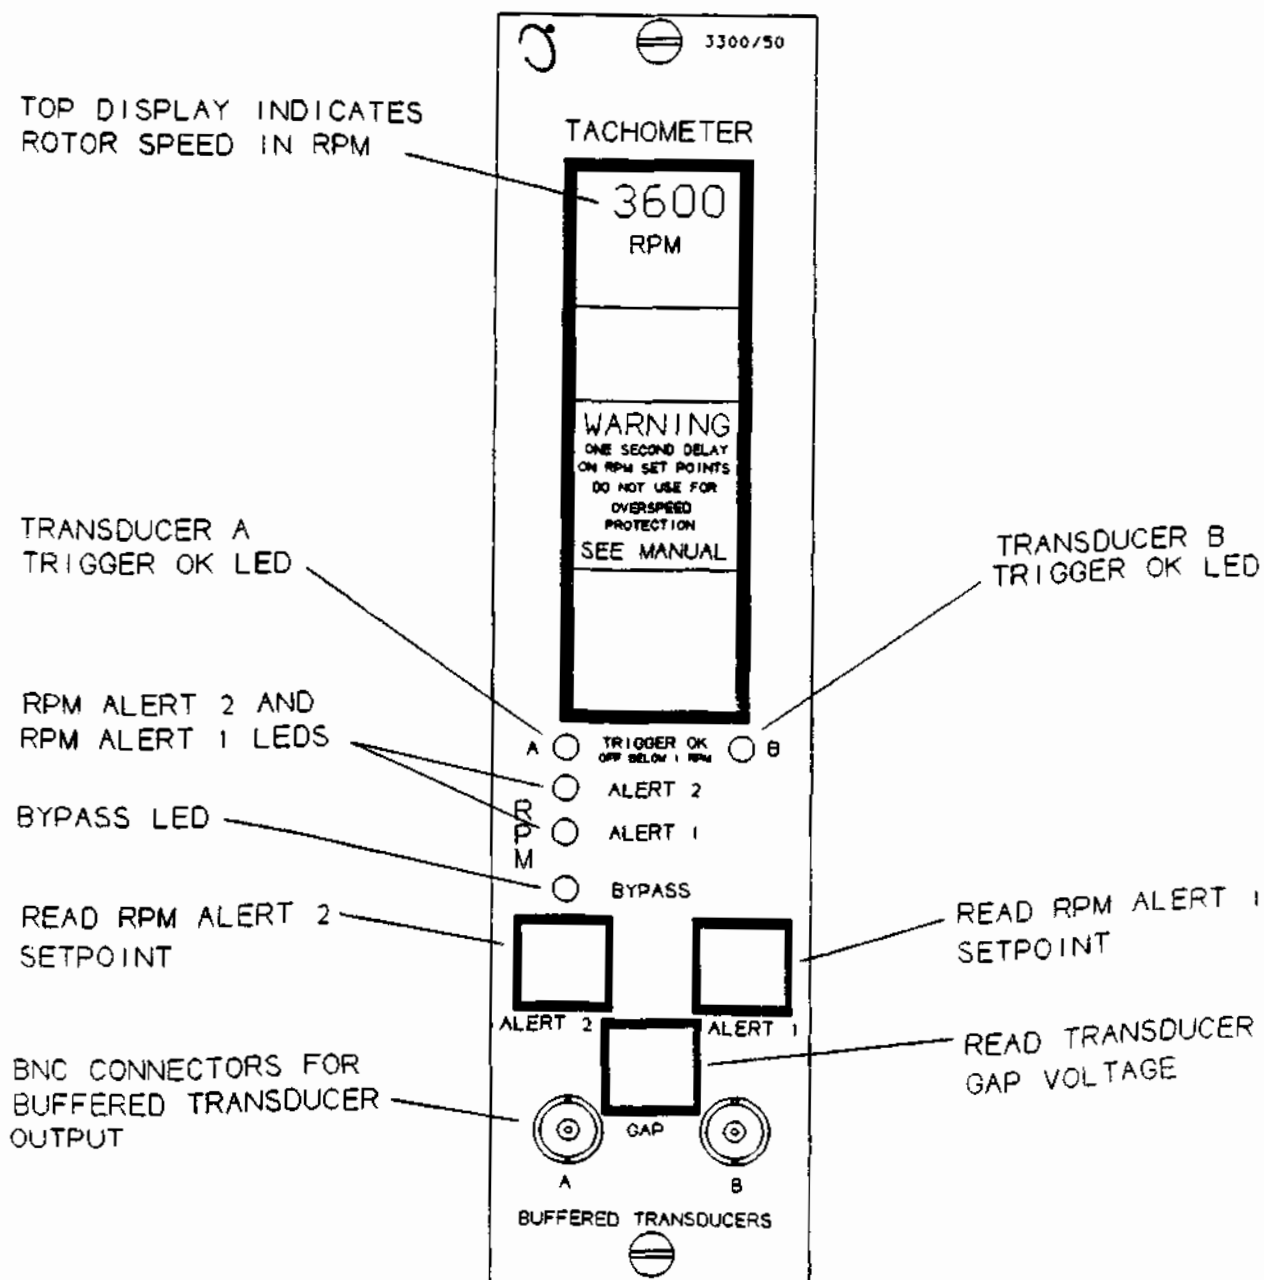


5

FRONT PANEL (ZERO SPEED TACHOMETER)

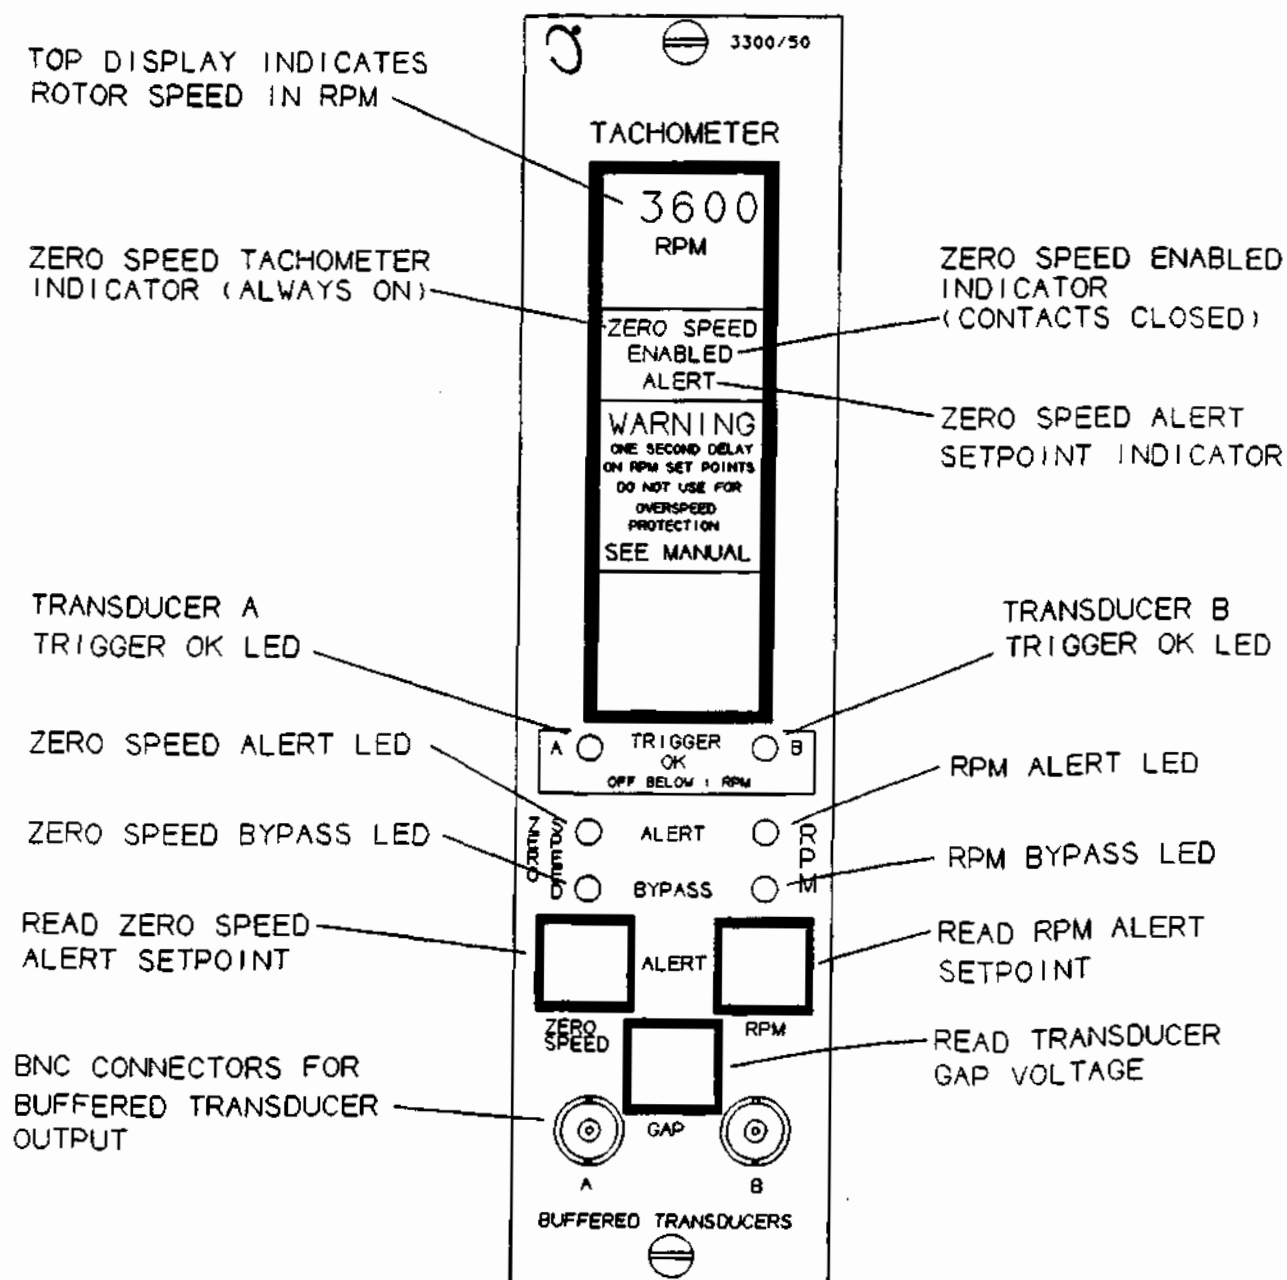

6 FRONT PANEL (ROTOR ACCEL. TACHOMETER)

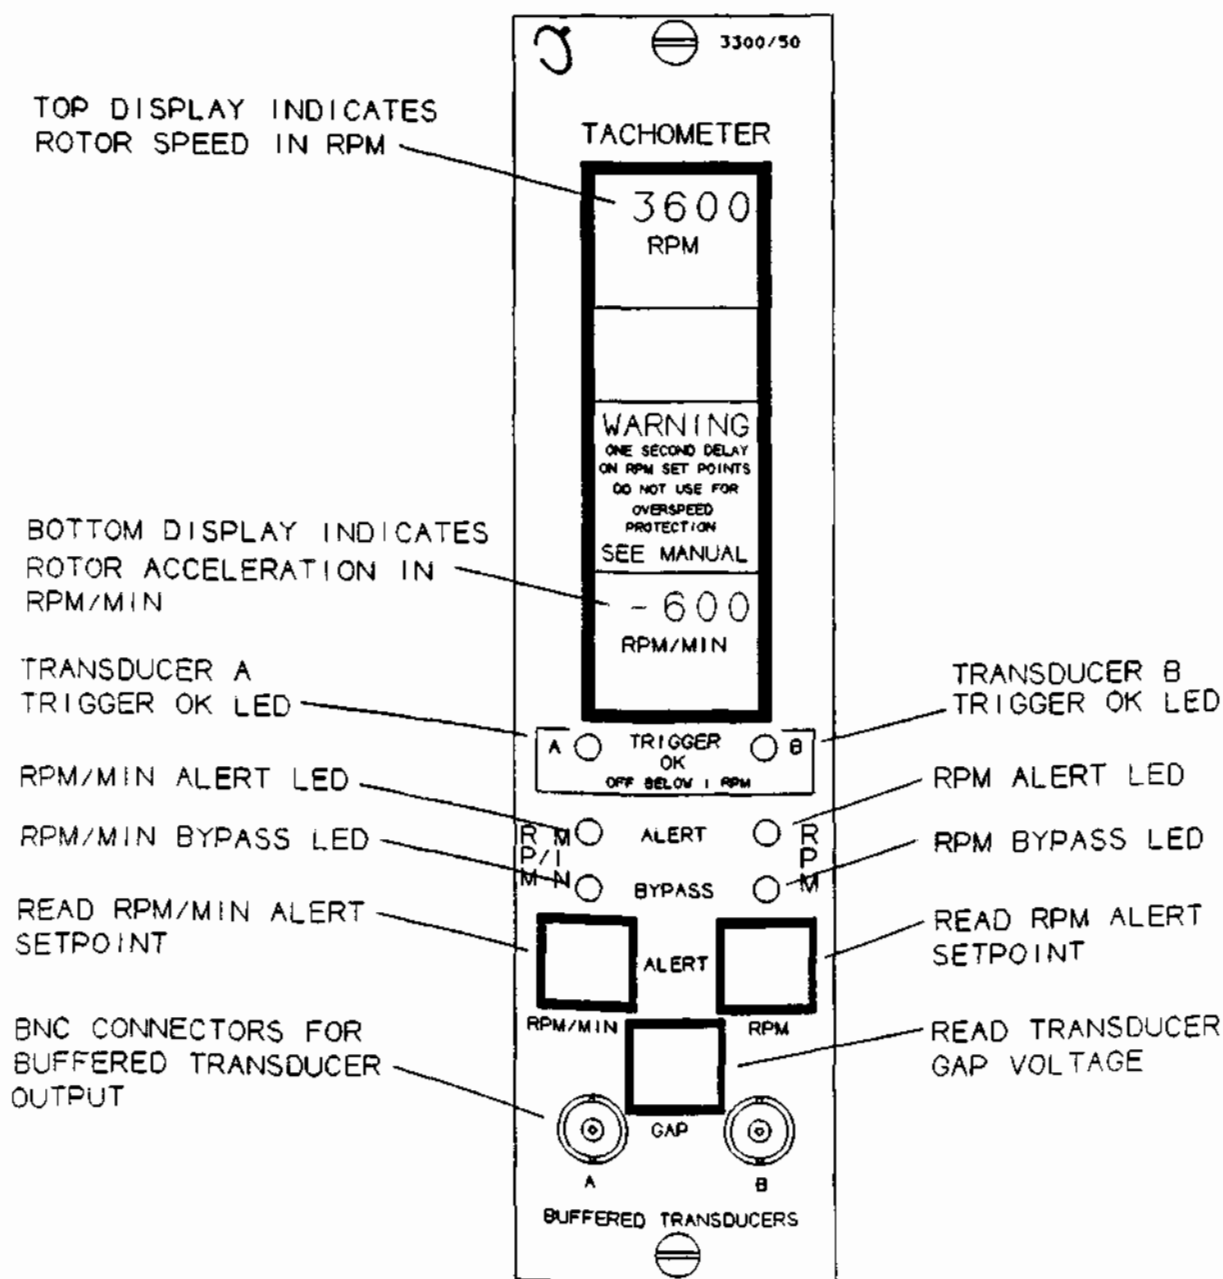


7

Monitor Removal

CAUTION

The machine is not protected when the monitor is removed from the rack.

1. Loosen two screws.
2. Pull monitor from rack.

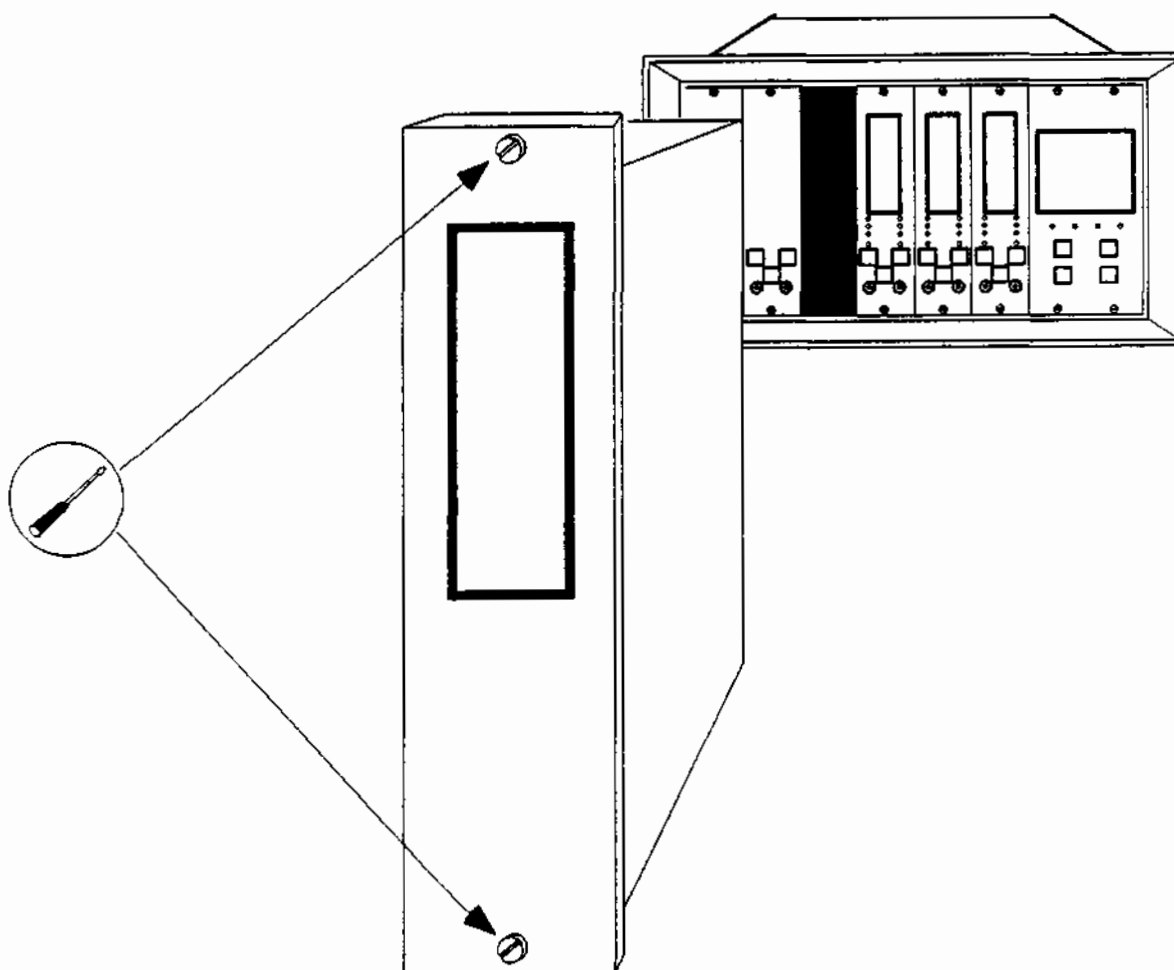


8


Monitor Disassembly

Side Cover Removal

Squeeze the retaining tips on each standoff, and remove the side cover from the monitor.

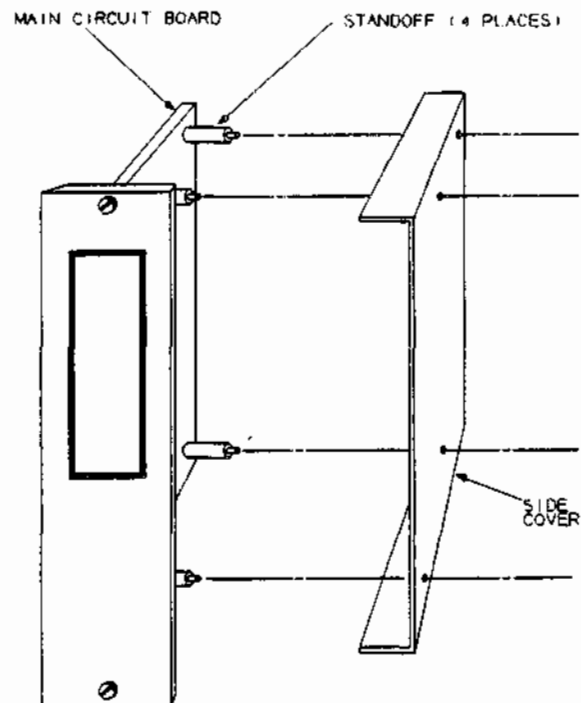**Circuit Board Removal**


Squeeze the retaining tips on each standoff, and remove the expander board from the main board.

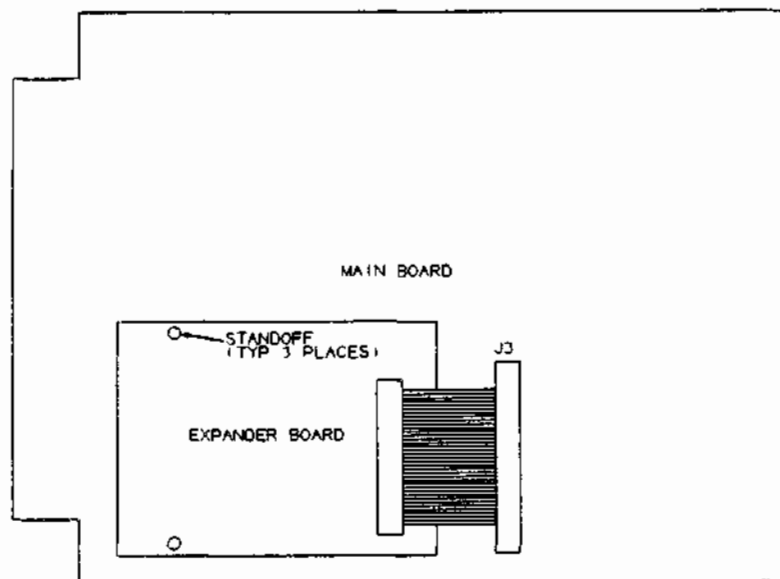

8

Monitor Disassembly [Cont]

Front Panel Removal

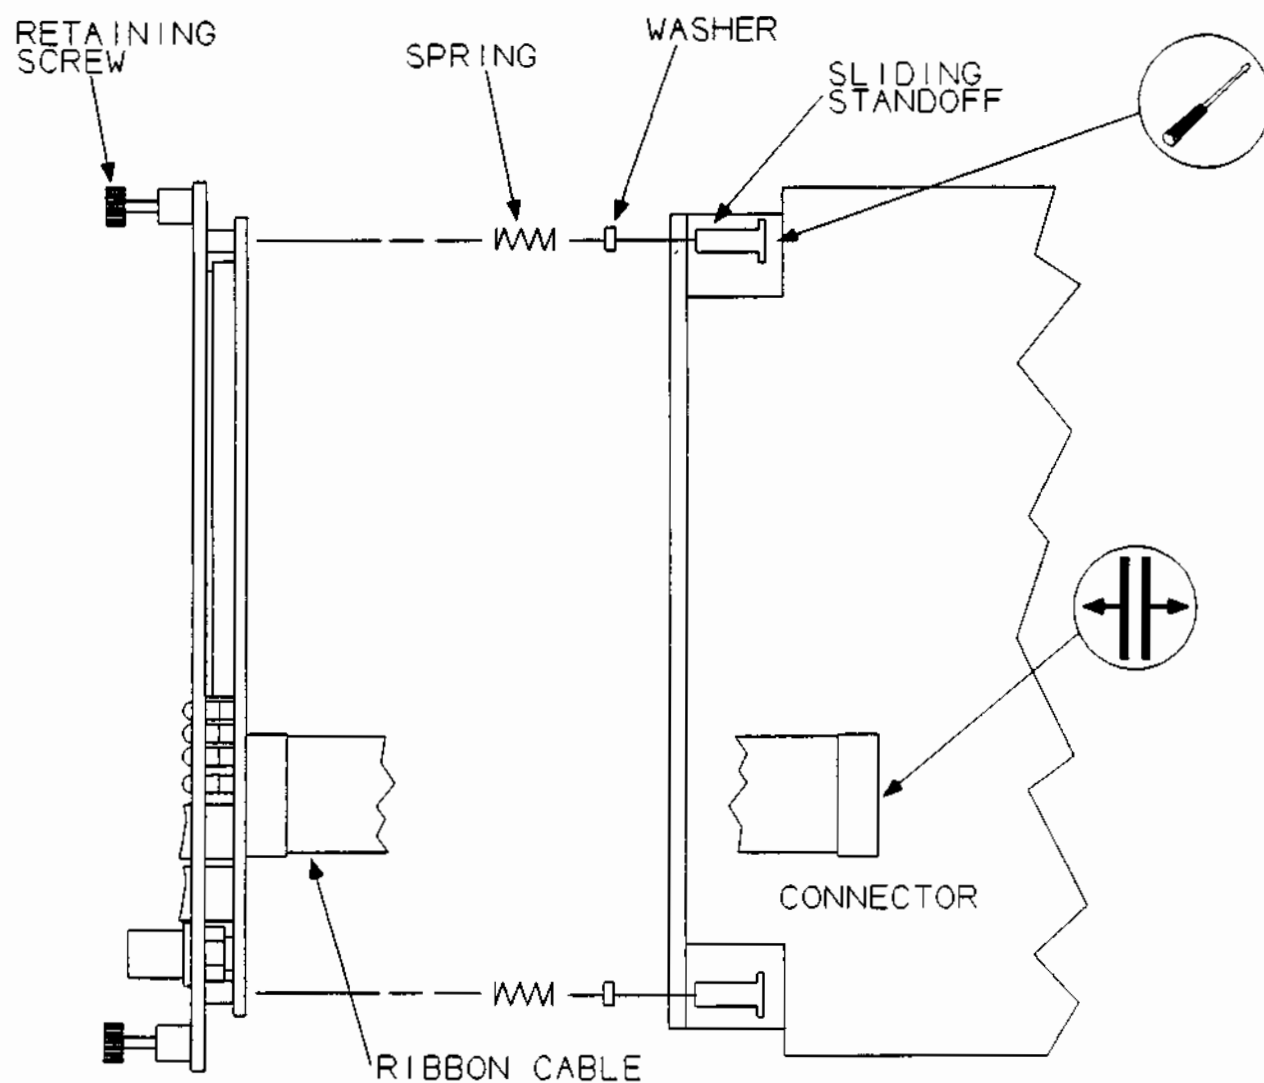

9

Signal Input Relay Module

**WARNING**


High Voltage present
Could cause shock, burns
or death.

Do Not touch exposed
wires or terminals.


The Signal Input Relay Module is on the back of the rack. For relay configuration, see Installation Manual. For field wiring, see Sections 27,28 and 29 (Field Wiring Diagrams).

Module Removal

Loosen two screws and remove the module.

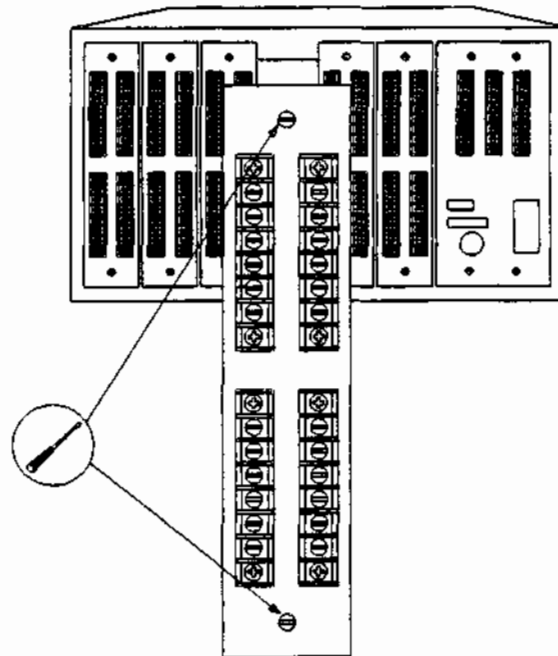**Module Options**

Alert 1 Relay	Jumper	
	In	Out
Normally Energized	W3	W4,W11
Normally De-energized	W4,W11	W3
Alert 2 Relay	Jumper	
	In	Out
Normally Energized	W2	W1,W12
Normally De-energized	W1,W12	W2

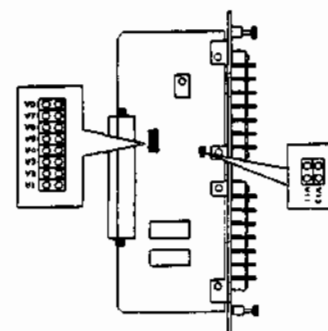**Alert Relays**

	Tachometer Type		
	Dual Setpoint	Zero Speed	Rotor Accel
Alert 1 Relay	RPM Alert 1	RPM Alert	RPM Alert
Alert 2 Relay	RPM Alert 2	Zero Speed Alert	RPM/MIN Alert


10

Monitor Options

TACHOMETER
PART NUMBER

TACHOMETER TYPE	ALERT RELAYS	AGENCY APPROVAL	BARRIERS
3300/50 — AA —	BB —	CC —	DD —
01 = DUAL SETPOINT TACHOMETER	00 = NONE	00 = NOT REQ'D	00 = NOT REQ'D
02 = ZERO SPEED TACHOMETER	01 = 5 AMP EPOXY SEALED	01 = CSA	01 = WITH BARRIERS
03 = ROTOR ACCELERATION TACHOMETER	02 = 5 AMP HERMETICALLY SEALED	02 = BASEEFA	
		03 = FACTORY MUTUAL	

The Tachometer has several user-programmable options. The options can be changed by removing and installing jumpers.

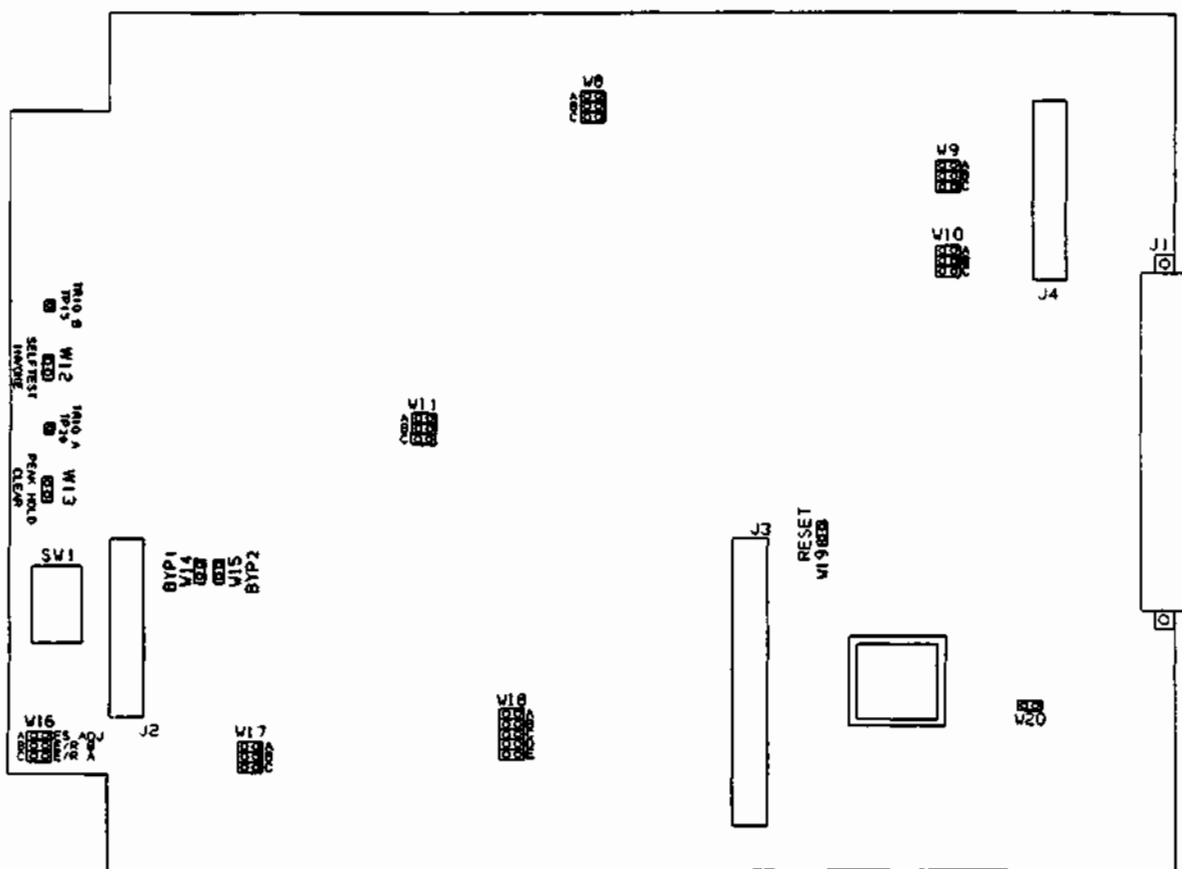

Jumper Locations on the Main Circuit Board

10 Monitor Options (Cont)

Main Board Option Settings

All monitor options, except for the Recorder options, are located on the Tachometer Main Board. Table 1 shows these options and their jumper positions.

Table 1 Option Settings on the Main Board

Option	Jumper	
	Install	Remove
Transducer Input:		
Transducer A		
System, Rack Keyphasor 1	W10C	W10A,B, 18A
* Monitor Signals, 7200 or 3000 Proximitors	W10A	W10B,C, 18A
Monitor Signals, Magnetic Pickup (Note 1)	W10A,B, 18A	W10C
Transducer B		
System, Rack Keyphasor 2	W9C	W9A,B, 18A
* Monitor Signals, 7200 or 3000 Proximitors	W9A	W9B,C, 18A
Monitor Signals, Magnetic Pickup (Note 1)	W9A,B, 18A	W9C
Transducer Conditioning:		
Threshold Mode (Note 2)		
Manual	-----	W17C
* Auto	W17C	-----
Hysteresis Transducer A		
0.2 Volts	W11B	W11A,C
* 0.5 Volts	W11C	W11A,B
1.0 Volts	W11A	W11B,C
2.0 Volts	-----	W11A,B,C
Hysteresis Transducer B		
0.2 Volts	W8B	W8A,C
* 0.5 Volts	W8C	W8A,B
1.0 Volts	W8A	W8B,C
2.0 Volts	-----	W8A,B,C

* Options as shipped from factory

Note 1: Magnetic Pickups are not Recommended for Zero Speed Applications.

Note 2: The Zero Speed Tachometer is Shipped in the Manual Threshold Mode.

10 Monitor Options (Cont)

Table 1 Option Settings on the Main Board (Continued)

Option	Jumper	
	Install	Remove
Alert Modes:		
Alert 1 (See Table 2)		
* Over Alert	W18B	_____
Under Alert	_____	W18B
* Latching Alert	W18C	_____
Nonlatching Alert	_____	W18C
Alert 2 (See Table 2)		
* Over Alert (Note 3)	W18D	_____
Under Alert	_____	W18D
* Latching Alert	W18E	_____
Nonlatching Alert	_____	W18E
First Out Alert Option: (Note 4)		
* First Out Alert Enable	W17A	_____
First Out Alert Disable	_____	W17A
Monitor Options: (Note 5)		
Alert 1 (See Table 2)		
Bypass Switch Enable	W14	_____
* Bypass Switch Disable	_____	W14
Alert 2 (See Table 2)		
Bypass Switch Enable	W15	_____
* Bypass Switch Disable	_____	W15

* Options as shipped from factory

Note 3: W18D has no affect on the Zero Speed Alert. Zero Speed is always an Under Alert.

Note 4: All Alerts drive the rack First Out Alert Bus. The Tachometers do not drive the rack First out Danger Bus.

Note 5: W14 has no affect on the Dual Setpoint Tachometer. Only the RPM Alert 2 Relay may be Bypassed on the Dual Setpoint Tachometer.


Note 6: W18D has no affect on the Rotor Accel Tachometer. Rotor Accel is always an Over Alert.

Table 2, Alerts

	Tachometer Type		
	Dual Setpoint	Zero Speed	Rotor Accel
Alert 1	RPM Alert 1	RPM Alert	RPM Alert
Alert 2	RPM Alert 2	Zero Speed Alert	RPM/MIN Alert

10

Monitor Options (Cont)

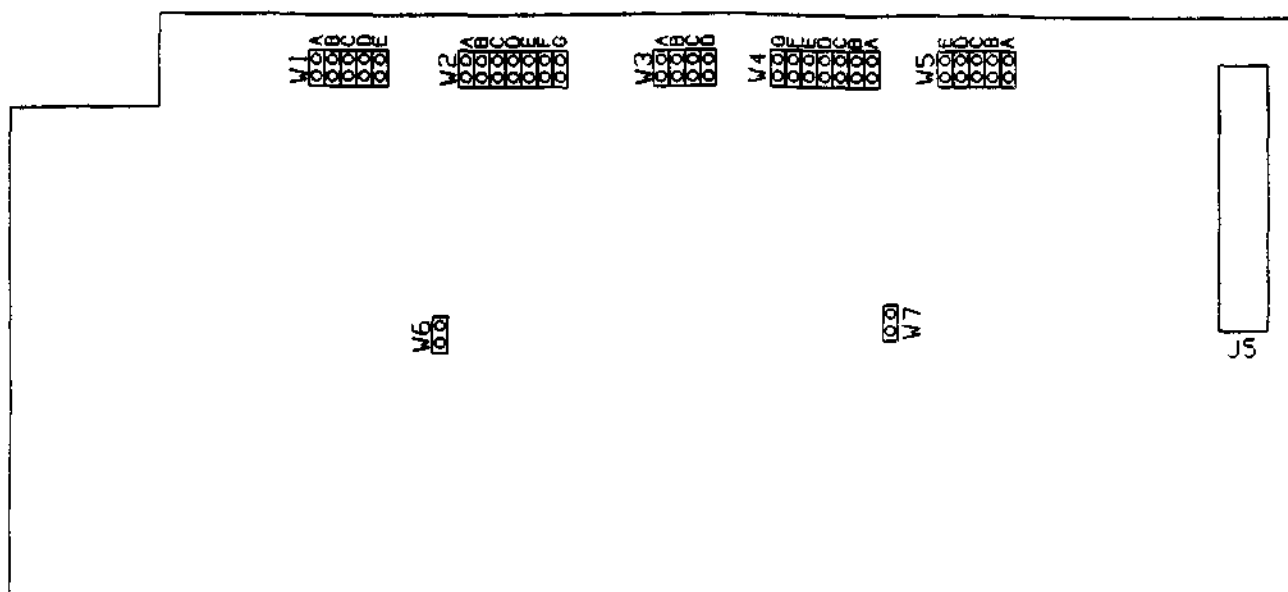

Jumper Locations on the Recorder Piggy Board

Table 3 Option Settings on the Recorder Piggy Board

Recorder Option	Jumper	
	Install	Remove
+4 to +20 mA	W1B,C,D W2B,D,E W3A,C W4B,D,E W5B,C,D	W1A,E W2A,C,F,G W3B,D W4A,C,F,G W5A,E W6 W7
+1 to +5 Vdc	W1A,E W2C,F W3A,C W4C,F W5A,E	W1B,C,D W2A,B,D,E,G W3B,D W4A,B,D,E,G W5B,C,D W6 W7
0 to -10 Vdc	W1A,E W2A,G W3B,D W4A,G W5A,E	W1B,C,D W2B,C,D,E,F W3A,C W4B,C,D,E,F W5B,C,D W6 W7

11

Monitor Full Scale Range Adjustment

NOTE: Information in [brackets] applies to the Rotor Acceleration (RPM/MIN) Tachometer only.

The Tachometer RPM [and RPM/MIN] Full Scale Range Adjustment allows the RPM [and RPM/MIN] Recorder outputs to be properly scaled to the expected operating range of the shaft being monitored. The Tachometer is shipped with a Full Scale Range of 5000 RPM [500 RPM/MIN]. The Tachometer may be adjusted to any of the following RPM [RPM/MIN] Full Scale Ranges.

Selectable RPM Full Scale Ranges:



100 200 500 1000 2000 5000 10,000 20,000 50,000 99,999

[Selectable RPM/MIN Full Scale Ranges:]

100 200 500 1000 9999

CAUTION

Machine Protection Will
be lost during the Full
Scale Adjust Procedure.

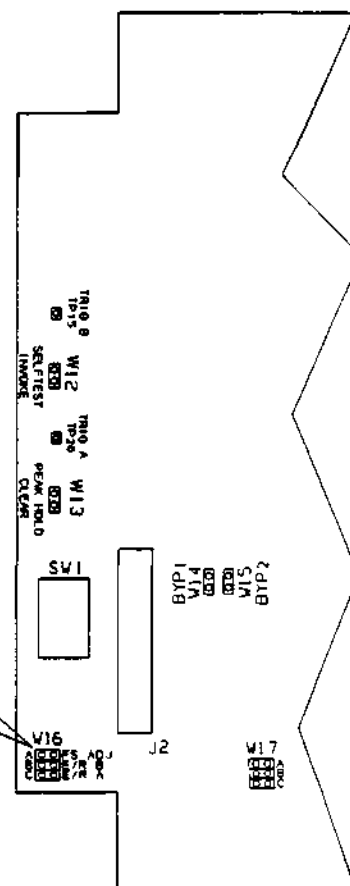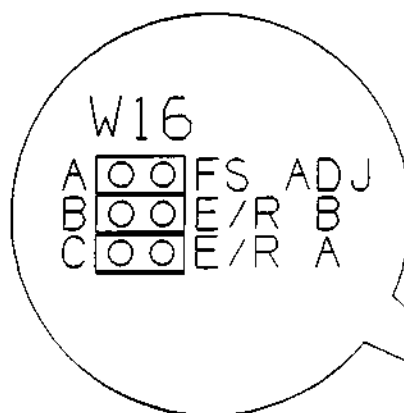


1. Remove Monitor (Section 7)
2. Remove Monitor side cover (Section 8)
3. Install Full Scale Adjust (FS ADJ) jumper, W16A.

11

Monitor Full Scale Range Adjustment (Cont)


4. Install Monitor in Rack. The RPM [and RPM/MIN] display will show the current RPM [and RPM/MIN] Full Scale Range.

5. Set Switch 6 (ER) to the "ON" position. The RPM [and RPM/MIN] display flash the current RPM [and RPM/MIN] Full Scale Range.

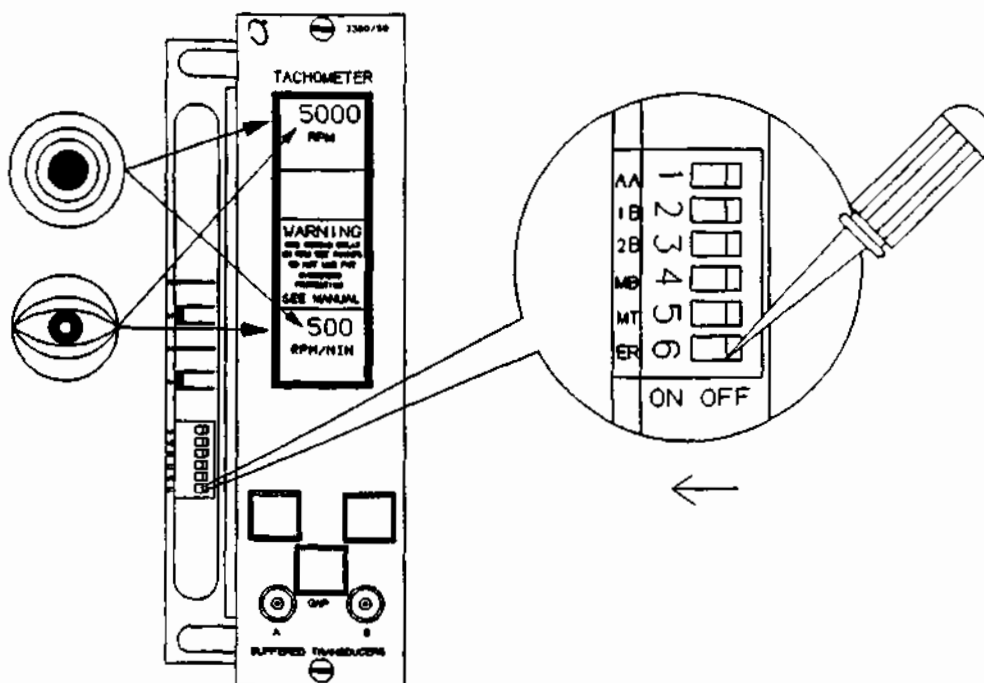

6. To adjust the RPM Full Scale Range, press and hold the right Alert switch on the front panel. The RPM Full Scale Range will remain flashing.

7. Use the (↑) or (↓) switches on the System Monitor to adjust the RPM Full Scale Range.


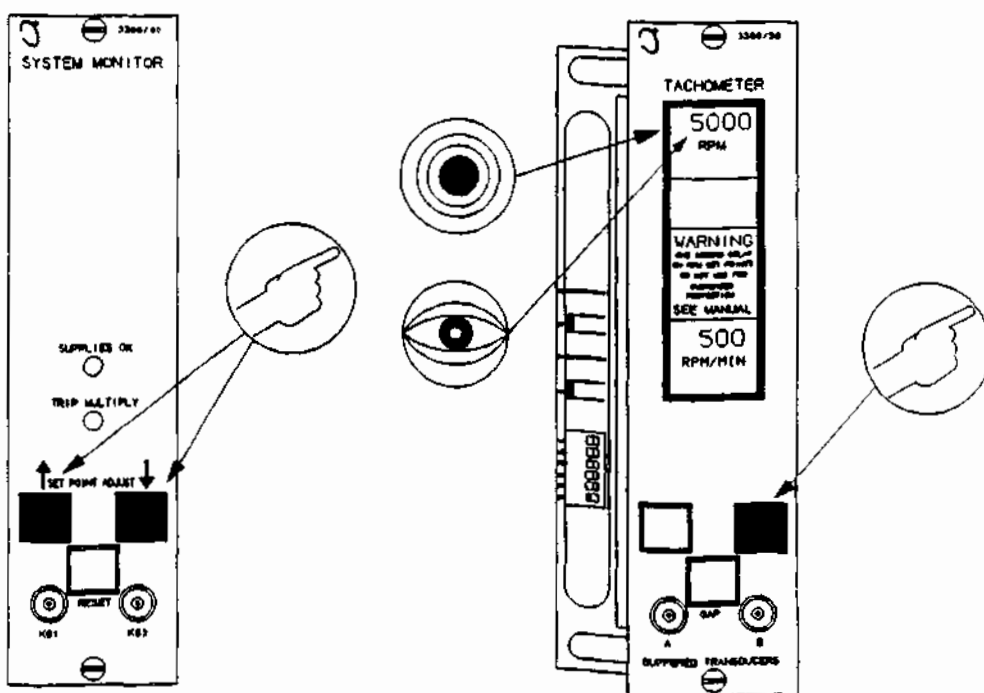


11

Monitor Full Scale Range Adjustment (Cont)

[8.] To adjust the RPM/MIN Full Scale Range, press and hold the left Alert switch on the front panel. The RPM/MIN Full Scale Range will remain flashing.

[9.] Use the (↑) or (↓) switches on the System Monitor to adjust the RPM/MIN Full Scale Range.

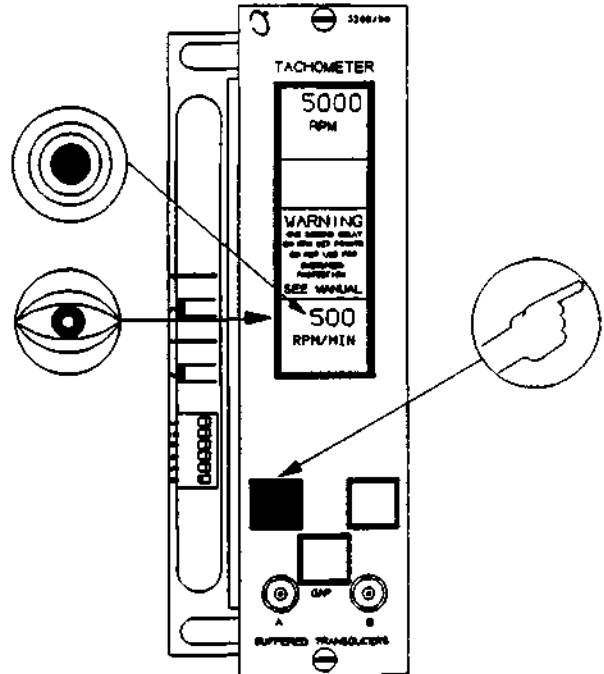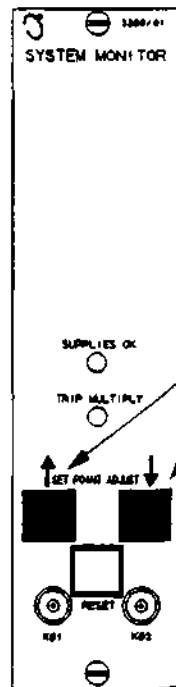



10. When the correct Full Scale Range has been selected, reset Switch 6 (ER) to the OFF position. This will lock the Full Scale Range into permanent memory.

11. Remove Monitor from Rack.

12. Remove the Full Scale Adjust Jumper, W16A.

13. Install Monitor side cover.

14. Install Monitor in Rack.

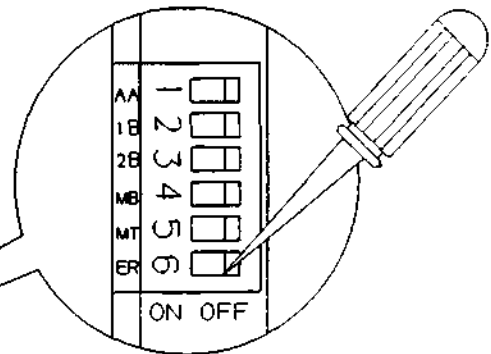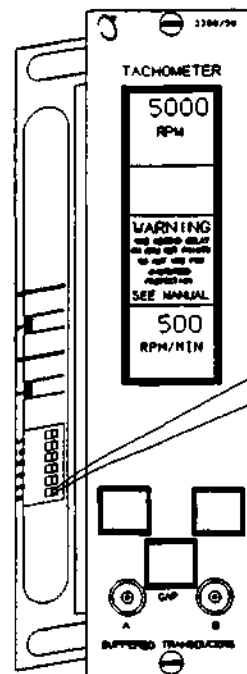

12


Events Per Revolution Adjustment

The Events Per Revolution Adjustment allows the Tachometer to observe a rotating shaft at other than one Event per Revolution. This is the case when observing a multi-tooth gear or when observing a shaft driven at some ratio of the actual rotor speed.

Events per Revolution Examples:


Example 1:

This example shows both probes observing a one event per revolution Keyphasor. The Tachometer is to indicate the speed of the shaft on the Keyphasor. In this case, the events per revolution (E/R) is set to 1. The E/R numerator and denominator are both 1. ($1/1 = 1$)

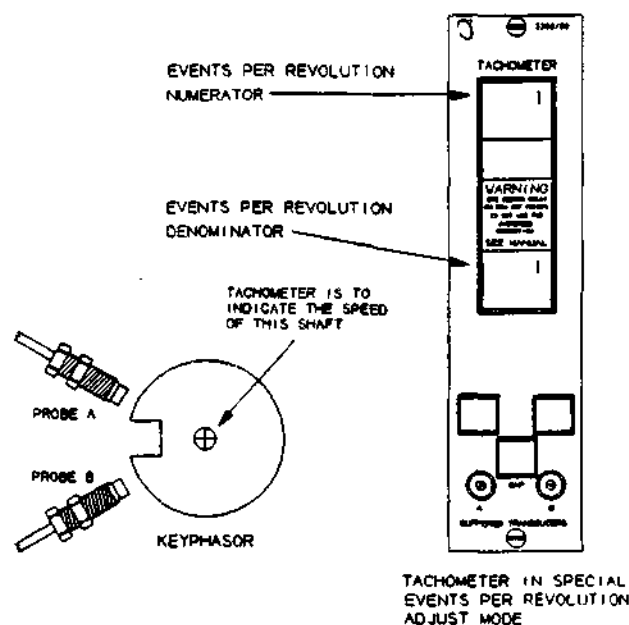

Example 2:

In this example both probes are observing a 24 tooth gear. The Tachometer is to indicate the speed of the shaft on the 24 tooth gear. In this case, the Events per Revolution (E/R) is set to 24. The E/R numerator is 24 and the denominator is 1. ($24/1 = 24$)

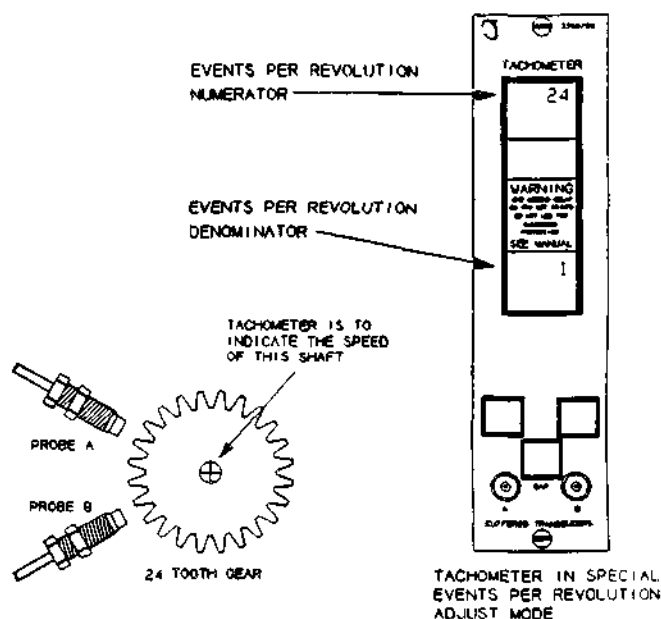


12

Events Per Revolution Adjustment (Cont)


Example 3:

In this example, both probes are observing an eleven tooth gear being driven from a 24 tooth gear. The Tachometer is to indicate the speed of the shaft on the 24 tooth gear. In this case, the Events per Revolution (E/R) is set to 24. Although the probes are observing the eleven tooth gear, they still detect 24 events per one turn of the indicated shaft. The E/R numerator is set to 24 and the denominator is set to 1. ($24/1 = 24$)

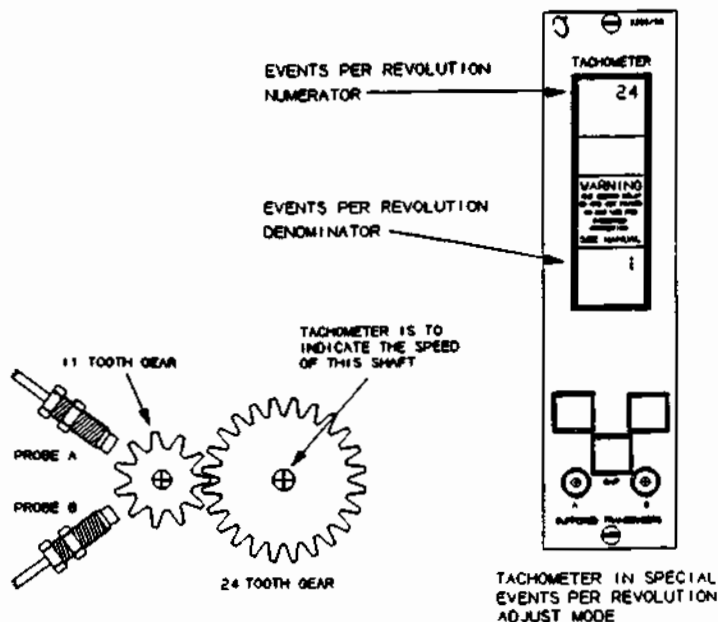

Example 4:

In this example, both probes are observing a one event per revolution Keyphasor on the same shaft with an eleven tooth gear. The eleven tooth gear is driven from a 24 tooth gear. The Tachometer is to indicate the speed of the shaft on the 24 tooth gear. In this case, the Events per Revolution (E/R) is 24/11. For each revolution of the indicated shaft, the Keyphasor will rotate 24/11 revolutions. The E/R numerator is set to 24 and the denominator is set to 11.

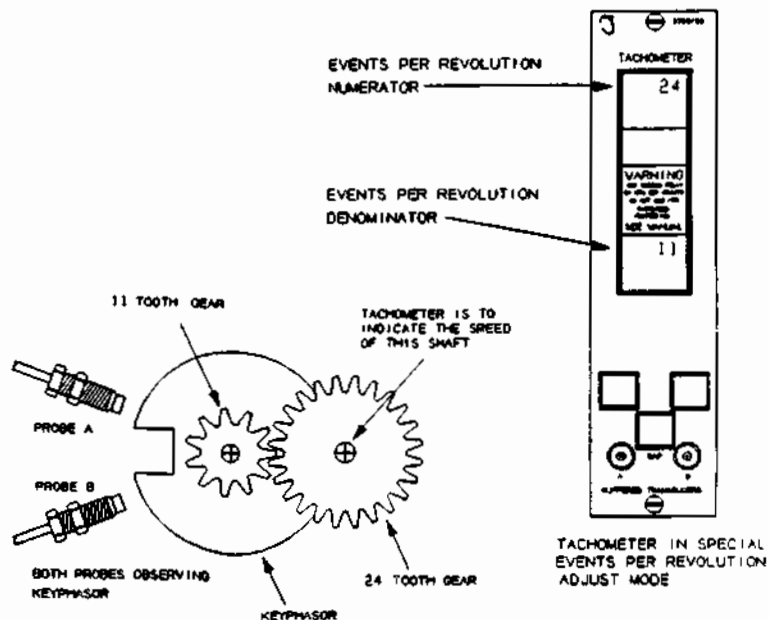

12

Events Per Revolution Adjustment (Cont)


Example 5:

In this example, both probes are observing an eighteen tooth gear on the same shaft with an eleven tooth gear. The eleven tooth gear is driven from a 24 tooth gear. The Tachometer is to indicate the speed of the shaft on the 24 tooth gear. In this case, the Events per Revolution (E/R) must be calculated:

$$E/R = (24 / 11) \times 18 ; E/R = 39.2727$$

To set the Tachometer to the proper E/R, the closest fraction must be found. The maximum E/R numerator allowed is 255. The maximum denominator allowed is also 255. The closest fraction found which is within these limits is E/R =

157/4. The E/R numerator is 157 and the denominator is 4. ($157/4 = 39.25$) Since 157/4 equals 39.25 and not 39.2727, a slight error will result. In this particular example, the error is 0.06 %, or 2 RPM at 3600 RPM.

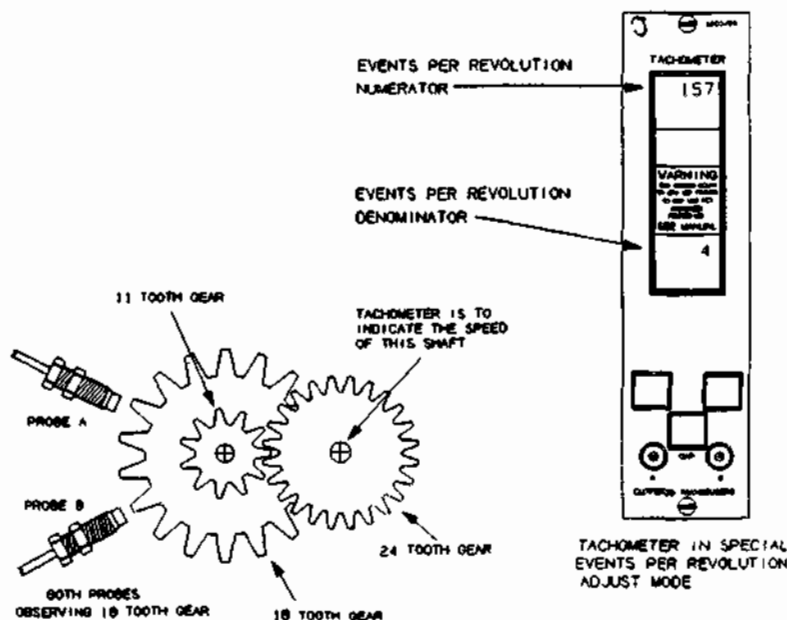

Notes on Events per Revolution

Depending on the operating speed, the Tachometer is limited to certain maximum values for the Events per Revolution. The table below must be adhered to for +/- 1 RPM accuracy.

RPM Full Scale Range	Maximum Allowed Events per Revolution
100 RPM	255
200 RPM	255
500 RPM	255
1000 RPM	255
2000 RPM	255
5000 RPM	120
10,000 RPM	60
20,000 RPM	30
50,000 RPM	6
100,000 RPM	1

When operating at speeds below 100 RPM with one Event per Revolution, the update rate and Alert response time can be extremely slow. Increasing the number of Events per Revolution observed will speed up the update rate and the Alert response time.

12

Events Per Revolution Adjustment (Cont)


Events per Revolution Adjustment Procedure:

CAUTION

Machine Protection Will be lost during the Events per Revolution Adjust Procedure.


1. Remove Monitor (Section 7)
2. Remove Monitor side cover (Section 8)
3. Install Events per Revolution jumper, W16C.

NOTE: Jumper W16C (E/R A) adjusts the Events per Revolution for both Transducer A and B. W16B (E/R B) is for future enhancements, and has no effect in this monitor. Both transducers must observe the same number of Events per Revolution.

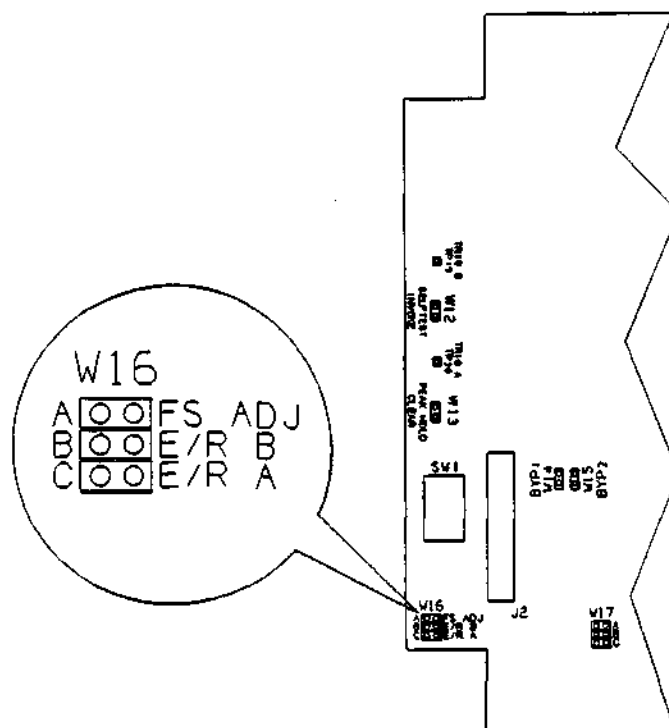

4. Install Monitor in Rack. The front panel display will show the current Events per Revolution (E/R) numerator and denominator.

5. Set Switch 6 (ER) to the "ON" position. The front panel display will flash the current E/R numerator and denominator.

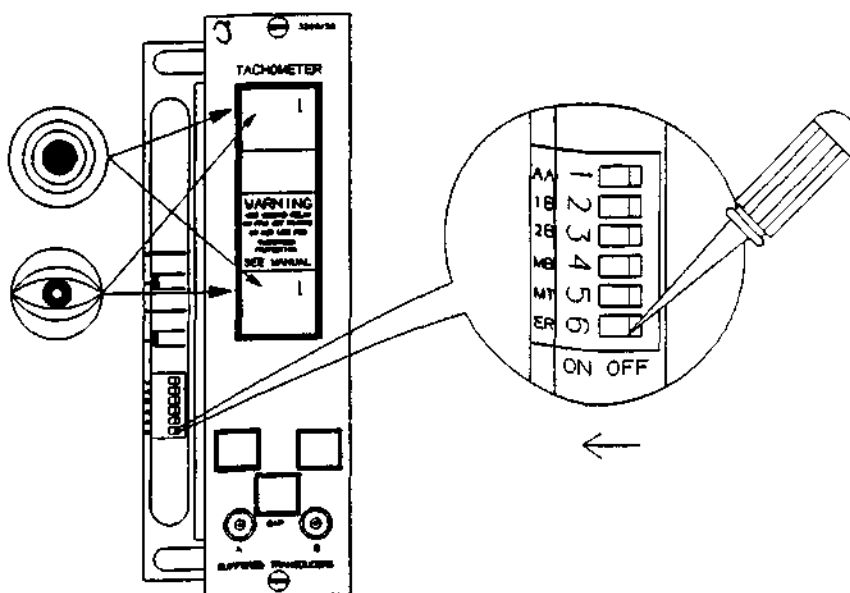


12

Events Per Revolution Adjustment (Cont)


6. To adjust the E/R numerator, press and hold the right Alert switch on the front panel. The E/R numerator will remain flashing.

7. Use the (↑) and (↓) switches on the System Monitor to adjust the E/R numerator.

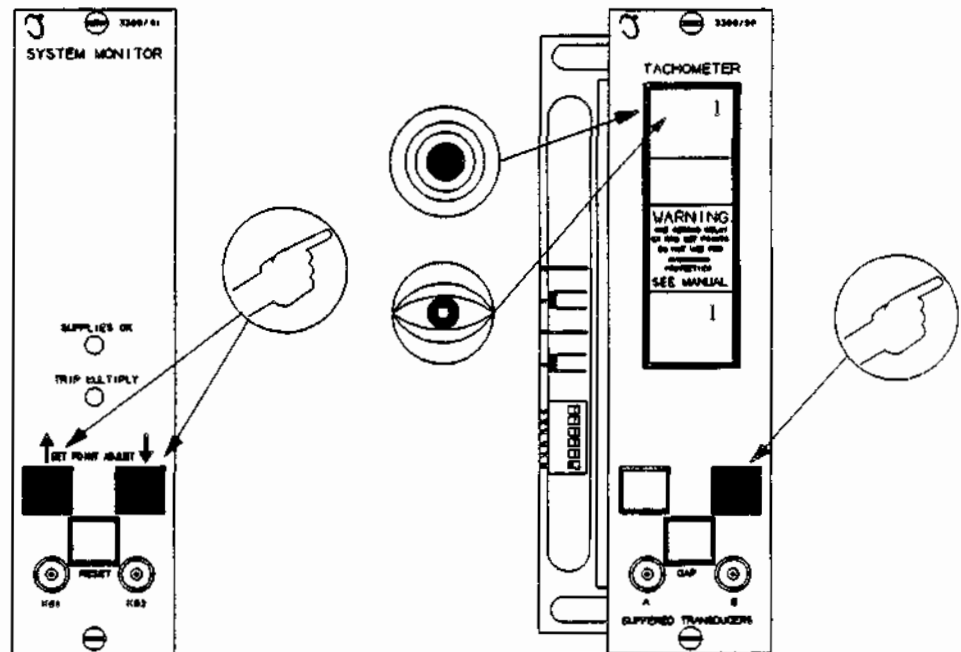

8. To adjust the E/R denominator, press and hold the left Alert switch on the front panel. The E/R denominator will remain flashing.

9. Use the (↑) and (↓) switches on the System Monitor to adjust the E/R denominator.

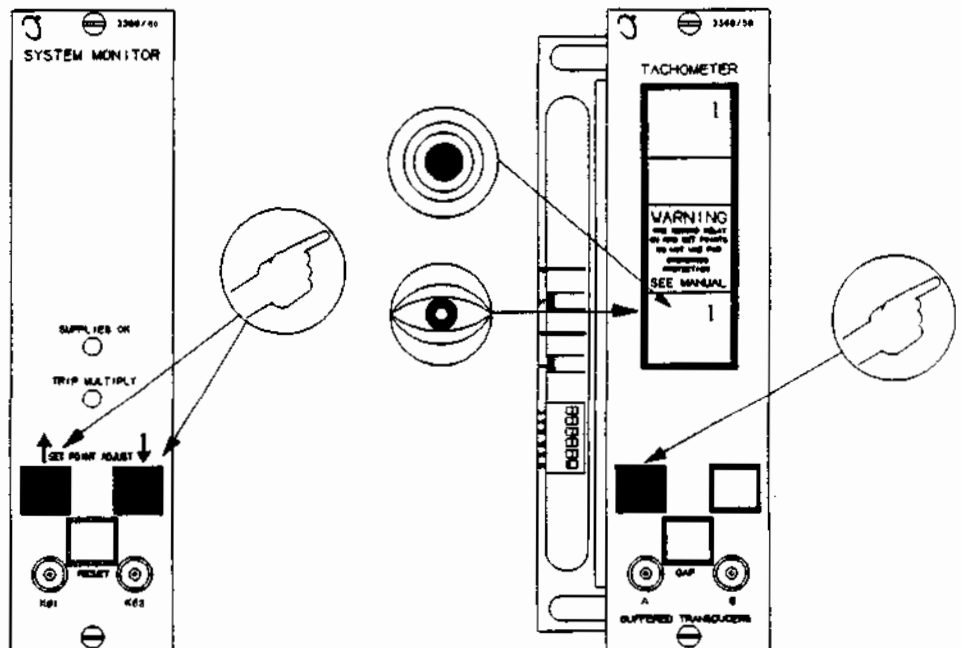

12

Events Per Revolution Adjustment (Cont)


10. When the correct Events per Revolution numerator and denominator have been selected, reset Switch 6 (ER) to the OFF position. This will lock the E/R into permanent memory.

11. Remove Monitor from Rack.

12. Remove the E/R Jumper, W16C.

13. Install Monitor side cover.

14. Install Monitor in Rack.

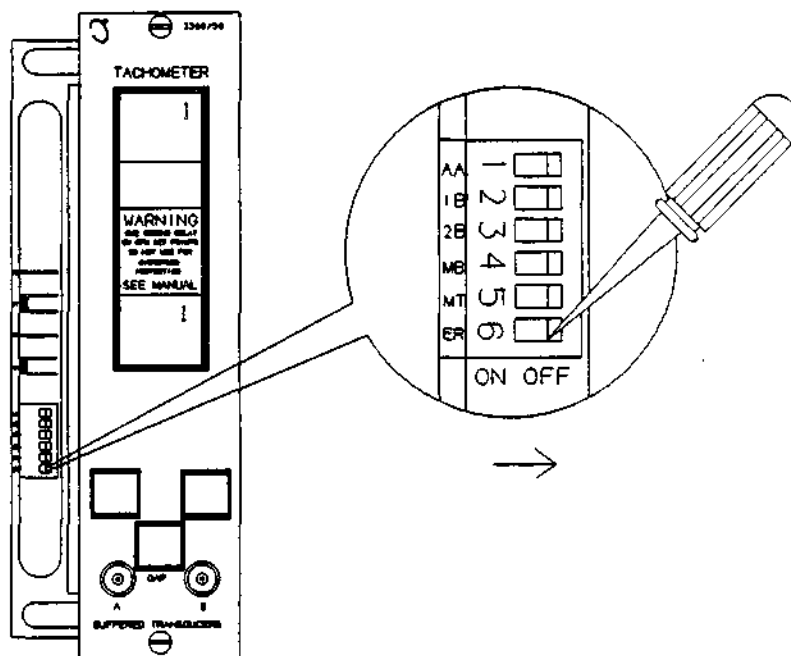

13 Threshold and Hysteresis Adjustments

The Tachometer has both **Manual** and **Automatic** Threshold modes. The Threshold mode is selected using option jumper W17C. The Dual Setpoint and Rotor Accel Tachometers are shipped in the Auto Threshold mode. The Zero Speed Tachometer is shipped in the Manual Threshold mode. The events per revolution into the monitor will determine the minimum RPM which can be used with Auto Threshold. The Auto Threshold's minimum frequency response is 5 Hertz or 300 RPM at one event per revolution. The input frequency must be greater than 5 Hertz for the Auto Threshold circuit to function properly. If the number of events per revolution is increased from 1 to 50, the minimum Auto Threshold frequency would be 6 RPM. See section 10 (Monitor Options) for Threshold jumper configuration.

Do not use Auto Threshold if the expected operating range is less than 5 Hertz (300 RPM at one event per revolution).

The Hysteresis can be selected from 0.2 to 2.0 Volts using option jumpers W8A through W8C and W11A through W11C. The Tachometer is shipped with a Hysteresis of 0.5 Volts. See section 10 (Monitor Options) for Hysteresis jumper configuration.


NOTE: If Auto Threshold is used, the following procedure need not be performed.

CAUTION

Machine Protection may be lost during the Manual Threshold Adjust Procedure.

Threshold Adjust Procedure:

1. Open and slide over the monitor front panel.
2. Set Switch 5, Manual Threshold (MT), to the ON position. The front panel display flashes the Threshold voltages for Transducers A and B.

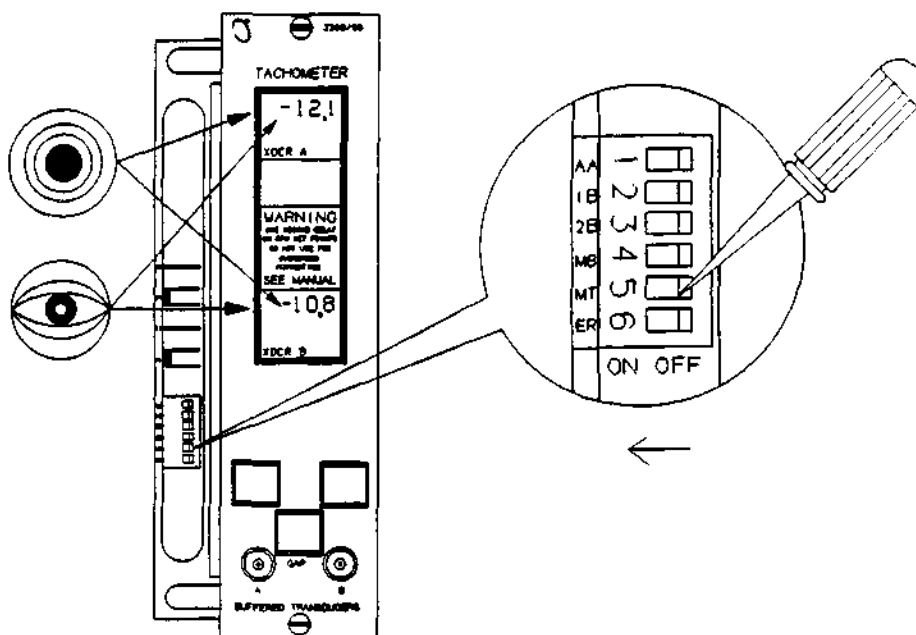

13


Threshold and Hysteresis Adjustments (Cont)

3. When adjusting the Transducer A Manual Threshold, connect an oscilloscope to the TRIGGER A Test Point (TA) located behind the front panel. When adjusting the Transducer B Manual Threshold, connect the oscilloscope to the TRIGGER B Test Point (TB).

NOTE: An oscilloscope is helpful, but not necessary.

NOTE: The buffered transducer input signals can be observed by connecting the oscilloscope to the coaxial connectors on the front panel.


4. The machinery should be running and the transducers should be properly connected to the Signal Input Module (Section 27,28, or 29).

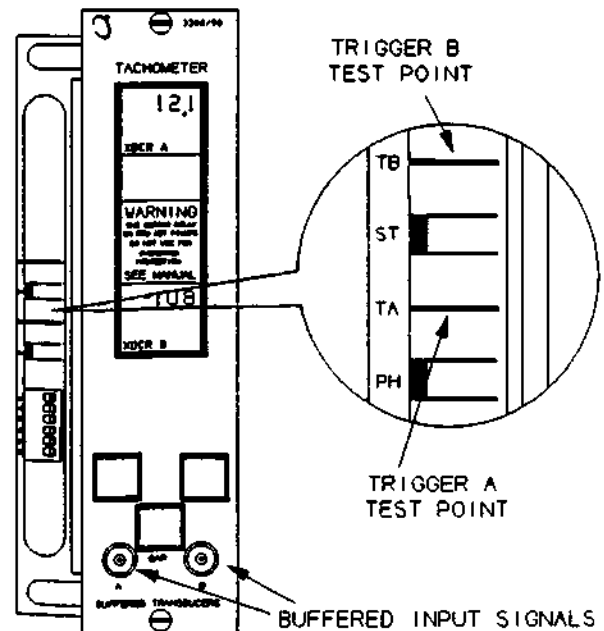

5. To adjust Threshold A, press and hold the left Alert switch on the front panel. The Threshold A value remains flashing.

6. Use the (↑) or (↓) switches on the System Monitor to adjust the Threshold.

7. Adjust Threshold A up or down until the oscilloscope displays the TRIGGER A square wave (approximately 0 to 5 volts) and the TRIGGER OK A LED comes on.

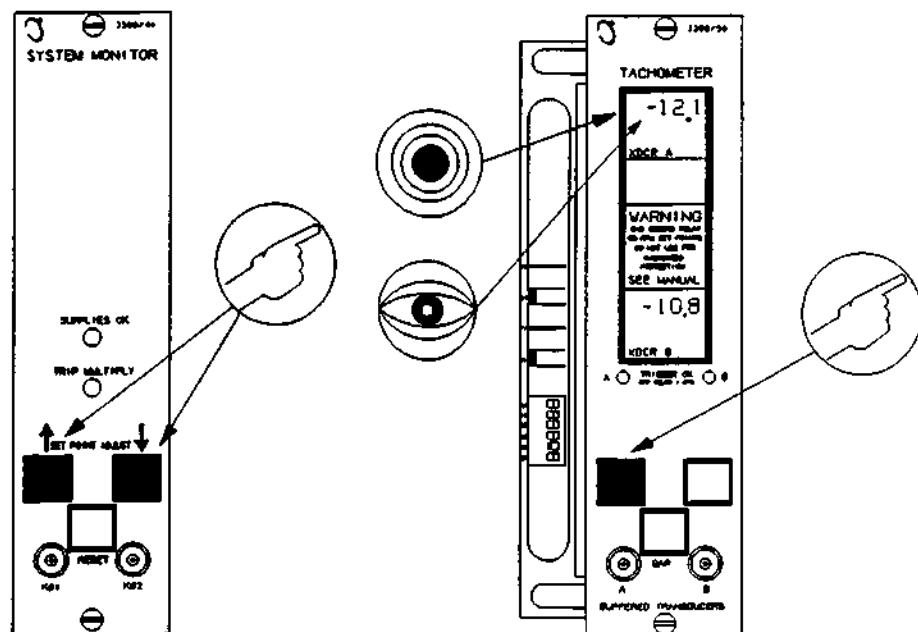

13 Threshold and Hysteresis Adjustments (Cont)

8. Adjust Threshold A UP until the TRIGGER OK A LED extinguishes and the oscilloscope shows no square wave. Note the Threshold A value at which this occurs.


9. Adjust Threshold A DOWN until the TRIGGER OK A LED comes back on, and the oscilloscope shows the TRIGGER A square wave. Continue adjusting Threshold A DOWN until the TRIGGER OK A LED extinguishes and the oscilloscope shows no square wave. Note The Threshold A value at which this occurs.

10. Adjust Threshold A to a value midway between the values obtained in steps 8 and 9 above.

11. To adjust Threshold B, press and hold the right Alert switch on the front panel. The Threshold B value should remain flashing.

12. Use the (↑) or (↓) switches on the System Monitor to adjust the Threshold.

13. Adjust Threshold B up or down until the oscilloscope displays the TRIGGER B square wave (approximately 0 to 5 volts) and the TRIGGER OK B LED comes on.

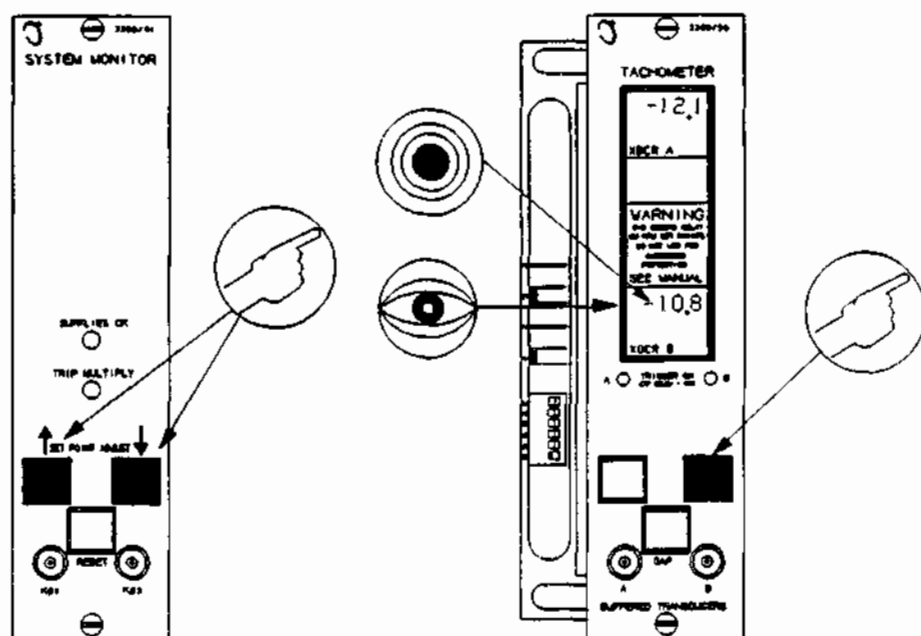

14. Adjust Threshold B UP until the TRIGGER OK B LED extinguishes and the oscilloscope shows no square wave. Note the Threshold B value at which this occurs.

15. Adjust Threshold B DOWN until the TRIGGER OK B LED comes back on, and the oscilloscope shows the TRIGGER B square wave. Continue adjusting Threshold B DOWN until the TRIGGER OK B LED extinguishes and the oscilloscope shows no square wave. Note The Threshold B value at which this occurs.

16. Adjust Threshold B to a value midway between the values obtained in steps 14 and 15 above.

17. Upon completion of the Manual Threshold procedure, reset Dip Switch SW1-5 (MT) to the "OFF" position. This will lock the Manual Threshold values into permanent memory.

13 Threshold and Hysteresis Adjustments (Cont)

18. Close the monitor front panel.

Hysteresis Adjustment:

The Tachometer is shipped with a Hysteresis of 0.5 Volts. This should work well in most installations. However, if the above Manual Threshold Adjust Procedure cannot be completed successfully, or the Auto Threshold does not function in a certain application, then the Hysteresis may require adjustment. See section 10 (Monitor Options) for the Hysteresis jumper configurations.

Threshold and Hysteresis Adjustment Considerations:

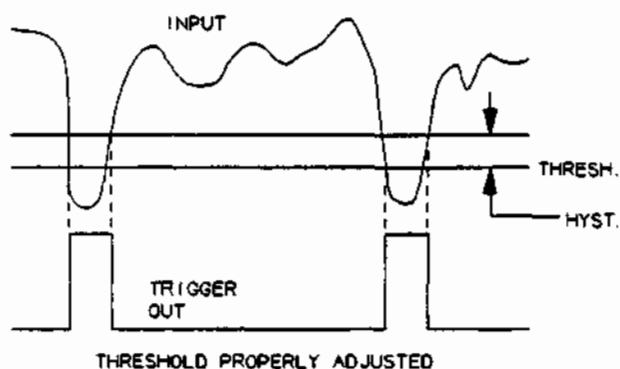


FIGURE 1

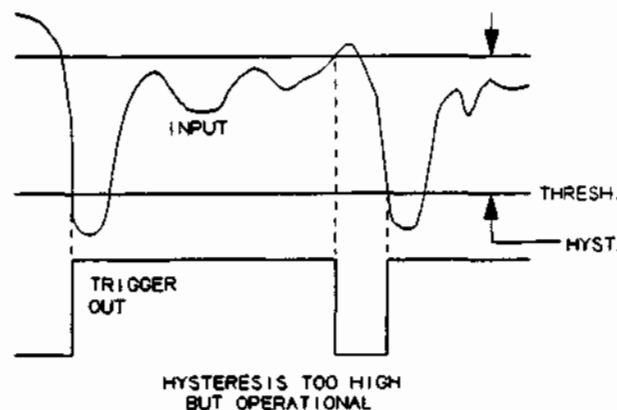


FIGURE 2

Figure 1 shows proper adjustment of Threshold and Hysteresis, resulting in one pulse for each Transducer input.

Threshold is the point where the Trigger Out pulse is turned on. Hysteresis is the difference between the level the Trigger Out pulse turns on and the level it turns off.

Figure 2 shows improper selection of Hysteresis, but still one pulse for each Transducer input.

Figure 3 shows improper Threshold adjustment and improper Hysteresis selection. There is more than one pulse for each Transducer input.

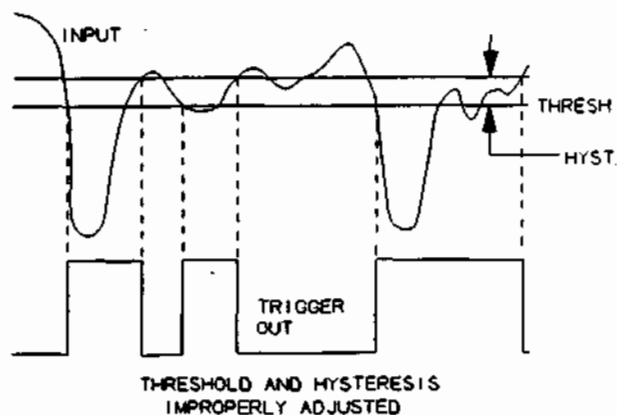



FIGURE 3

14

Adjust Alert Setpoints (Dual Setpoint Tach.)


1. Open and slide over the front panel.

2. Set Switch 1, Alert Adjust (AA) to the ON position. The RPM display flashes to indicate Alert Adjust Mode.

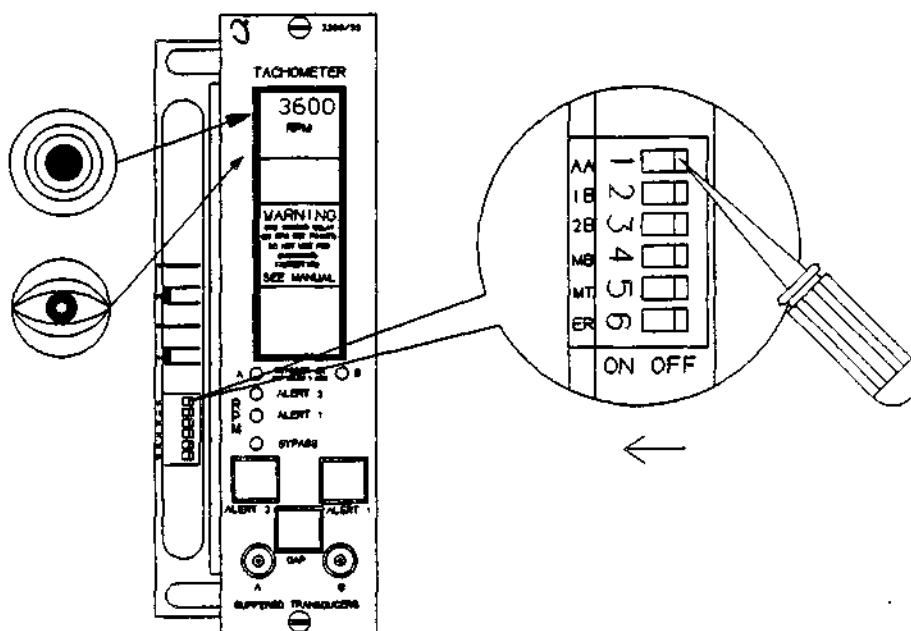

3. Press and hold the RPM Alert 1 switch (right), to adjust the RPM Alert 1 setpoint. The current RPM Alert 1 setpoint now flashes on the display. The upward pointing arrow indicates an over Alert setpoint. (A downward pointing arrow indicates an under Alert setpoint).

4. Use the (↑) or (↓) switches on the System Monitor to adjust the RPM Alert 1 setpoint.

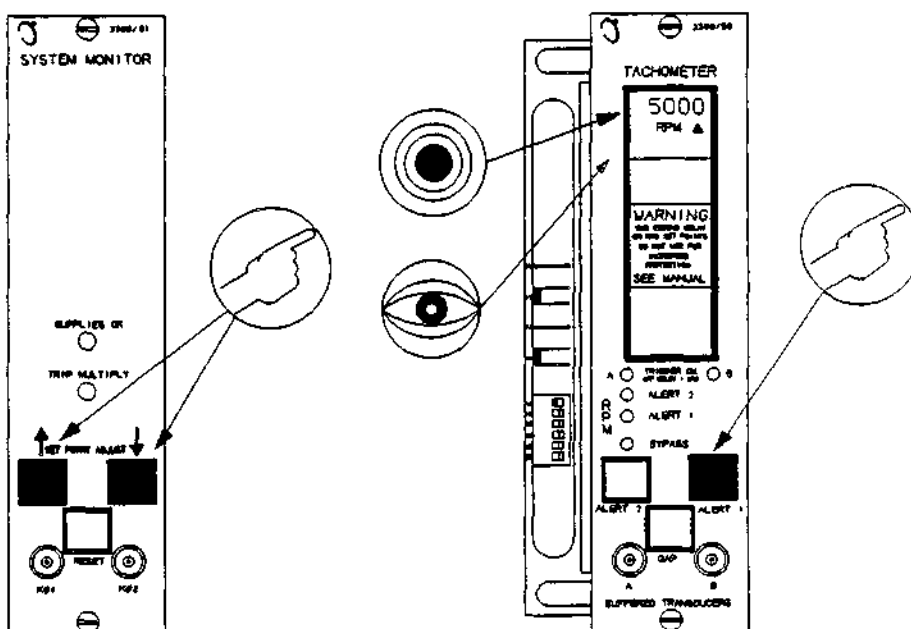


14

Adjust Alert Setpoints (Dual Setpoint Tach.) (Cont.)


5. Press and hold the RPM Alert 2 switch (left), to adjust the RPM Alert 2 setpoint. The current RPM Alert 2 setpoint now flashes on the display. The upward pointing arrow indicates an over Alert setpoint. (A downward pointing arrow indicates an under Alert setpoint).

6. Use the (↑) or (↓) switches on the System Monitor to adjust the RPM Alert 2 setpoint.

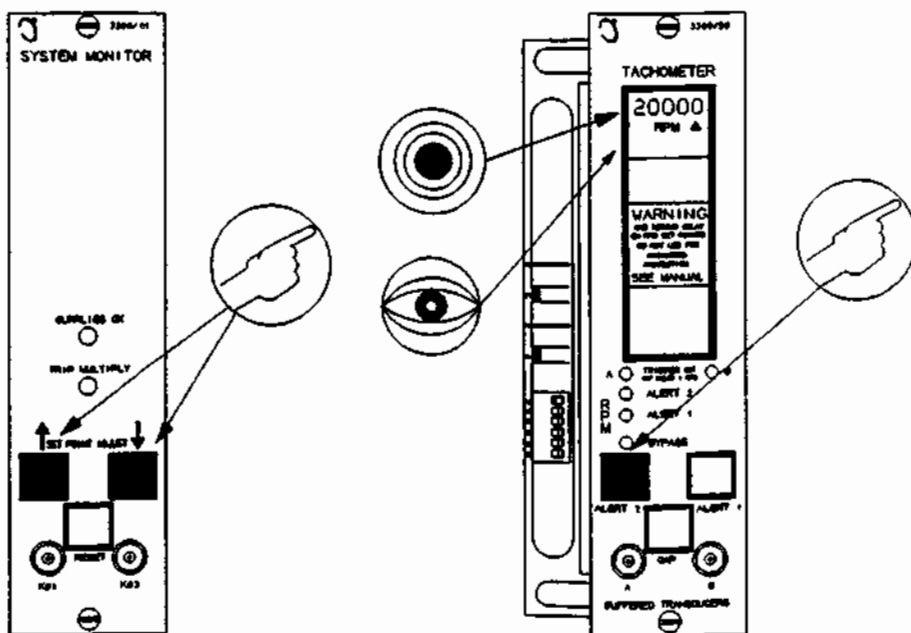

7. Reset Switch 1, Alert Adjust (AA) to the OFF position to lock the Alert setpoints into permanent memory.


8. Close the monitor front panel.

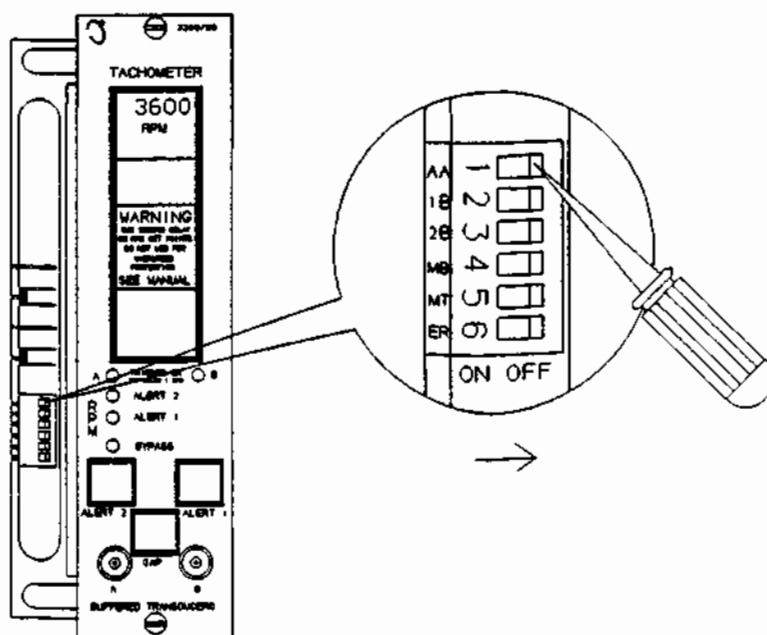

15 Adjust Alert Setpoints (Zero Speed Tach.)


1. Open and slide over the front panel.

2. Set Switch 1, Alert Adjust (AA) to the ON position. The RPM display flashes to indicate Alert Adjust Mode.

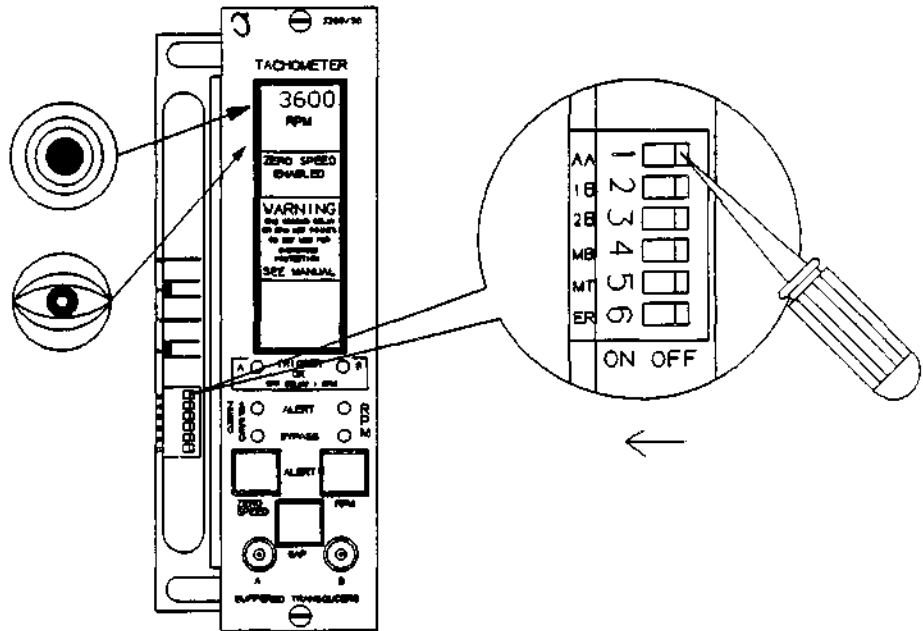

3. Press and hold the RPM Alert switch (right), to adjust the RPM Alert setpoint. The current RPM Alert setpoint now flashes on the display. The upward pointing arrow indicates an over Alert setpoint. (A downward pointing arrow indicates an under Alert setpoint).


4. Use the (↑) or (↓) switches on the System Monitor to adjust the RPM Alert setpoint.

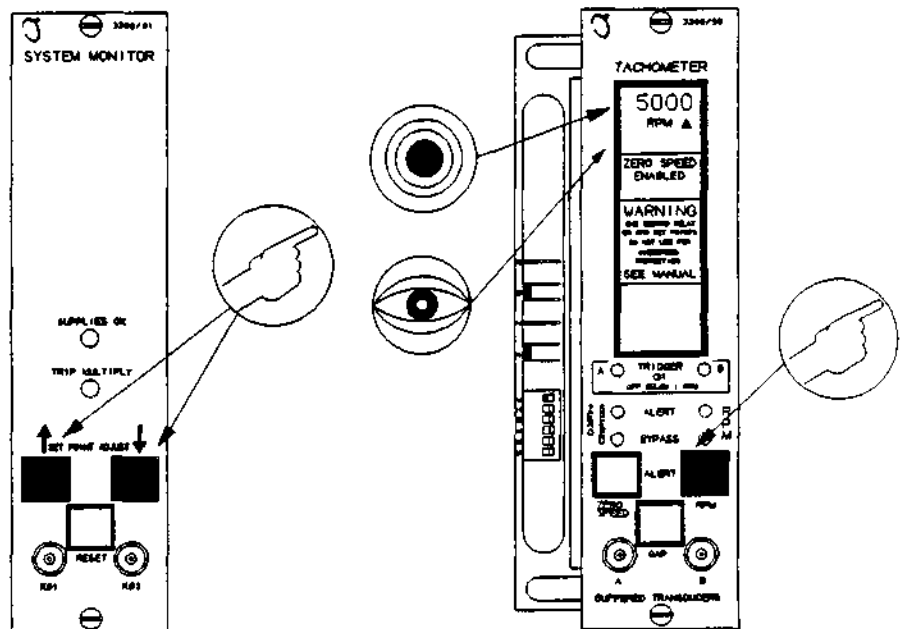

15 Adjust Alert Setpoints (Zero Speed Tach.) (Cont.)


5. Press and hold the Zero Speed Alert switch (left), to adjust the Zero Speed Alert setpoint. The current Zero Speed Alert setpoint now flashes on the display. The downward pointing arrow indicates an under Alert setpoint. (Zero Speed is always an under Alert setpoint).

6. Use the (↑) or (↓) switches on the System Monitor to adjust the Zero Speed Alert setpoint.

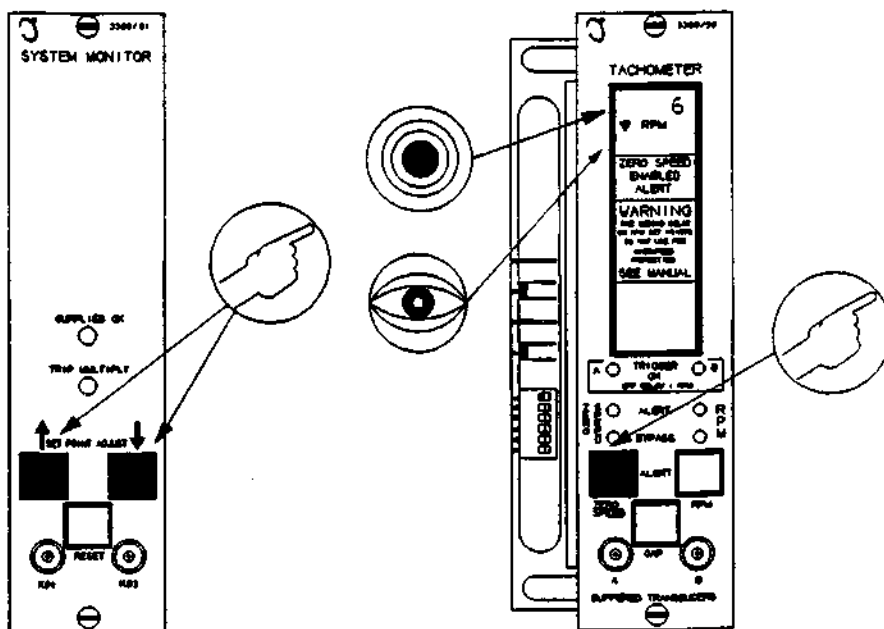

7. Reset Switch 1, Alert Adjust (AA) to the OFF position to lock the Alert setpoints into permanent memory.

8. Close the monitor front panel.

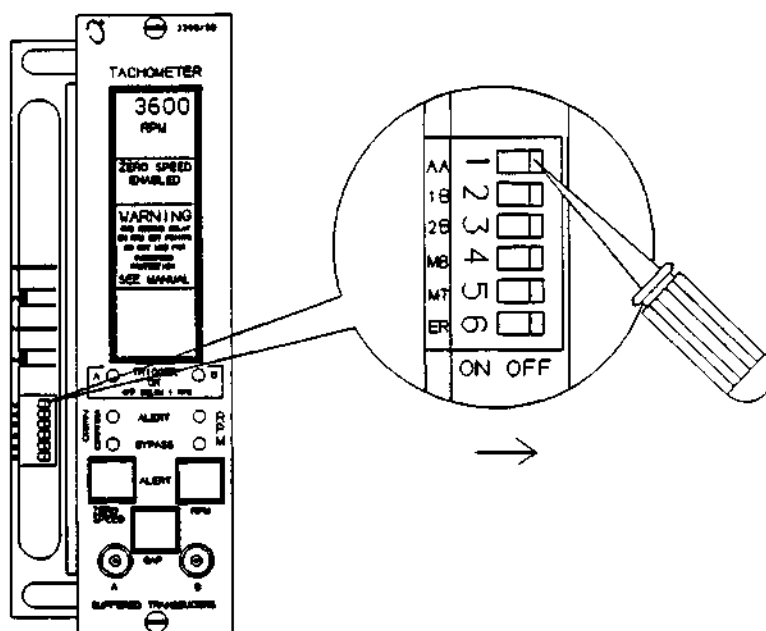


16

Adjust Alert Setpoints (Rotor Accel Tach)


1. Open and slide over the front panel.

2. Set Switch 1, Alert Adjust (AA) to the ON position. The RPM and RPM/MIN display flashes to indicate Alert Adjust Mode.

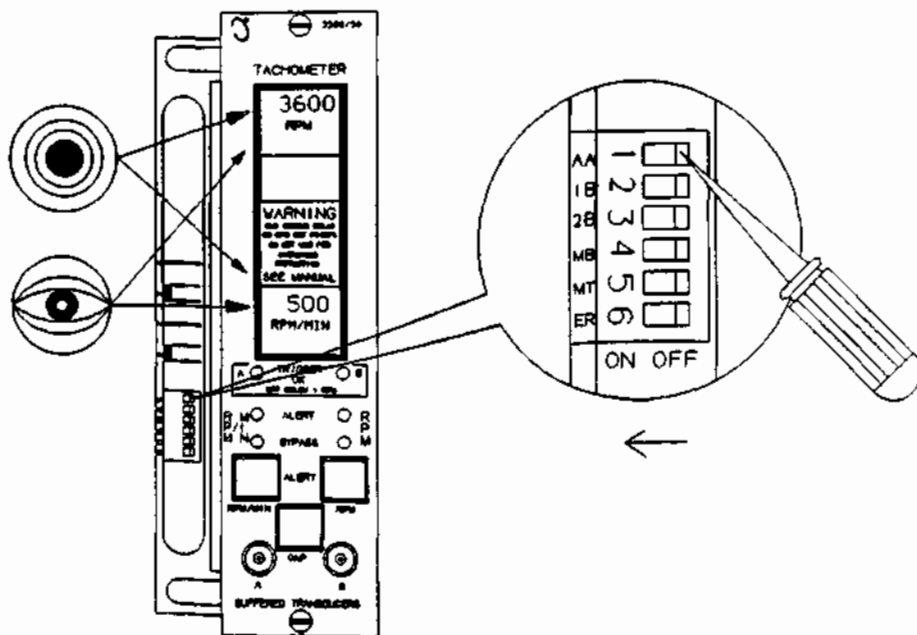

3. Press and hold the RPM Alert switch (right), to adjust the RPM Alert setpoint. The current RPM Alert setpoint now flashes on the display. The upward pointing arrow indicates an over Alert setpoint. (A downward pointing arrow indicates an under Alert setpoint).


4. Use the (↑) or (↓) switches on the System Monitor to adjust the RPM Alert setpoint.

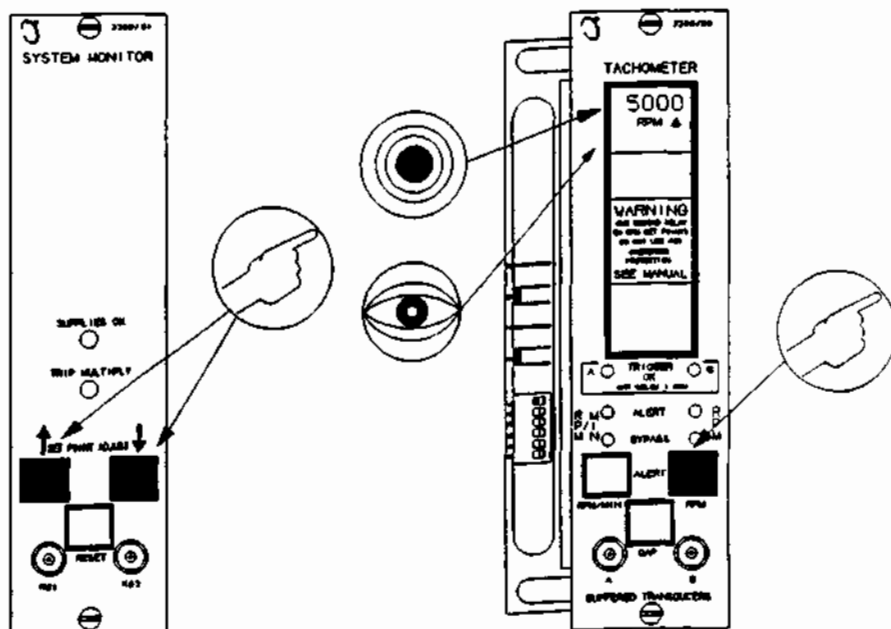

16 Adjust Alert Setpoints (Rotor Accel Tach) (Cont)


5. Press and hold the RPM/MIN Alert switch (left), to adjust the RPM/MIN Alert setpoint. The current RPM/MIN Alert setpoint now flashes on the display. The upward pointing arrow indicates an over Alert setpoint. (RPM/MIN is always an over Alert setpoint).

6. Use the (↑) or (↓) switches on the System Monitor to adjust the RPM/MIN Alert setpoint.

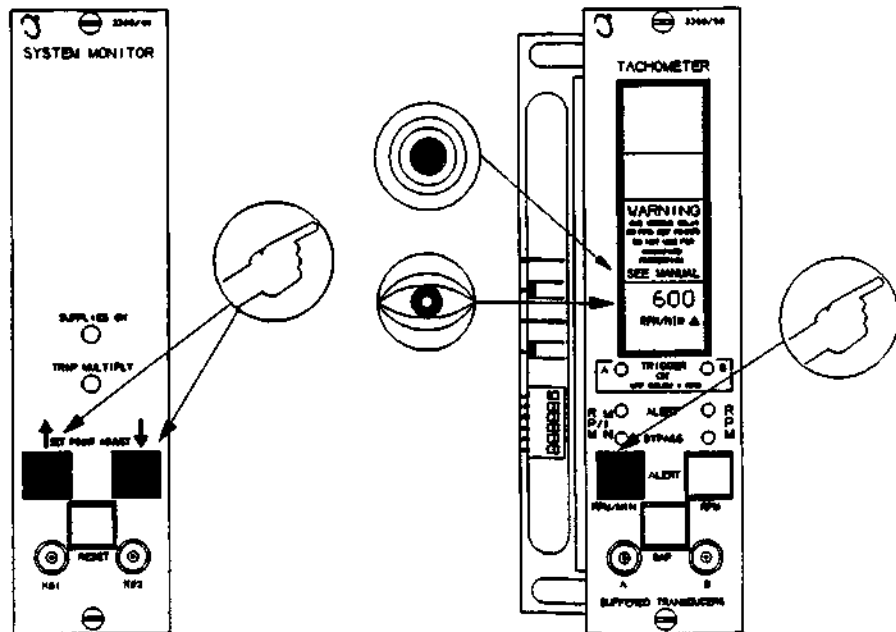

7. Reset Switch 1, Alert Adjust (AA) to the OFF position to lock the Alert setpoints into permanent memory.

8. Close the monitor front panel.

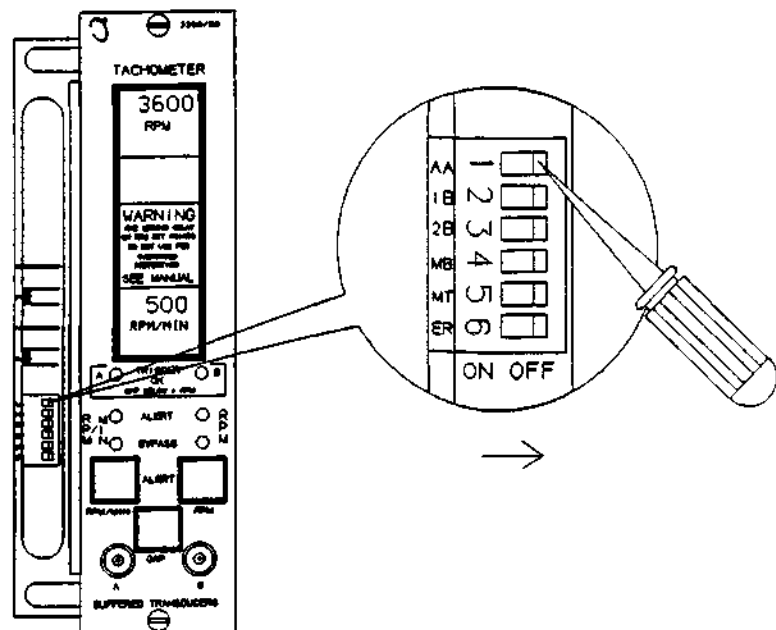


17

Bypass (Dual Setpoint Tach.)**CAUTION**

Machine Protection will
be lost while Bypass is
on.

Set the 2B (Bypass Alert 2 Relay) Switch to the ON position to bypass the Alert 2 relay. The Bypass LED will turn on. The monitor will otherwise function normally.

The RPM Alert 1 relay cannot be Bypassed. Switch (1B) has no affect in the Dual Setpoint Tach.

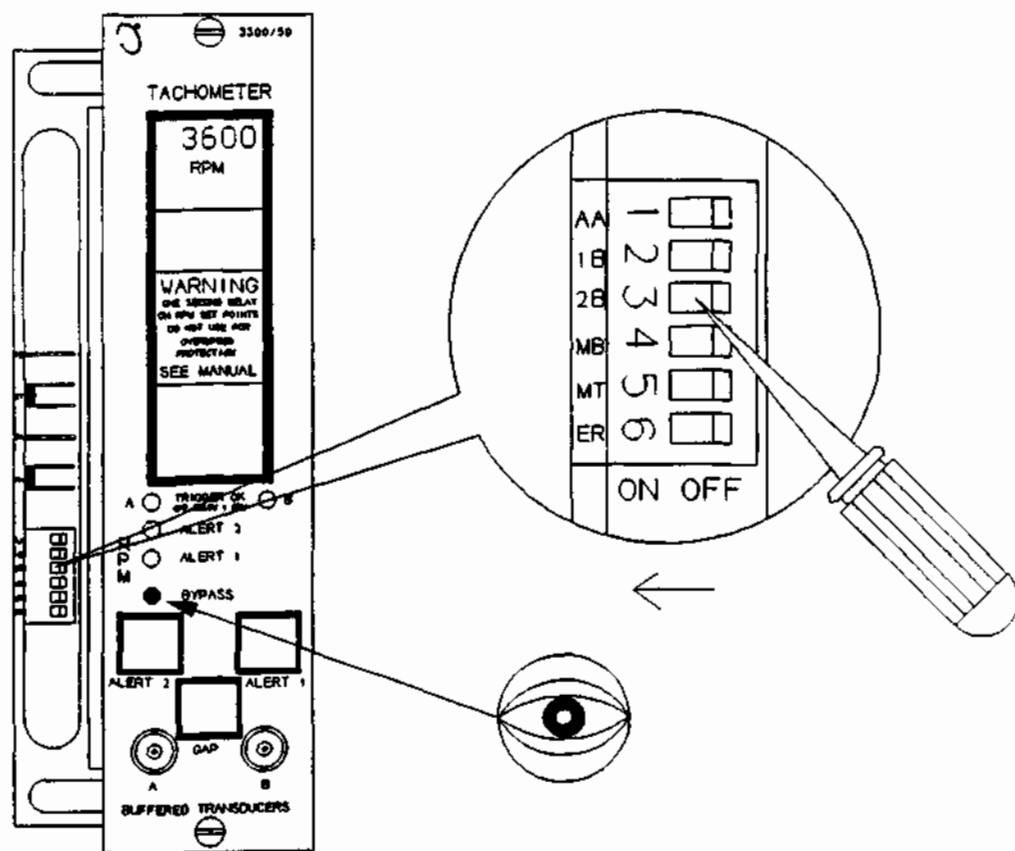


18

Bypass (Zero Speed Tach.)**CAUTION**

Machine Protection will
be lost while Bypass is
on.

Set the 1B (Bypass RPM Alert Relay) Switch to the ON position to bypass the RPM Alert relay. The RPM Bypass LED will turn on. The monitor will otherwise function normally.

Set the 2B (Bypass Zero Speed Alert Relay) Switch to the ON position to bypass the Zero Speed Alert relay. The Zero Speed Bypass LED will turn on. The monitor will otherwise function normally.

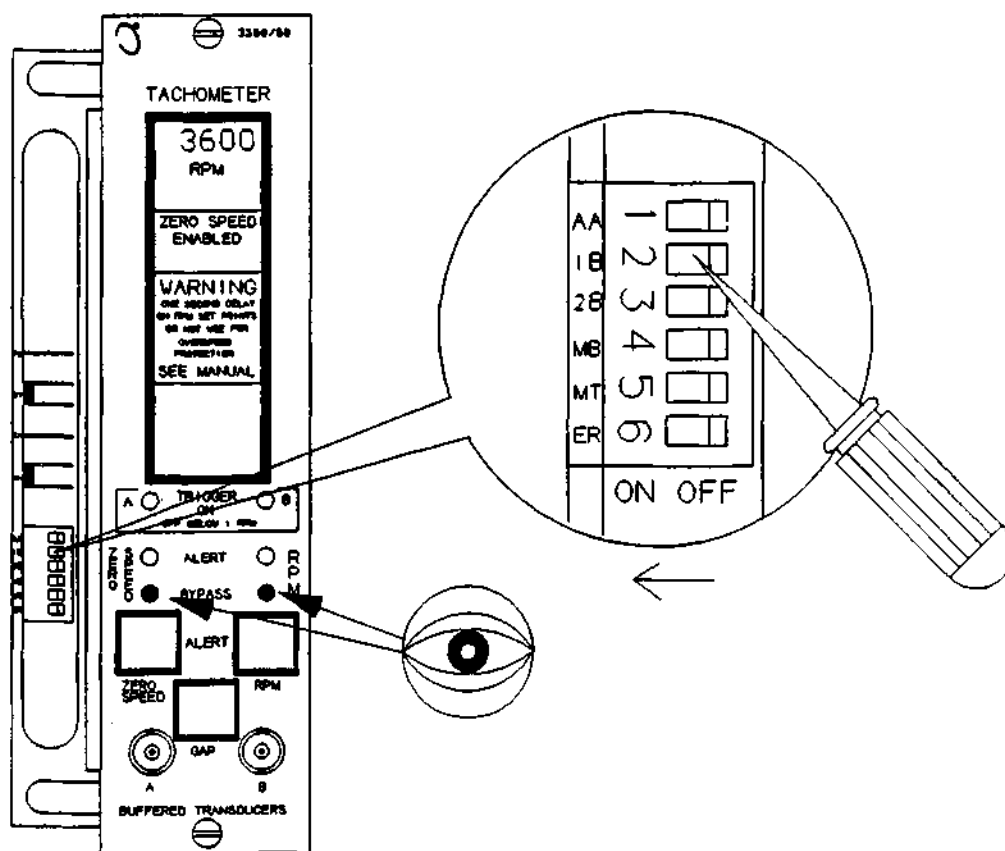


19

Bypass (Rotor Accel Tach.)**CAUTION**

Machine Protection will
be lost while Bypass is
on.

Set the 1B (Bypass RPM Alert Relay) Switch to the ON position to bypass the RPM Alert relay. The RPM Bypass LED will turn on. The monitor will otherwise function normally.

Set the 2B (Bypass RPM/MIN Alert Relay) Switch to the ON position to bypass the RPM/MIN Alert relay. The RPM/MIN Bypass LED will turn on. The monitor will otherwise function normally.

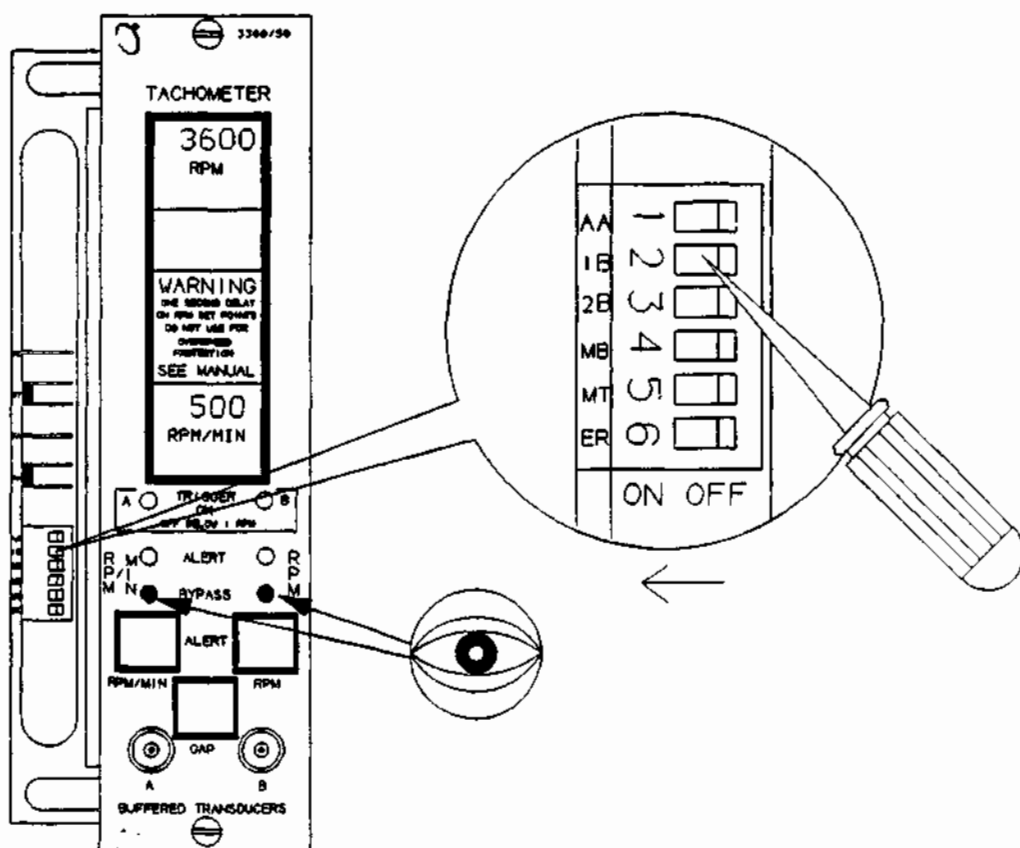


20

Monitor Bypass (Dual Setpoint Tach.)

CAUTION

Machine Protection will
be lost while Monitor
Bypass is on.

Set the MB (Monitor Bypass) Switch to the ON position. The Bypass LED will turn on, the Trigger OK LEDs will turn off, and the RPM display will go to zero.

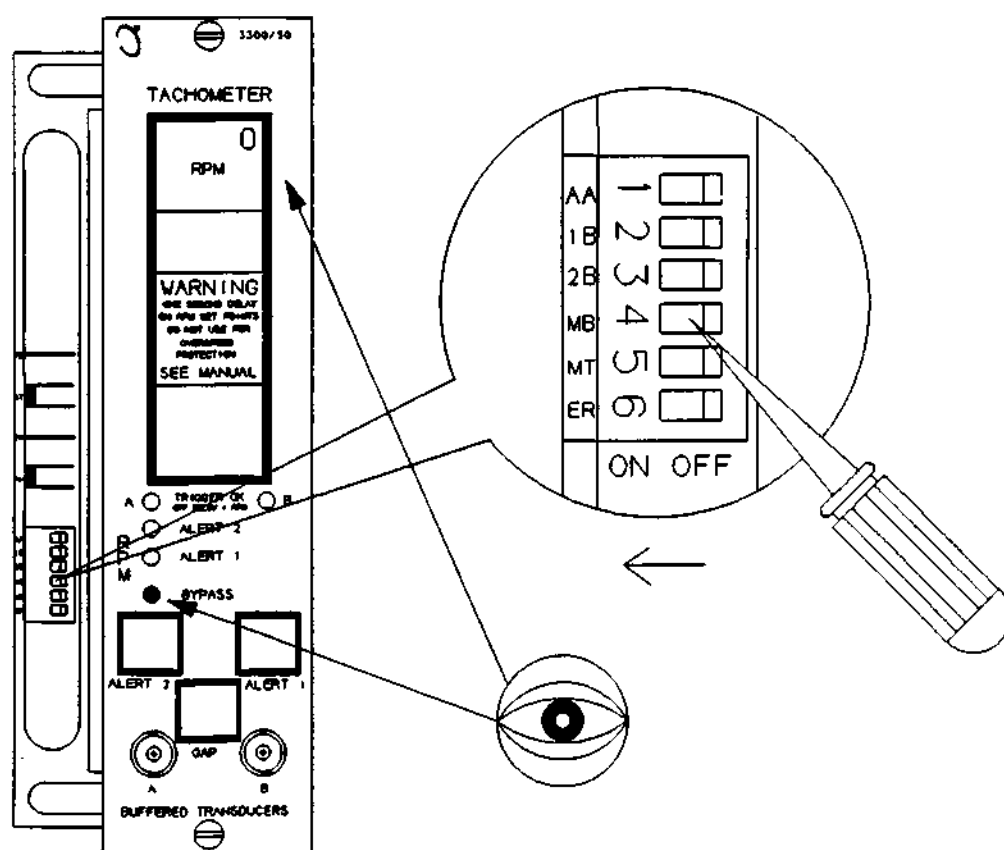


21

Monitor Bypass (Zero Speed Tach.)

CAUTION

Machine Protection will
be lost while Monitor
Bypass is on.

Set the MB (Monitor Bypass) Switch to the ON position. The Bypass LEDs will turn on, the Trigger OK LEDs will turn off, and the RPM display will go to zero.

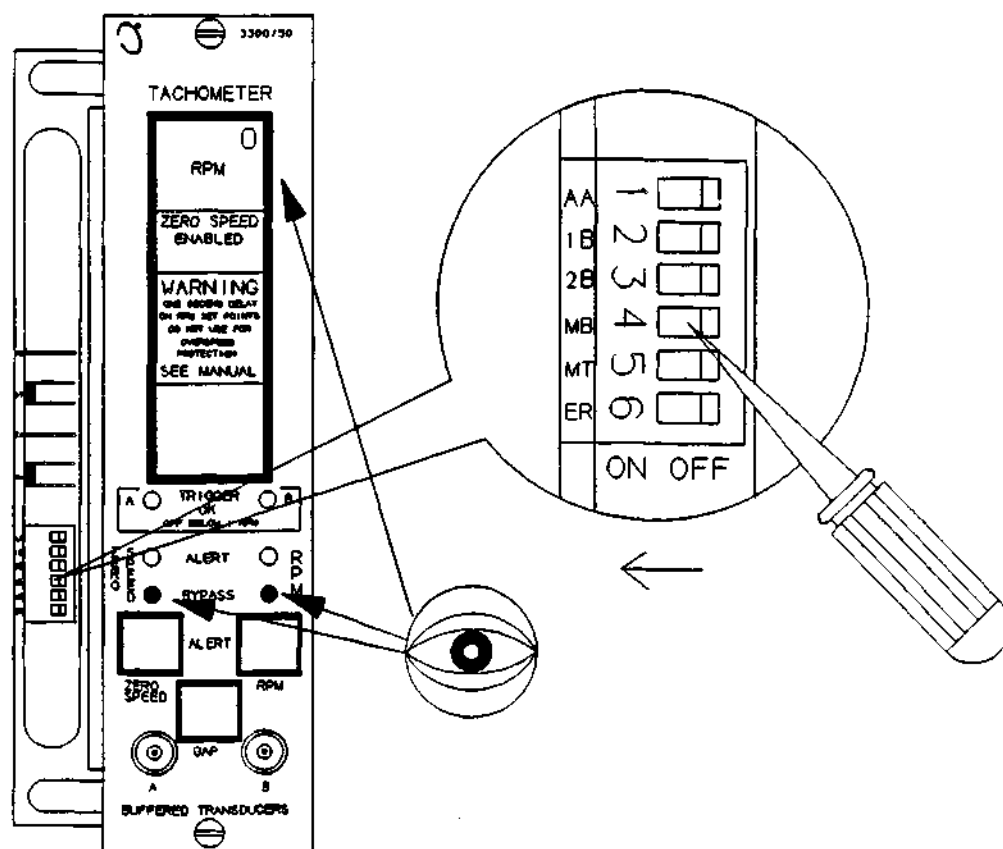


22

Monitor Bypass (Rotor Accel Tach.)

CAUTION


Machine Protection will
be lost while Monitor
Bypass is on.

Set the MB (Monitor Bypass) Switch to the ON position. The Bypass LEDs will turn on, the Trigger OK LEDs will turn off, and the RPM and RPM/MIN displays will go to zero.

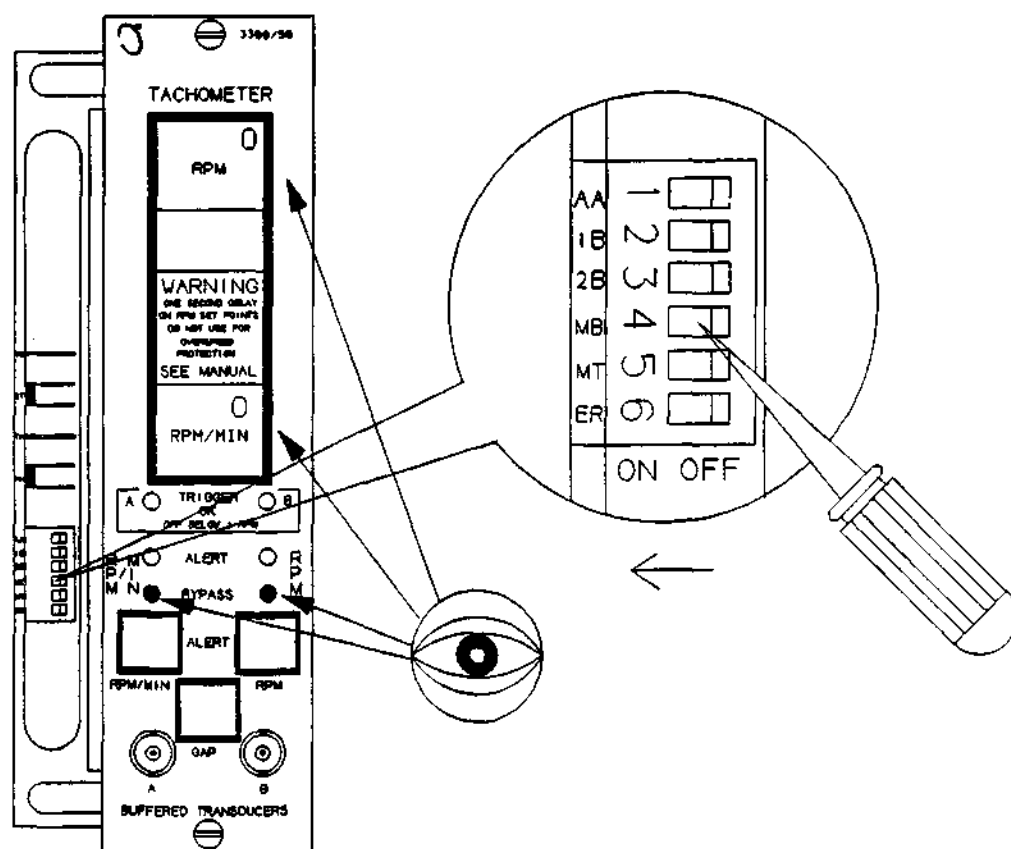

23

Test Alerts (Dual Setpoint Tach.)

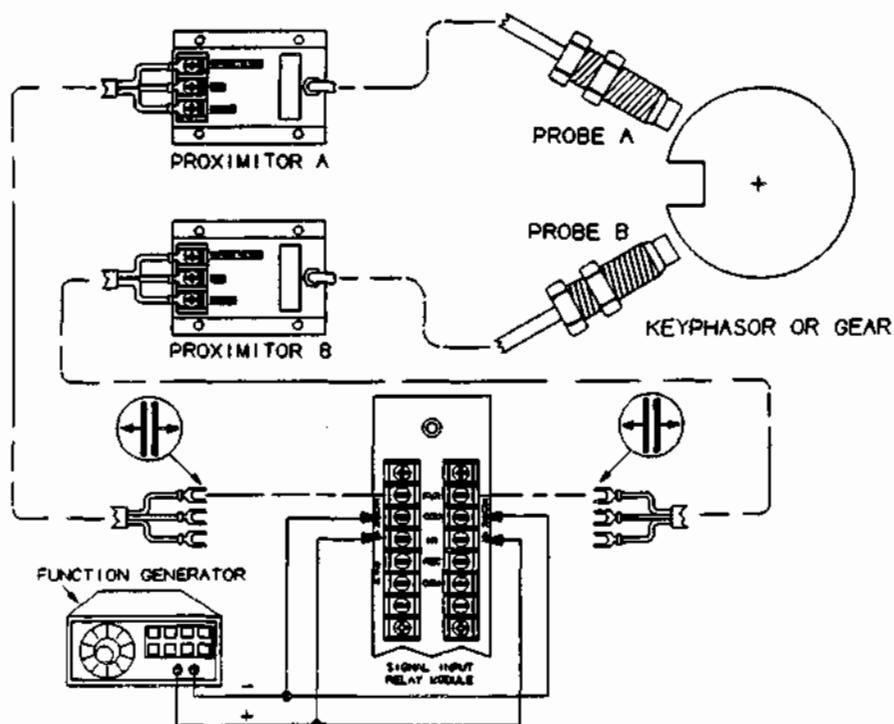**CAUTION**


Tests will exceed Alert set point levels causing Alerts to activate. This could result in relay contact state change. See Bypass Section 17.

WARNING

High Voltage present could cause shock, burns or death.

Do Not touch exposed wires or terminals.

1. Disconnect the COM and IN wiring from the Transducer A and B terminals on the Signal Input Module.
2. Connect a function generator output to an oscilloscope input. Adjust the function generator output until a sine or square wave having sufficient amplitude to trigger the tachometer is displayed.
3. Disconnect the function generator from the oscilloscope. Connect the function generator to the XDCCR A and B terminals on the Signal Input Module.
4. Adjust the function generator frequency until the Tachometer displays an RPM reading below the over speed setpoint(s) and/or above the under speed setpoint(s).
5. Press the RESET switch on the System Monitor and verify that the TRIGGER OK LEDs are on, and the ALERT 1 and ALERT 2 LEDs are off.

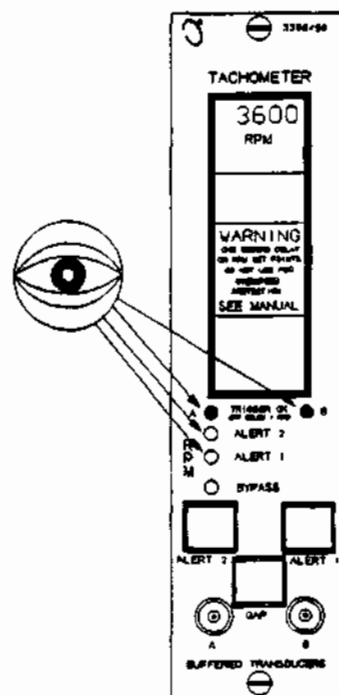

23

Test Alerts (Dual Setpoint Tach.) (Cont.)

6. Adjust the function generator frequency until the Tachometer displays an RPM reading above the ALERT 1 over speed setpoint or below the ALERT 1 under speed setpoint.

7. Verify that the ALERT 1 LED turns on (Flashing if the first out option is selected).

8. Verify that the ALERT 1 relay has changed state.

9. Press the RESET switch on the System Monitor and verify that the ALERT 1 LED remains on steady.

10. Adjust the function generator frequency until the Tachometer displays an RPM reading above the ALERT 2 over speed setpoint or below the ALERT 2 under speed setpoint.

11. Verify that the ALERT 2 LED turns on (Flashing if the first out option is selected).



12. Verify that the ALERT 2 relay has changed state. (The Relay will not change state if the Alert 2 Relay has been Bypassed. See section 17)

13. Press the RESET switch on the System Monitor and verify that the ALERT 2 LED remains on steady.


14. Adjust the function generator frequency until the Tachometer displays an RPM reading below the Alert 1 and 2 over speed setpoints or above the Alert 1 and 2 under speed setpoints.

15. Press the Reset switch on the System Monitor and verify that the Alert 1 and 2 LEDs go off.

16. Connect all field wiring.

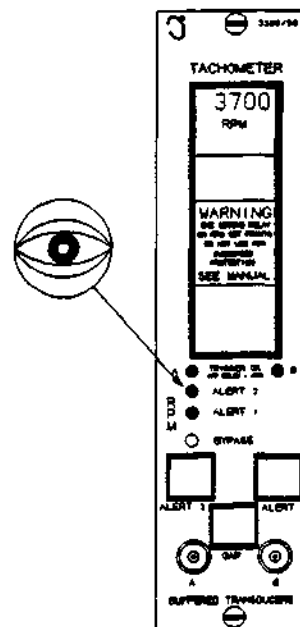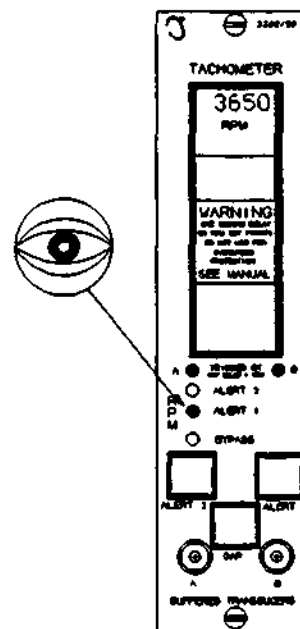

24 Test Alerts (Zero Speed Tach.)

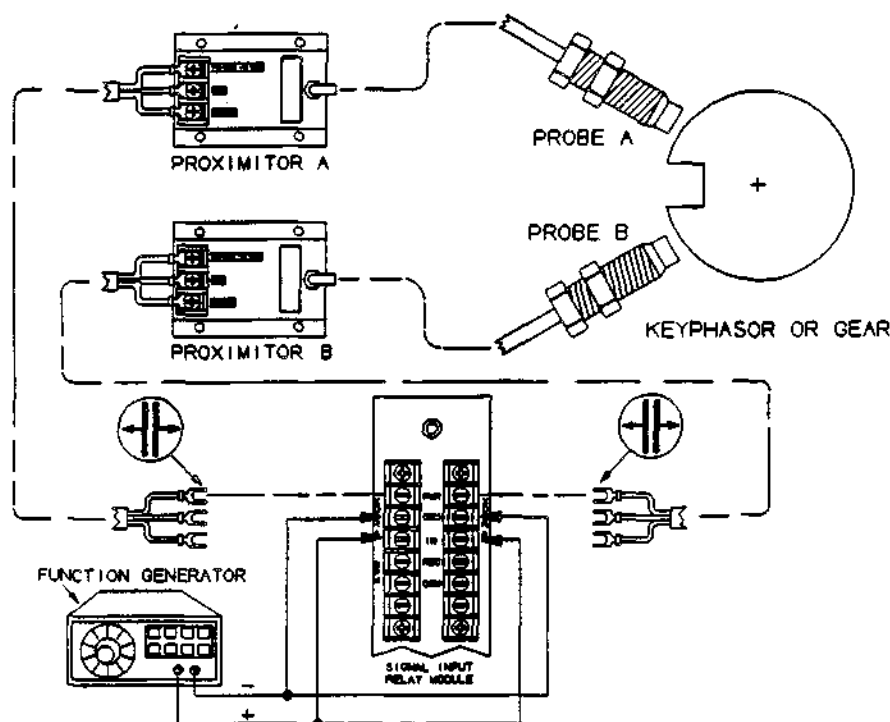

CAUTION


Tests will exceed Alert set point levels causing Alerts to activate. This could result in relay contact state change. See Bypass Section 18.

WARNING

High Voltage present could cause shock, burns or death.

Do Not touch exposed wires or terminals.

1. Disconnect the COM and IN wiring from the Transducer A and B terminals on the Signal Input Module.
2. Connect a function generator output to an oscilloscope input. Adjust the function generator output until a sine or square wave having sufficient amplitude to trigger the tachometer is displayed.
3. Disconnect the function generator from the oscilloscope input and connect it to the XDCR A and B terminals on the Signal Input Module.
4. Adjust the function generator frequency until the Tachometer displays an RPM reading below the over speed setpoint or above the under speed setpoint and over the Zero Speed setpoint.
5. Press the RESET switch and verify that the TRIGGER OK LEDs are on, and the RPM Alert and Zero Speed Alert LEDs are off.

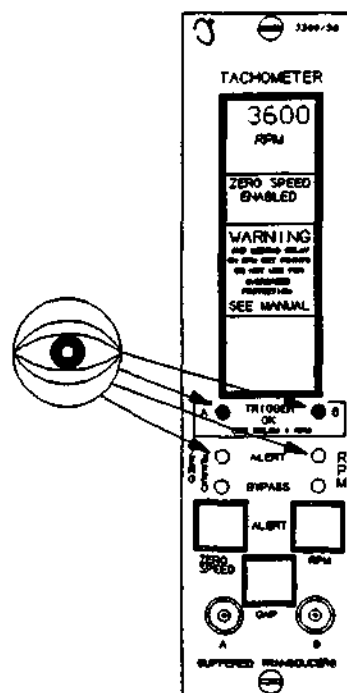

24 Test Alerts (Zero Speed Tach.) (Cont.)

6. Adjust the function generator frequency until the Tachometer displays an RPM reading above the RPM Alert over speed setpoint or below the RPM Alert under speed set point.

7. Verify that the RPM Alert LED turns on (Flashing if the first out option is selected), and that the RPM Alert relay has changed state. (The Relay will not change state if the Alert 1 Relay has been Bypassed. See section 18.)

8. Press the RESET switch on the System Monitor and verify that the RPM Alert LED remains on steady.

9. Short the Zero Speed Enable contacts on the Signal Input Module.

10. Slowly adjust the function generator frequency until the Tachometer displays an RPM reading below the Zero Speed Alert setpoint. (The Zero Speed Alert provides protection against rapid ramp-down. A Zero Speed Alert will not occur if the RPM value is brought down too fast. If this occurs, the TRIGGER OK LED(s) will go out to indicate this condition.)

11. Verify that the Zero Speed Alert LED turns on (Flashing if the first out option is selected).



12. Verify that the Zero Speed Alert relay has changed state. (The Relay will not change state if the Alert 2 Relay has been Bypassed. See section 18.)

13. Press the RESET switch on the System Monitor and verify that the Zero Speed Alert LED remains on steady.

14. Adjust the function generator frequency until the Tachometer displays an RPM reading below the RPM Alert over speed setpoint or above the RPM Alert under speed setpoint and above the Zero Speed Alert setpoint.


15. Press the Reset switch on the System Monitor and verify that the RPM and Zero Speed Alert LEDs go off.

16. Connect all field wiring.

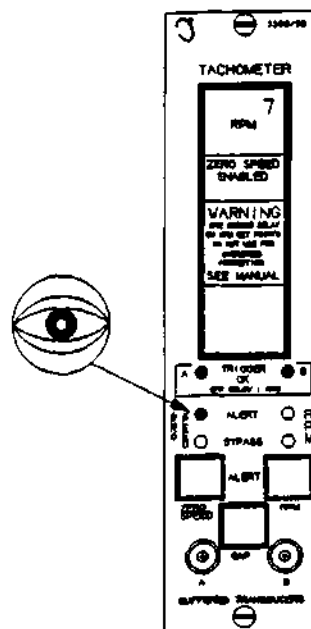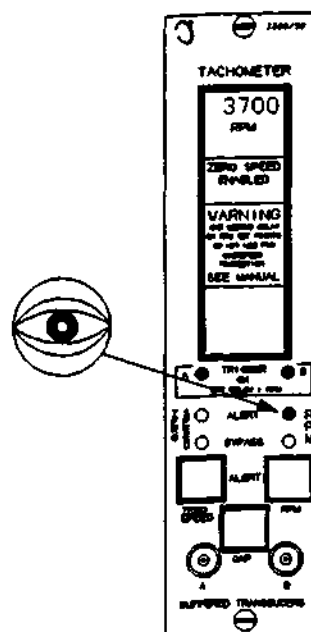

25

Test Alerts (Rotor Accel Tach.)

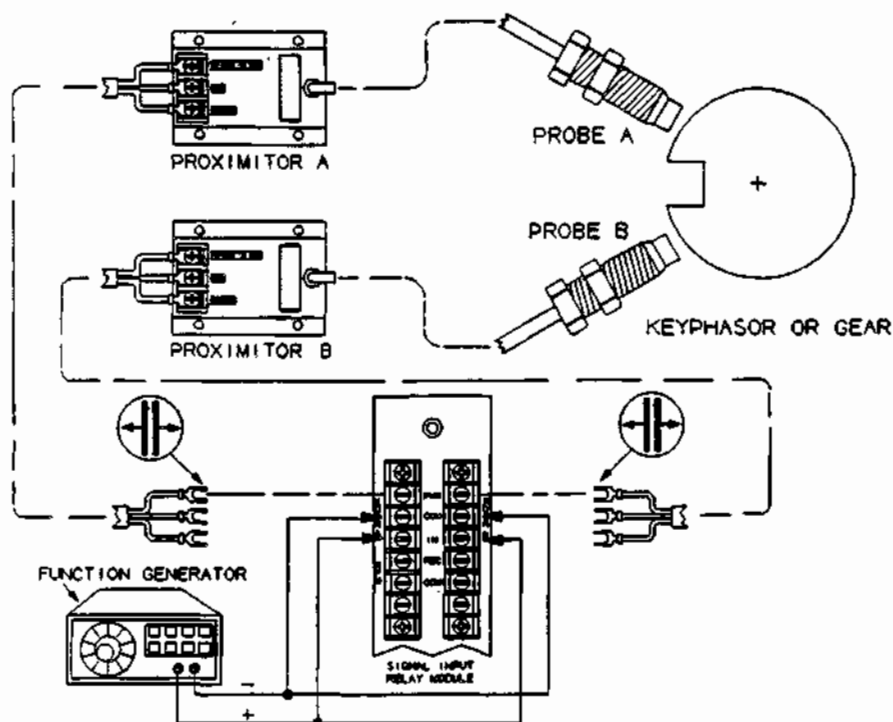**CAUTION**


Tests will exceed Alert setpoint levels causing Alerts to activate. This could result in relay contact state change. See Bypass Section 19.

**WARNING**

High Voltage present could cause shock, burns or death.

Do Not touch exposed wires or terminals.

1. Disconnect the COM and IN wiring from the Transducer A and B terminals on the Signal Input Module.
2. Connect a function generator output to an oscilloscope input. Adjust the function generator output until a sine or square wave having sufficient amplitude to trigger the tachometer is displayed.
3. Disconnect the function generator from the oscilloscope input and connect it to the XDCR A and B terminals on the Signal Input Module.
4. Adjust the function generator frequency until the Tachometer displays an RPM reading below the over speed setpoint or above the under speed setpoint.
5. Press the RESET switch and verify that the TRIGGER OK LEDs are on, and the RPM Alert and RPM/MIN Alert LEDs are off.

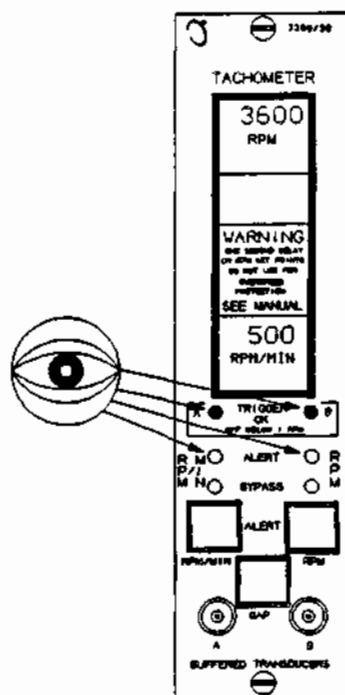

25 Test Alerts (Rotor Accel Tach.) (Cont.)

6. Adjust the function generator frequency until the Tachometer displays an RPM reading above the RPM Alert over speed setpoint or below the RPM Alert under speed setpoint.

7. Verify that the RPM Alert LED turns on (Flashing if the first out option is selected), and that the RPM Alert relay has changed state. (The Relay will not change state if the Alert 1 Relay has been Bypassed. See section 19.)

8. Press the RESET switch on the System Monitor and verify that the RPM Alert LED remains on steady.

9. Adjust the function generator frequency until the Tachometer displays an RPM/MIN reading above the RPM/MIN Alert setpoint.

NOTE: Rotor Acceleration (RPM/MIN) is the rate of change of Rotor Speed (RPM). Therefore, the RPM/MIN display increases as the function generator frequency is increased. The RPM/MIN display returns to Zero if the function generator frequency remains constant.



10. Verify that the RPM/MIN Alert LED turns on (Flashing if the first out option is selected).

11. Verify that the RPM/MIN Alert relay has changed state. (The Relay will not change state if the Alert 2 Relay has been Bypassed. See section 19.)

12. Adjust the function generator until the Tachometer displays an RPM reading below the RPM Alert over speed setpoint or above the RPM Alert under speed setpoint. Leave the generator at this frequency long enough for the RPM/MIN display to settle back to zero.


13. Press the Reset switch on the System Monitor and Verify that the RPM and RPM/MIN LEDs go out.

14. Connect all field wiring.

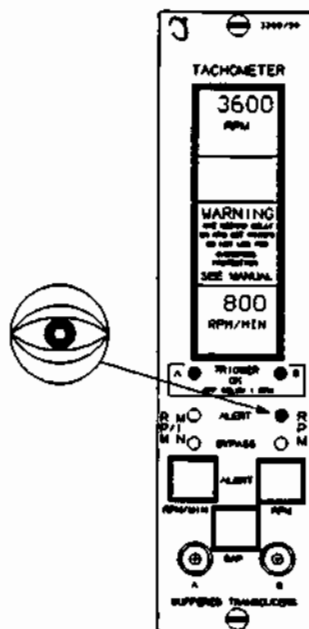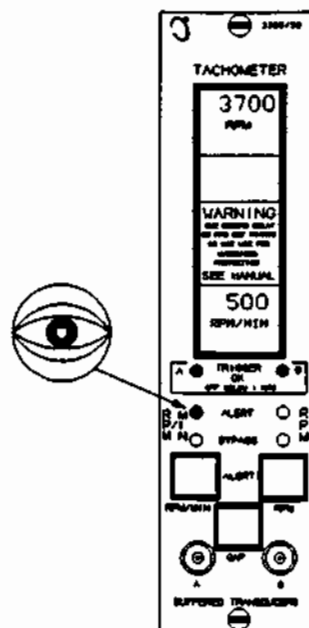

26

Test Trigger OKs

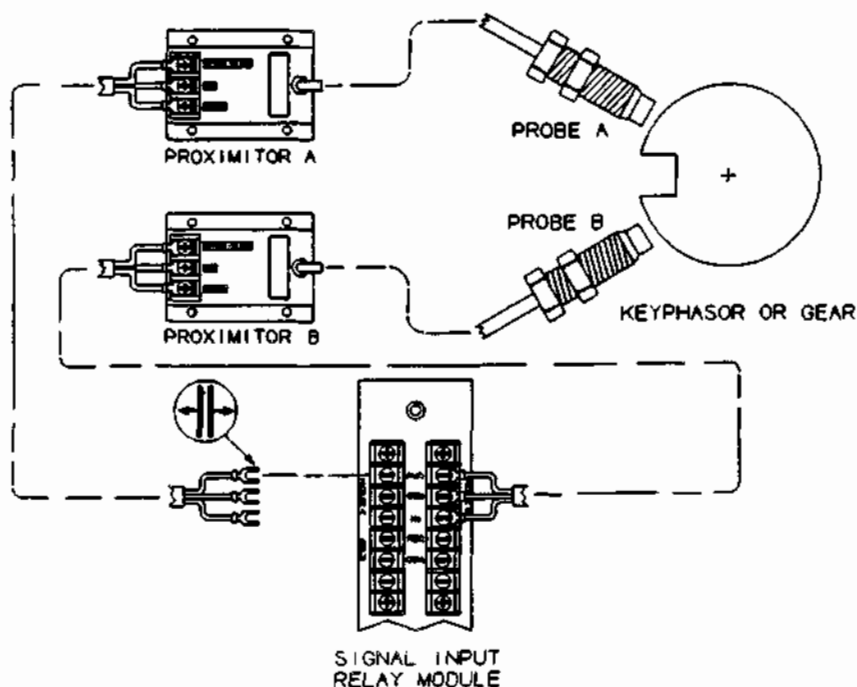**CAUTION**

Machine Protection could be lost during the Test Trigger OKs Procedure.

WARNING

High Voltage present could cause shock, burns or death.

Do Not touch exposed wires or terminals.

1. Disconnect the COM and IN wiring from the Transducer A terminals on the Signal Input Module.


2. Verify that the TRIGGER OK A LED turns off.

NOTE: With low RPMs at one event per revolution, it may take up to one minute for the TRIGGER OK LED to indicate NOT OK.

3. Reconnect the COM and IN wiring from the Transducer A terminals on the Signal Input Module.


4. Verify that the TRIGGER OK A LED turns back on.

NOTE: With low RPMs at one event per revolution, it may take up to several minutes for the TRIGGER OK LED to indicate OK.

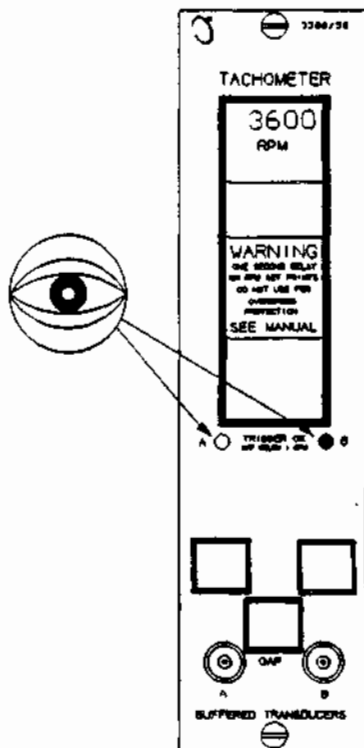

26

Test Trigger OKs (Cont.)

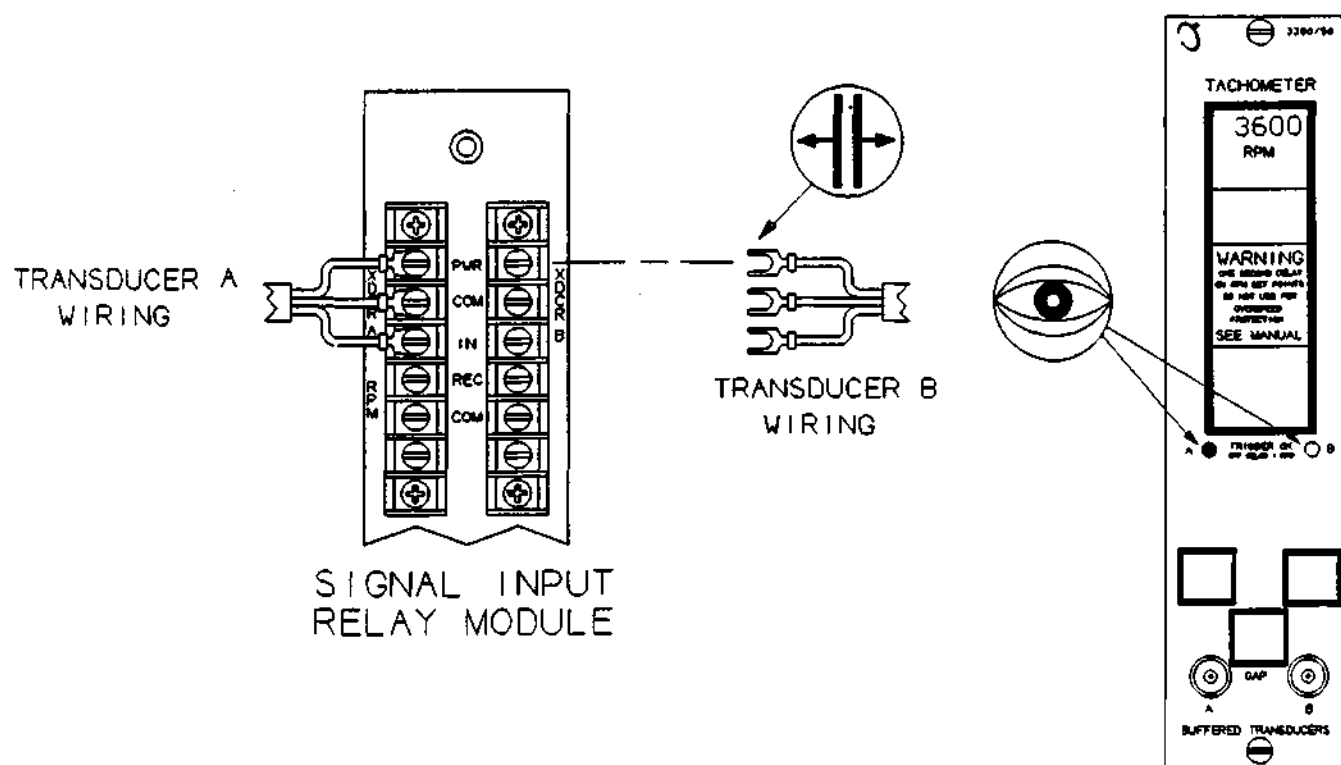

1. Disconnect the COM and IN wiring from the Transducer B terminals on the Signal Input Module.
2. Verify that the TRIGGER OK B LED turns off.

NOTE: With low RPMs at one event per revolution, it may take up to one minute for the TRIGGER OK LED to indicate NOT OK.

3. Reconnect the COM and IN wiring from the Transducer B terminals on the Signal Input Module.
4. Verify that the TRIGGER OK B LED turns back on.

NOTE: With low RPMs at one event per revolution, it may take up to several minutes for the TRIGGER OK LED to indicate OK.

27


SELF TEST

THE MONITOR HAS THREE LEVELS OF SELF TESTS:

POWER-UP TEST: PERFORMED ONLY WHEN THE MONITOR IS TURNED ON.

CYCLIC TEST: PERFORMED CONTINUOUSLY.

USER-INVOKED TEST: PERFORMED ONLY WHEN INITIATED BY USER.

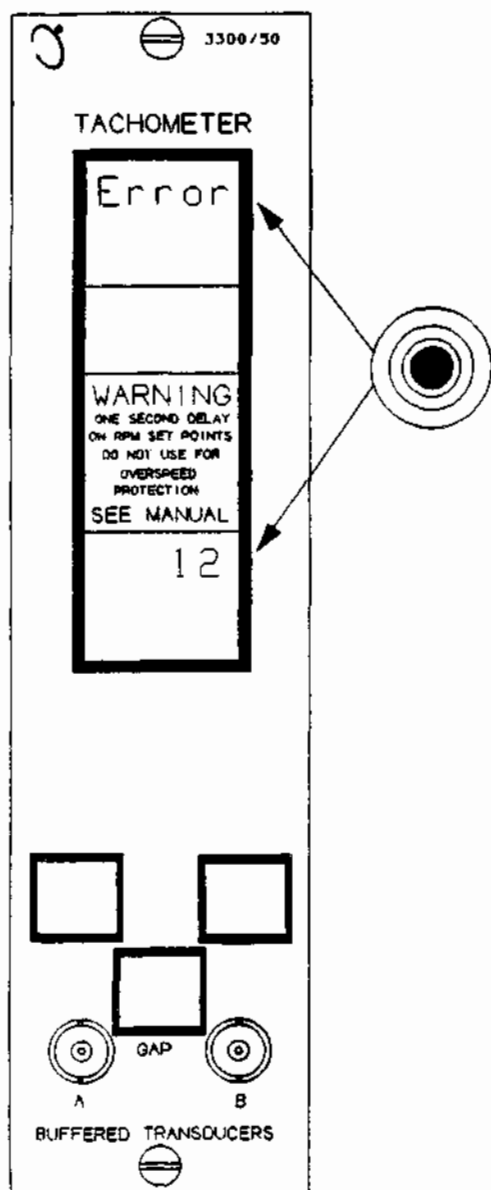

IF ERRORS ARE DETECTED DURING CYCLIC SELF TESTS:

MONITORING IS ABORTED UNTIL THE ERROR IS RESOLVED.

ERROR CODE IS STORED IN MEMORY AND FLASHES ON THE LCD DISPLAY.

BYPASS LED GOES ON AND OK LED FLASHES AT 5 HZ.

IF ERROR IS INTERMITTENT AND GOES AWAY, MONITORING IS RESUMED AND OK LED FLASHES AT 5 HZ.

ERROR CODE IS STORED. USER INVOKED-TEST DISPLAYS AND CLEARS ERROR.

IF ERRORS ARE DETECTED DURING POWER-UP TEST OR USER-INVOKED SELF TEST:


MONITORING IS ABORTED UNTIL USER ACTION RESOLVES PROBLEM.

TEST CAN BE RERUN WITH MONITOR POWER-UP OR USER-INVOKED TEST.

27

SELF TEST (CONT)


INITIATE USER-INVOKED TEST BY SHORTING ACROSS TWO SELF TEST (ST) PINS.

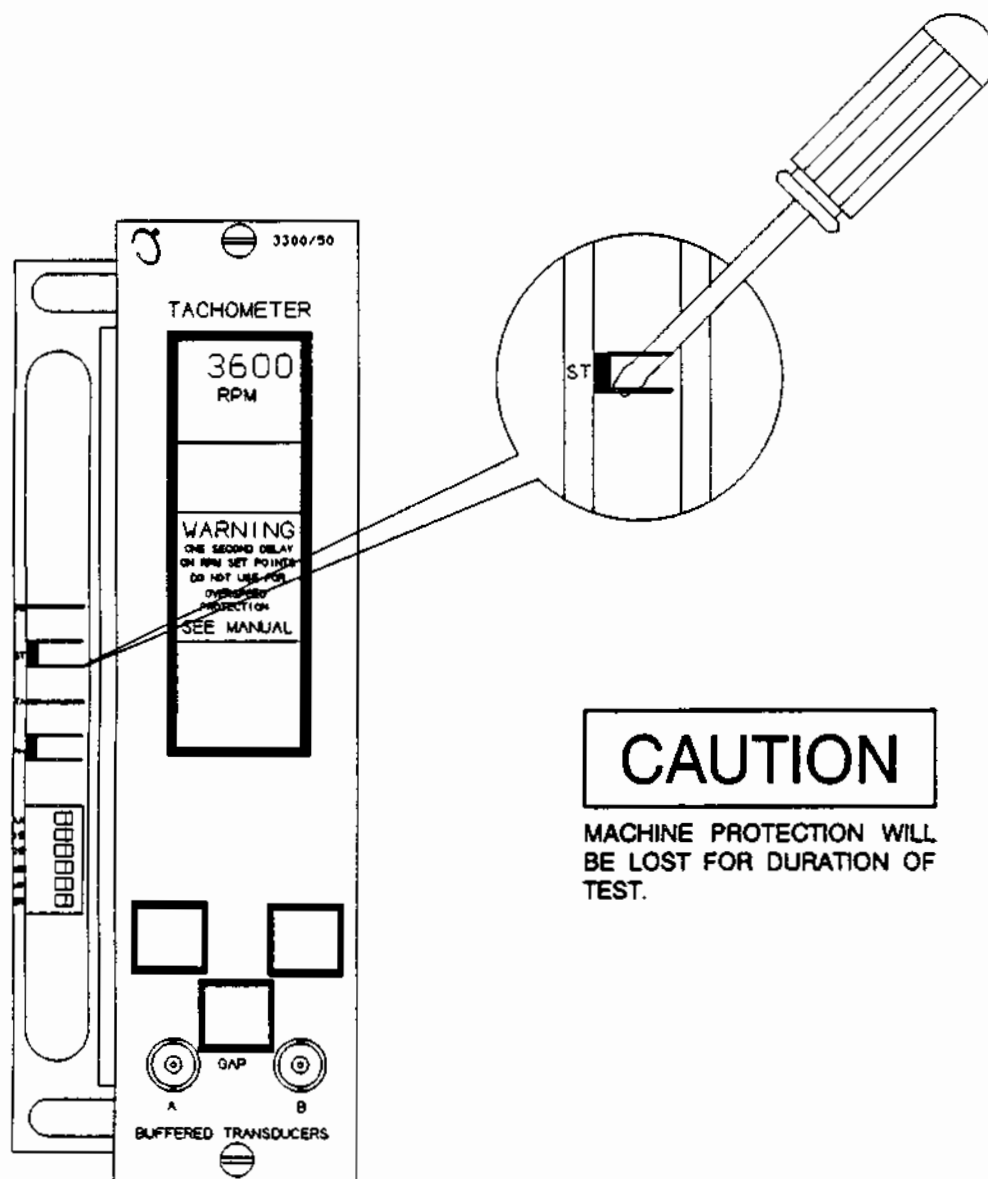


27

SELF TEST (CONT)

AT THE COMPLETION OF USER-INVOKED SELF TEST, THE MONITOR WILL RECALL STORED ERROR CODES, IF ANY. THESE ERROR CODES MUST BE READ AND CLEARED WITH USER INTERACTION TO ALLOW MONITORING TO CONTINUE.

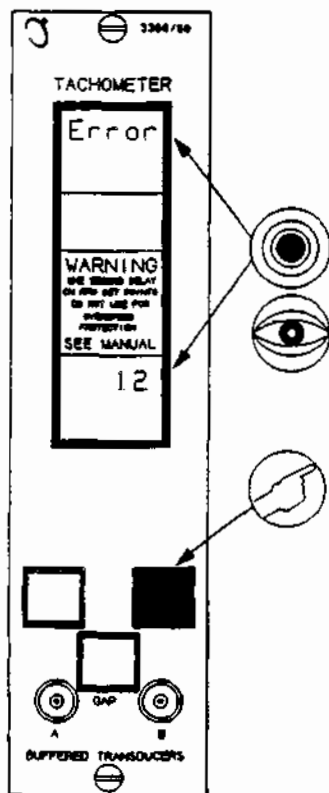


READ CODES ON LIST; STEP THROUGH EACH ERROR CODE ON LIST BY PRESSING AND HOLDING THE RIGHT ALERT SWITCH FOR APPROXIMATELY ONE SECOND.

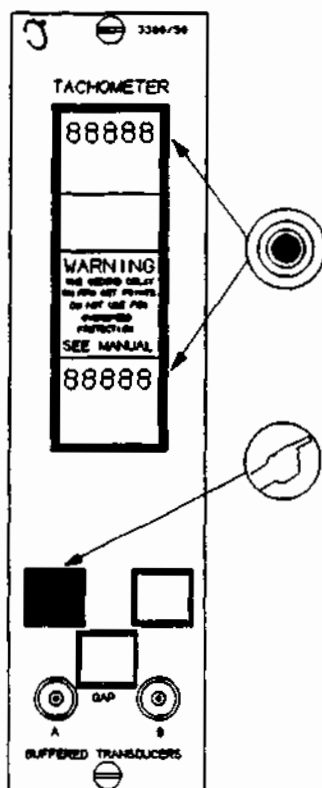

AT THE END OF THE LIST, THE LCD WILL DISPLAY ALL EIGHTS. TO REREAD THE LIST, PRESS THE RIGHT ALERT SWITCH. TO CLEAR THE LIST FROM MEMORY, PRESS AND HOLD THE LEFT ALERT SWITCH FOR APPROXIMATELY ONE SECOND.

27

SELF TEST (CONT)

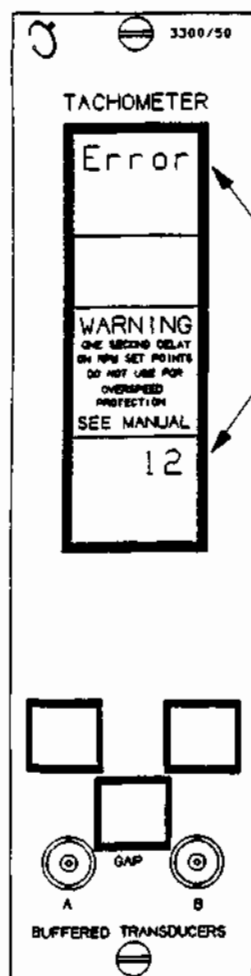


ERROR CODE	DESCRIPTION
2	ROM CHECKSUM HAS FAILED. *
3	EEPROM FAILURE NO. 1. **
4	EEPROM FAILURE NO. 2. *** ADJUST SETPOINTS
5	+7.5V/-VT NODE OUT OF TOLERANCE. **
6	+VRH NODE OUT OF TOLERANCE. **
7	+5V NODE OUT OF TOLERANCE. **
8	MVREF NODE OUT OF TOLERANCE. **
9	+7.5V NODE OUT OF TOLERANCE. **
10	+VRL NODE OUT OF TOLERANCE. **
12	+5V/-7.5V NODE OUT OF TOLERANCE. **
14	RAM FAILURE. *
17	COP WATCHDOG NOT CONFIGURED. *
21	INCORRECT SWITCH OR SWITCH COMBINATION. ****
32	AUTO THRESHOLD OR MAGNETIC PICKUP NOT ALLOWED WITH A ZERO SPEED TACHOMETER.
33	THE PROCESSOR HAS NOT BEEN PROGRAMMED FOR THE TACHOMETER TYPE. *
34	THE INPUT FREQUENCY TO THE TACHOMETER IS TOO HIGH FOR PROPER OPERATION.

- * TESTED ONLY AT POWER-UP OR USER-INVOKED SELF TEST. THIS ERROR IS DISPLAYED ON THE FRONT PANEL BUT IS NOT STORED IN MEMORY.
- ** TESTED ONLY AT CYCLIC SELF TEST. ERRORS 2, 3 AND 14 ARE NONRECOVERABLE AND ERRORS 5 THROUGH 12 COULD BE INTERMITTENT AND RECOVERABLE.
- *** ERROR 4 IS A SETPOINT FAILURE AND MAY BE CORRECTED BY ADJUSTING ALL SETPOINTS IN THE MONITOR.
- **** TESTED ONLY WHEN MONITOR IS IN SETUP MODE.

28

Field Wiring Diagram (Dual Setpoint Tach)

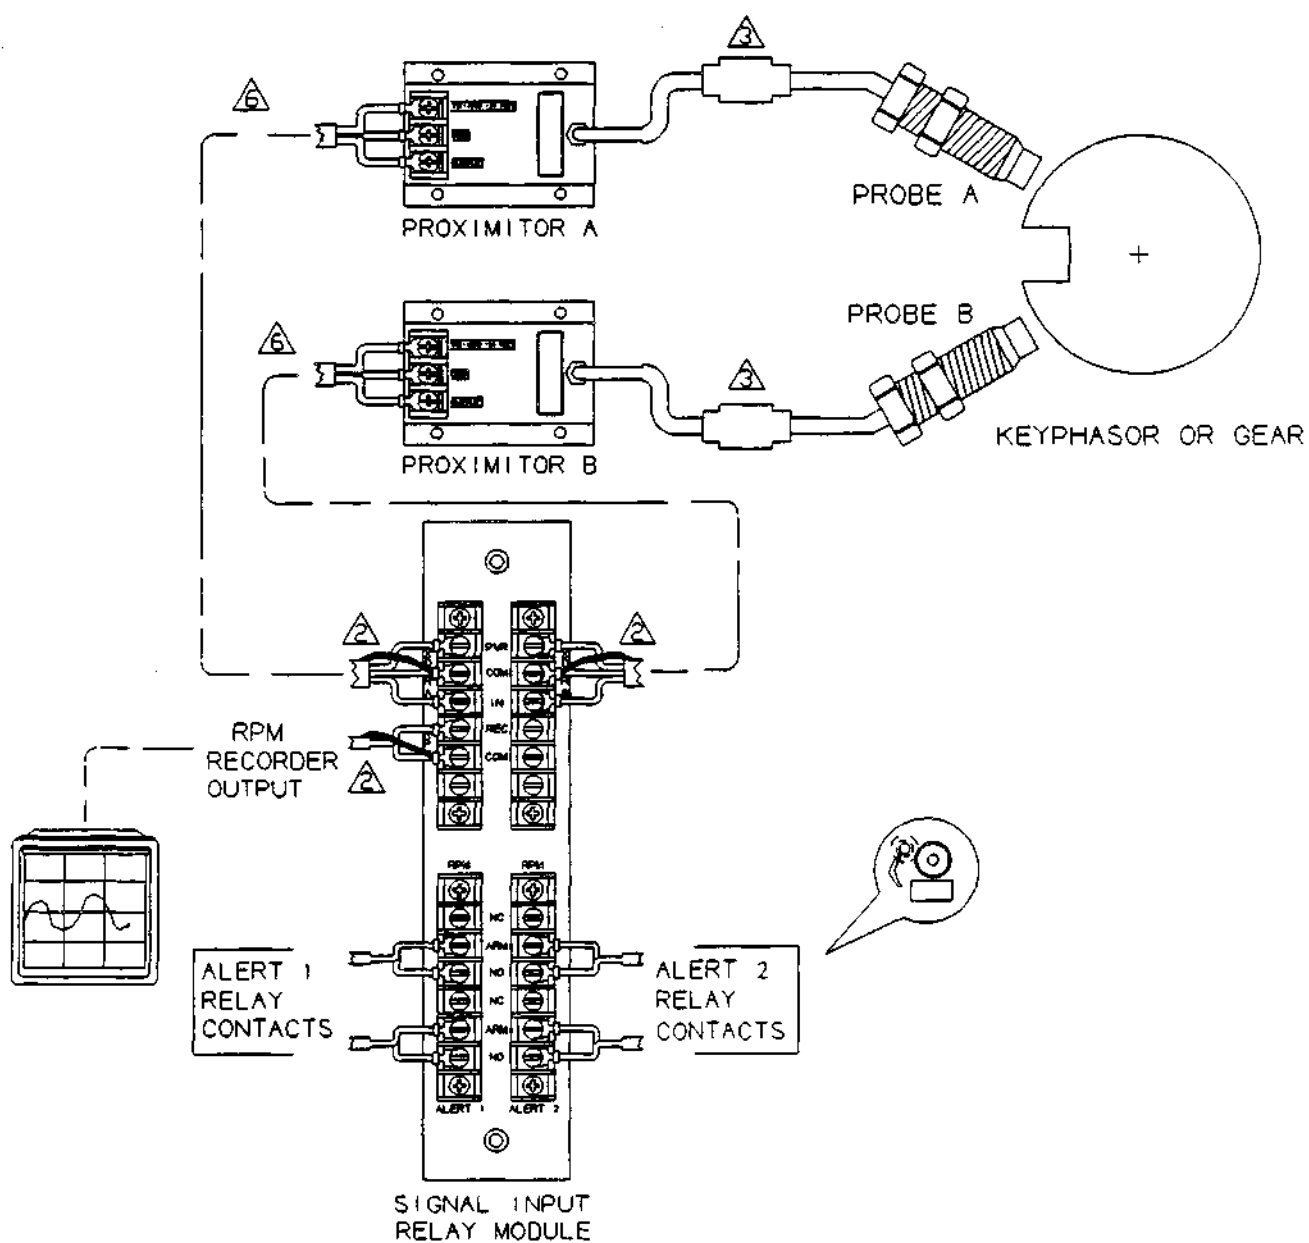

28 Field Wiring Diagram (Dual Setpoint Tach) (Cont)**1. Wiring Recommendations:**

- a. Signal Module to Proximitor, 18 to 22 AWG solid or stranded 3 - wire shielded with insulating sheath. 1000 feet (305 metres) maximum.
- b. Signal Module to Recorder, 18 to 22 AWG solid or stranded 2 - wire shielded with insulating sheath.

2. Shields terminated to Signal Module Common.

3. To electrically isolate and protect coaxial connection, use connector protector kit part number 40113-02.


4. To minimize ground loops, a single point earth ground (GND) to system common (COM) connection is recommended.

5. Proximitor case must be electrically isolated from earth ground. Electrical isolation: 500 Vac (RMS) minimum. Isolation kit part number 19094-01 may be used to satisfy isolation requirement.

6. Maximum cable length between Signal Input Relay Module and Proximitor must not exceed 1000 feet (305 metres).

29

Field Wiring Diagram (Zero Speed Tach)

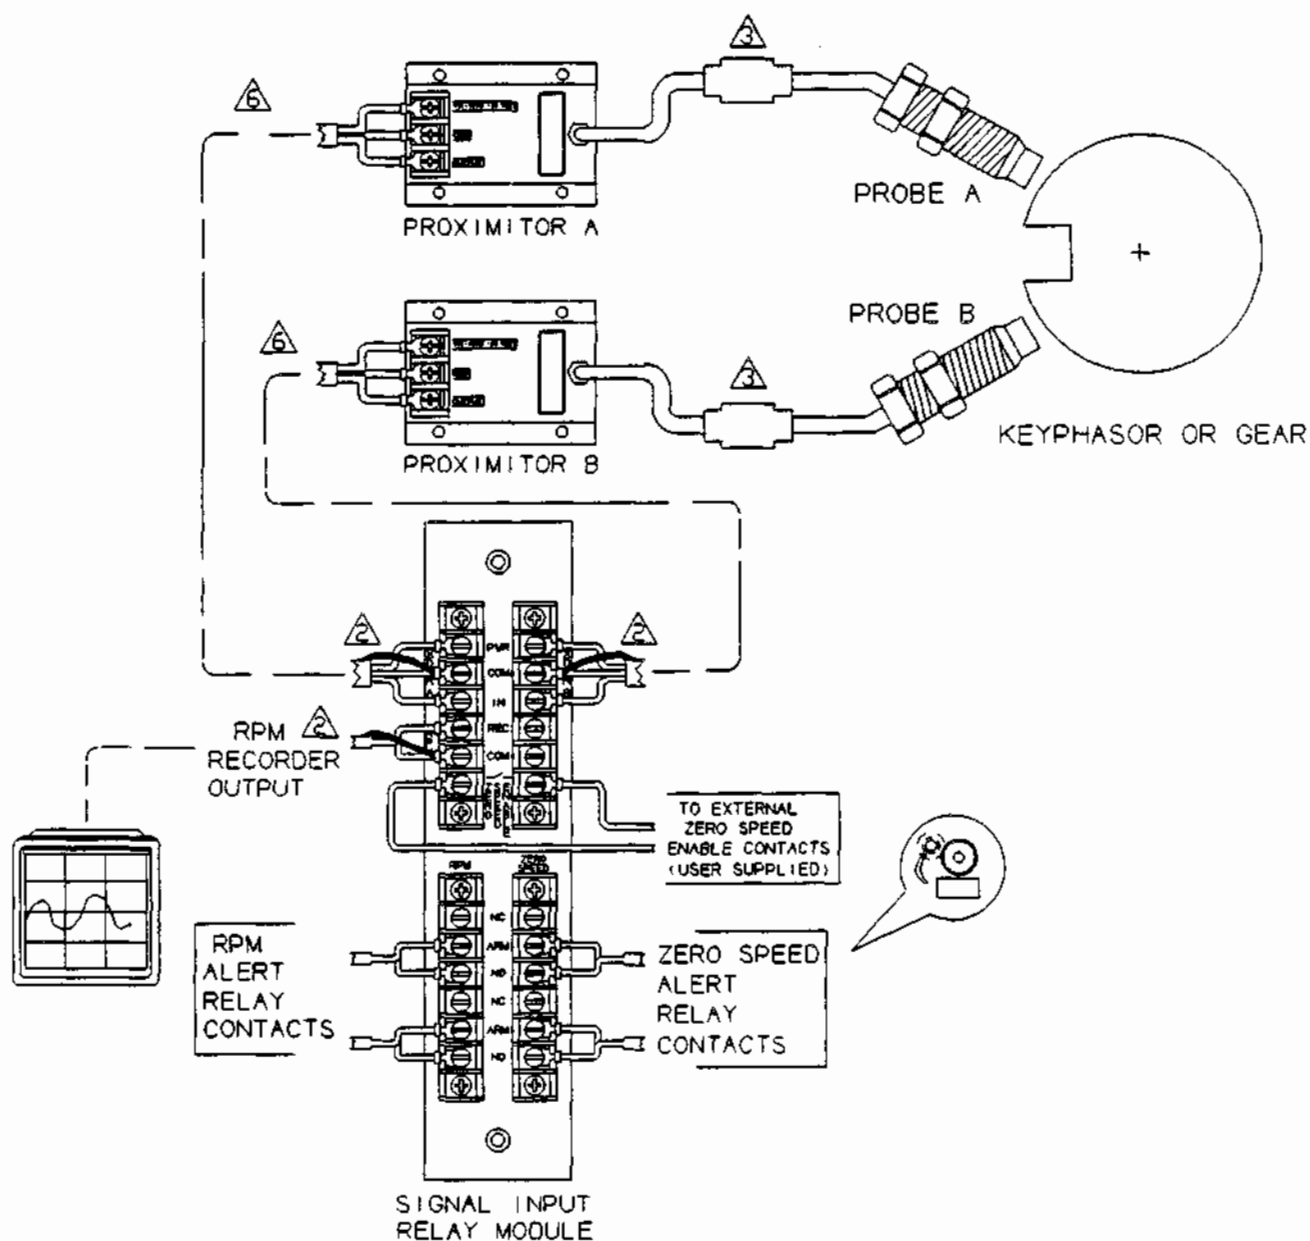

29**Field Wiring Diagram (Zero Speed Tach) (Cont)****1. Wiring Recommendations:**

- a. Signal Module to Proximitior, 18 to 22 AWG solid or stranded 3 - wire shielded with insulating sheath. 1000 feet (305 metres) maximum.
- b. Signal Module to Recorder, 18 to 22 AWG solid or stranded 2 - wire shielded with insulating sheath.

2. Shields terminated to Signal Module Common.

3. To electrically isolate and protect coaxial connection, use connector protector kit part number 40113-02.


4. To minimize ground loops, a single point earth ground (GND) to system common (COM) connection is recommended.

5. Proximitior case must be electrically isolated from earth ground. Electrical isolation: 500 Vac (RMS) minimum. Isolation kit part number 19094-01 may be used to satisfy isolation requirement.

6. Maximum cable length between Signal Input Relay Module and Proximitior must not exceed 1000 feet (305 metres).

30

Field Wiring Diagram (Rotor Accel Tach)

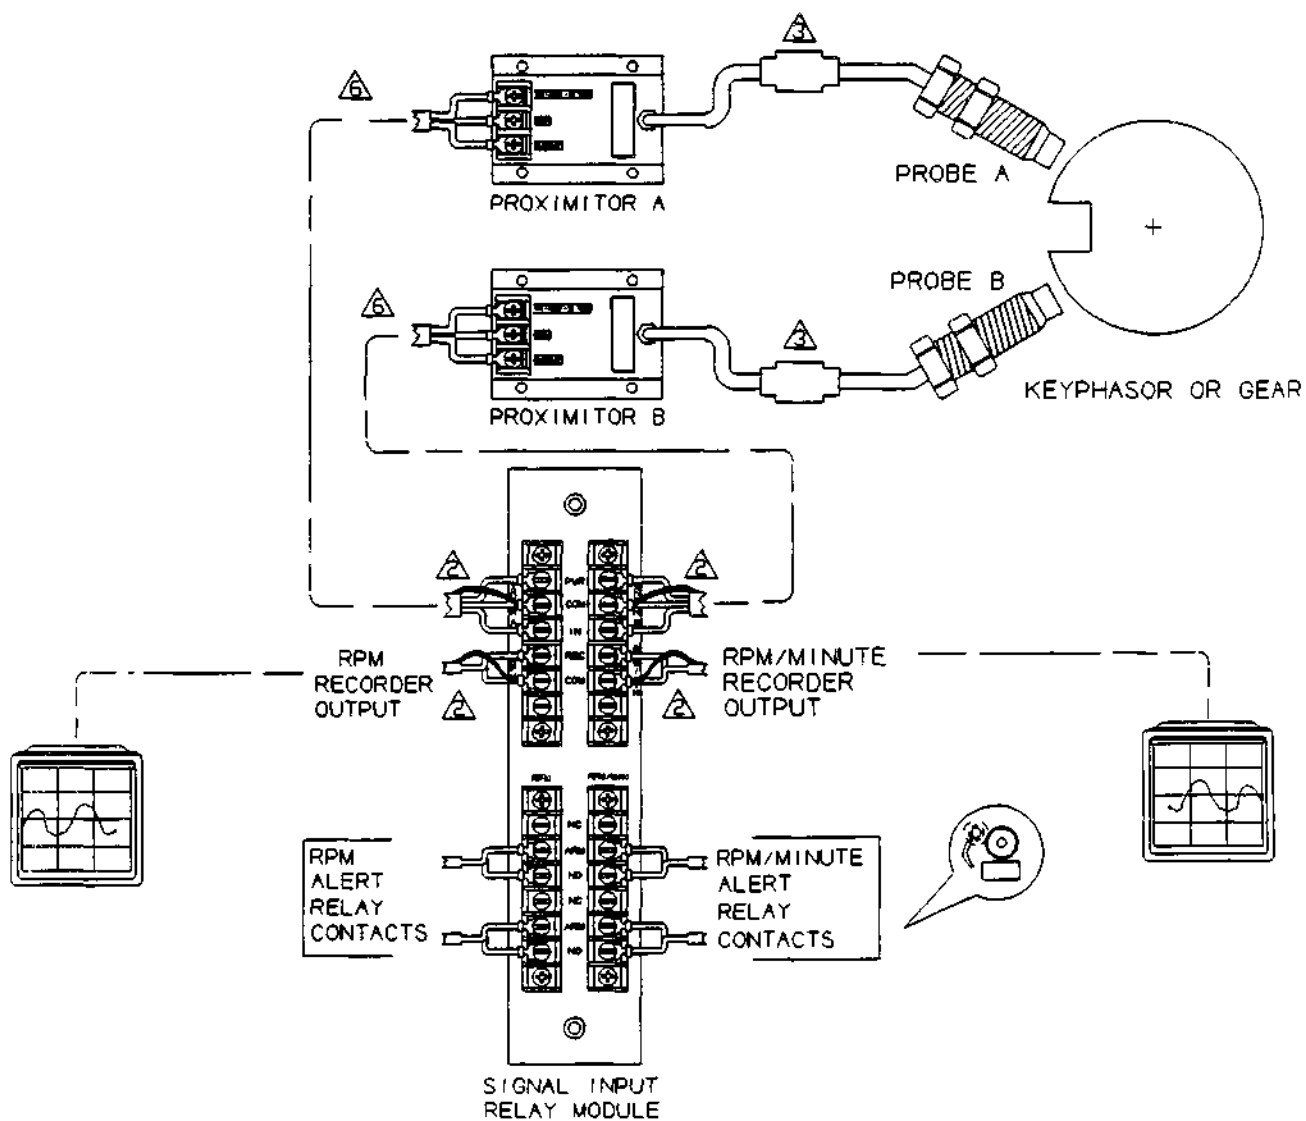

30**Field Wiring Diagram (Rotor Accel Tach) (Cont)****1. Wiring Recommendations:**

- a. Signal Module to Proximitior, 18 to 22 AWG solid or stranded 3 - wire shielded with insulating sheath. 1000 feet (305 metres) maximum.
- b. Signal Module to Recorder, 18 to 22 AWG solid or stranded 2 - wire shielded with insulating sheath.

2. Shields terminated to Signal Module Common.

3. To electrically isolate and protect coaxial connection, use connector protector kit part number 40113-02.

4. To minimize ground loops, a single point earth ground (GND) to system common (COM) connection is recommended.

5. Proximitior case must be electrically isolated from earth ground. Electrical isolation: 500 Vac (RMS) minimum. Isolation kit part number 19094-01 may be used to satisfy isolation requirement.

6. Maximum cable length between Signal Input Relay Module and Proximitior must not exceed 1000 feet (305 metres).

31

Recommended Spare Parts

QTY	DESCRIPTION	PART NUMBER
	TACHOMETER	3300/50 - - - -
1	FRONT PANEL ASSEMBLY	78412-04 78412-03 78412-03
1	MONITOR CIRCUIT ASSEMBLY	82962-01
1	EXPANDER BOARD PWA	81410-01
1	SIGNAL INPUT RELAY MODULE	
	NO RELAYS	84689-01
	EPOXY SEALED RELAYS	84140-01
	HERMETICALLY SEALED RELAYS	84146-01
	NO RELAYS	84689-01
	EPOXY SEALED RELAYS	84141-01
	HERMETICALLY SEALED RELAYS	84147-01
	NO RELAYS	84689-01
	EPOXY SEALED RELAYS	84142-01
	HERMETICALLY SEALED RELAYS	84148-01

To order replacement parts, specify the complete part number according to this table as indicated on the identification decal. If the monitor has been modified, specify the modification number on the parts order. User must set programmable options (Reference section 10 of this manual). If in doubt about the part number, call your Bently Nevada Corporation representative before ordering.



TACHOMETER

PART NO. 3300/50 - - - -

MODIFICATION NUMBER

CUSTOMER ORDER

S/N

DATE

RECORDING OUTPUT

32**Specifications****INPUTS**

Signal Inputs: Redundant inputs. Any two of the following:
Proximity Probes. 0 to -24 or 0 to -18 Volt.
Magnetic Pickups. (Not allowed for Zero Speed Application)
3300 System (Rack) Keyphasors.

Input Impedance: 10k Ohm

Input Frequency: 10kHz Maximum

SIGNAL CONDITIONING

OK Detection: A Transducer is detected as NOT OK if the RPM reading changes more than 50% between consecutive input triggers above 100 RPM. A Transducer must have three consecutive OK readings before it can return to OK from a NOT OK status. A Transducer is also detected as NOT OK if the RPM value is above 99,999 RPM or below 1 RPM.

Transducer Switching: The Tachometer automatically switches to the OK transducer if one should go NOT OK. The monitor uses the highest RPM reading of the two transducers, when both are OK.

Input Threshold: Jumper optioned for Automatic or Manual. (Automatic not allowed on Zero Speed Tachometers)

Automatic Threshold: Limited to inputs above 5 Hz or 300 RPM at one event per revolution.

Hysteresis: Jumper selectable from 0.2 to 2.0 Volts.

Events per Revolution: 255 Maximum, 0.1 Minimum

RPM ALERTS

Setpoints: Adjustable from 1 to 99,999 RPM

Requirements: Three valid input triggers above an over speed setpoint or below an under speed setpoint.

Alert Delay: One second or three valid input triggers, whichever is greatest.

RPM/MIN ALERT (Rotor Accel Tach Only)

Setpoint: Adjustable from 20 to 9,980 RPM/MIN in 20 RPM/MIN steps.

Requirements: Three valid input triggers above the RPM/MIN setpoint.

Alert Delay: One second or three valid input triggers, whichever is greatest.

32 Specifications (Cont)

ZERO SPEED ALERT (Zero Speed Tach Only)

- Setpoint:** Adjustable from 1 to 100 RPM
- Requirements:** External Zero Speed Enable contacts (user-supplied) must be closed. Three valid inputs below the Zero Speed setpoint, or one minute (maximum) without an input trigger. Both transducers must meet all OK detection requirements as the rotor speed approaches the Zero Speed setpoint.
- Alert Delay:** One second or three valid input triggers, whichever is greatest. One minute is required to declare a Zero Speed Alert when three input triggers are not detected. (Machine rotor at zero RPM)

RPM DISPLAY

- Range:** 1 to 99,999 RPM
- Resolution:** +/- 1 RPM
- Accuracy:** +/- 1 RPM @ 25°C.
- Over/Under Indicators:** One of two arrows indicates whether an RPM setpoint is an over or under Alert. The over arrow flashes to indicate an over range condition.

RPM/MIN DISPLAY (Rotor Accel Tach Only)

- Range:** -9,999 to 9,999 RPM/MIN
- Resolution:** +/- 1 RPM/MIN
- Accuracy:** +/- 20 RPM/MIN @ 25°C.
- Over Indicator:** The over arrow flashes to indicate an over range condition.

ZERO SPEED DISPLAY (Zero Speed Tach Only)

- "ZERO SPEED":** Indicates Zero Speed Monitor (Always on during monitoring)
- "ENABLED":** Indicates when the Zero Speed Enable contacts (user-supplied) have been closed.
- "ALERT":** Indicates when a Zero Speed Alert setpoint is being read or adjusted.

LEDs

- Green:** Annunciates the TRIGGER OK condition or monitor OK condition.
- Red:** Annunciates ALERTS and BYPASS conditions.

32**Specifications (Cont)****CONTROLS**

- Front Panel:** Front panel switches (3) for reading the ALERT setpoints, PEAK HOLD value, and probe gap voltage.
- Internal:** Switches on circuit board for setpoint adjustment, Relay Bypass, Monitor Bypass, and monitor set-up.
- External:** External remote controls: Reset, Inhibit, setpoint, full scale and hysteresis adjust (r and i).

OUTPUT

- Recorder:** Output proportional to selected full scale RPM (and RPM/MIN) ranges. Output is protected against continuous short circuit to ground:
+4 mA to +20 mA, +12 Vdc compliance.
+1 Vdc to +5 Vdc, 100 Ohm minimum output impedance.
0 Vdc to -10 Vdc, 100 Ohm minimum output impedance.
- Transducer Power:** -24 Vdc or -18 Vdc per option selected in Power Supply. Output is short circuit protected.
- Alerts and OK:** Relay drives for Alerts and monitor (system) OK.

RELAY CONTACT RATINGS

- Relays:** 5 Amps @ 120 Vac 50/60 Hz.
5 Amps @ 28 Vdc.

ENVIRONMENTAL

- Temperature:** Operating +32°F to +149°F (0°C to +65°C).
Storage -40°F to +185°F (-40°C to +85°C).
- Humidity:** 0 to 95%, noncondensing.

33

Index


	PAGE
ALERT	28, 29, 30, 31, 32, 33
ALERT BYPASS	34, 35, 36
ALERT RELAYS	41, 43, 45
BUFFERED OUTPUTS	4, 5, 6, 24, 25, 26, 27
CYCLIC TEST	48, 49, 50, 51
ERROR CODE	51
EVENTS PER REVOLUTION	18, 19, 20, 21, 22, 23
FIRST OUT	41, 43, 45
FIRST OUT ALERT	41, 43, 45
FRONT PANEL	4, 5, 6
FULL SCALE	11, 15, 16, 17
GAP	4, 5, 6
HYSTERESIS	24, 25, 26, 27
MONITOR BYPASS	37, 38, 39
MONITOR OK	46, 47
OPTIONS	11
OK RELAY	46, 47
PART NUMBER	11
POWER-UP TEST	48, 51
PROBE GAP VOLTAGE	4, 5, 6
RECORDER OUTPUT	11
ROTOR ACCEL ALERT	32, 33, 44, 45
ROTOR ACCELERATION	32, 33, 44, 45
ROTOR SPEED MONITORING	28, 29, 40, 41
RPM ALERT	28, 29, 40, 41
SELF TEST	48, 49, 50, 51
SETPOINT	28, 29, 30, 31, 32, 33, 40, 41, 42, 43, 44, 45
SPARE PARTS	58
THRESHOLD	24, 25, 26, 27
TRIGGER OK	46, 47
USER-INVOKED TEST	48, 49, 51
WIRING DIAGRAMS	52, 53, 54, 55, 56, 57
ZERO SPEED	30, 31, 35, 38, 42, 43
ZERO SPEED ALERT	30, 31, 42, 43

34

Appendix

SCHEMATICS AND TECHNICAL DRAWINGS




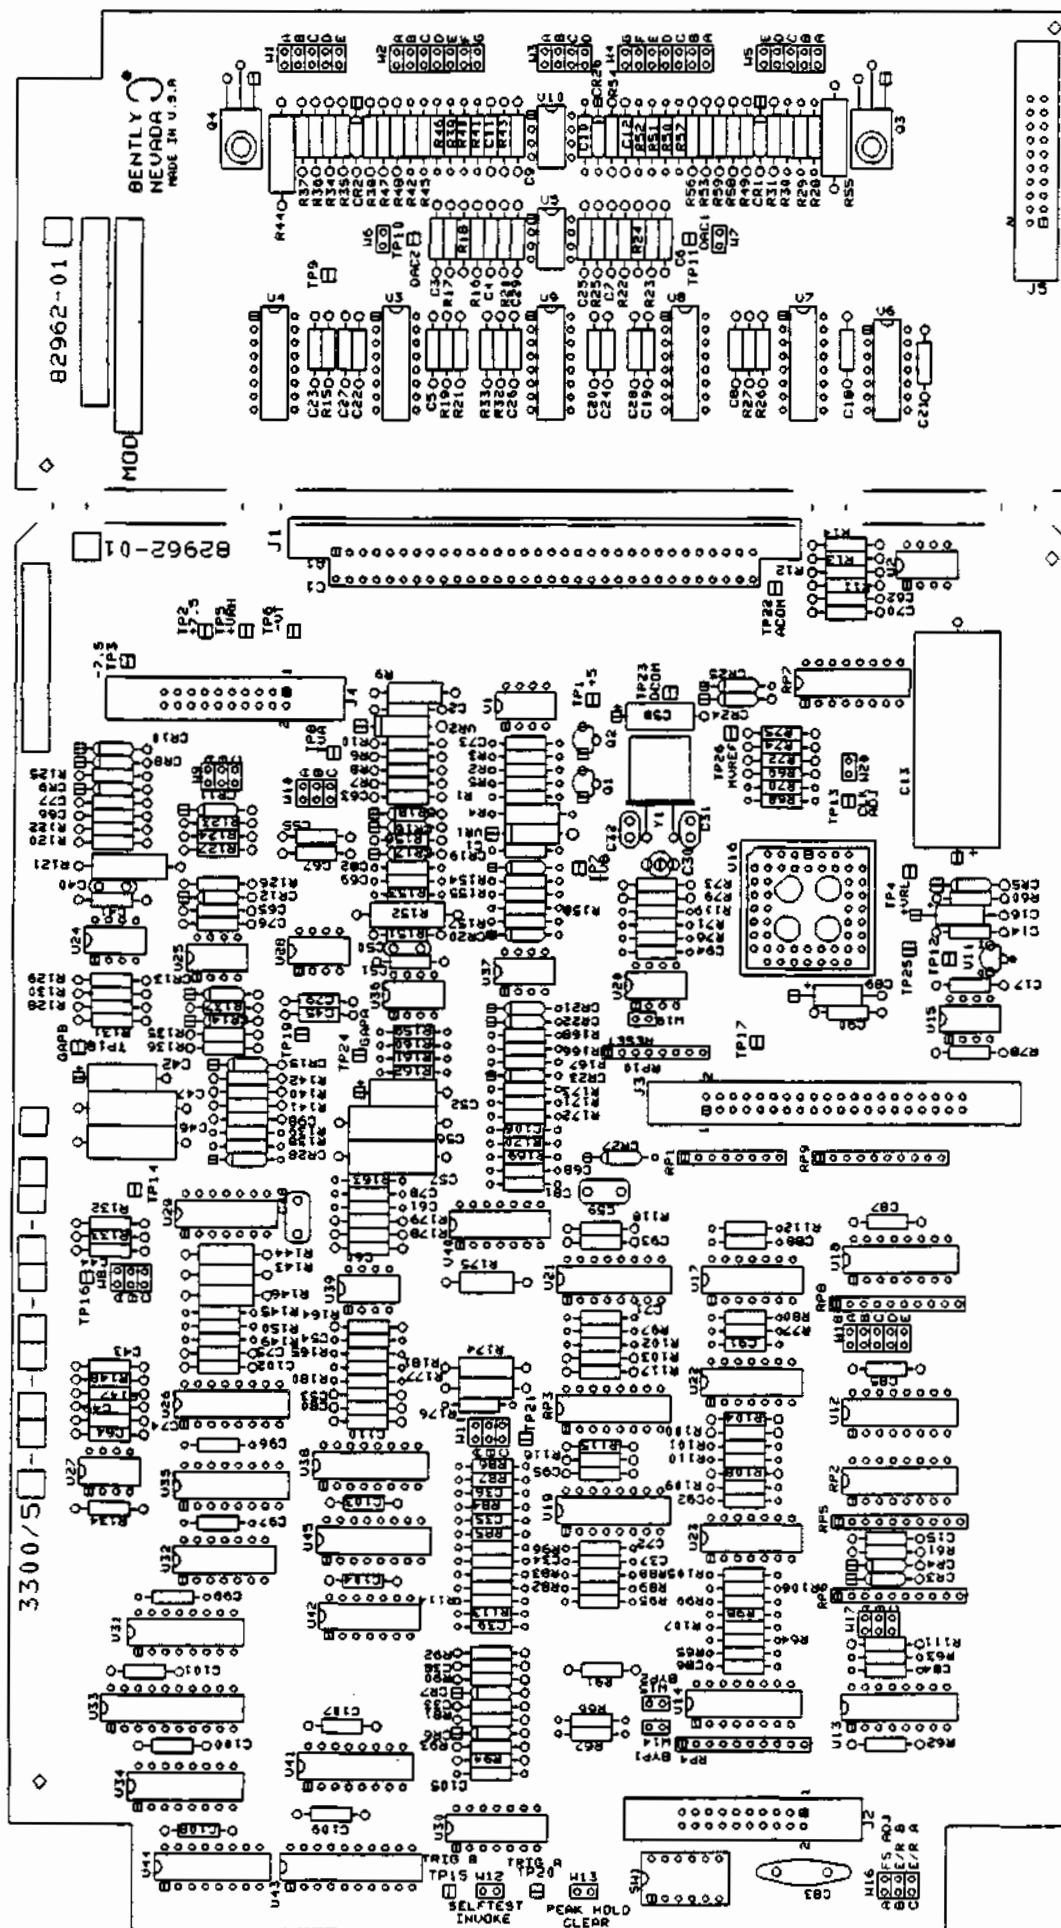


SPARE COMPONENTS	
COMPONENT	SHEET ZONE
U30	2 A-4
PR3	4 A-5
RP1	4 C-6
RP10	5 D-5
U6	7 A-4
U9	7 A-3
U2	8 C-5
U40	2 A-2
U29	3 A-2


REFERENCE DESIGNATORS	
LAST USED	NOT USED
C118	
DR28	
J5	
Q4	
R181	
RP10	
SW1	
TP26	
U46	
U42	
U20	
Y1	

VOLTAGE CHART			
REF DESIG	PIN NO.	TO	
U1, 24, 25, 27, 28, 36, 39	8	+7.5	
	4	-0V	
U2, 5	8	+7.5	
	4	-7.5	
U3, 8	13	+5P	
	3	-7.5P	
U4, 7	16	+5P	
	8	000P	
U6	14	+5P	
	7	000P	
U9	12	+5P	
	13	+7.5P	
	7	000P	
	3	-7.5P	
U10	8	+0P	
	4	-0P	
U12, 13, 14, 18, 31, 34, 35, 41, 44, 45	16	+5	
	8	000H	
U16	26	+5	
	1	000H	
U17	3	+5	
	12	000H	
U19, 21	16	+5	
	8	000H	
	7	-7.5	
U22, 23, 29, 30, 32, 40, 42	14	+5	
	7	000H	
U33, 43	20	+5	
	10	000H	

 


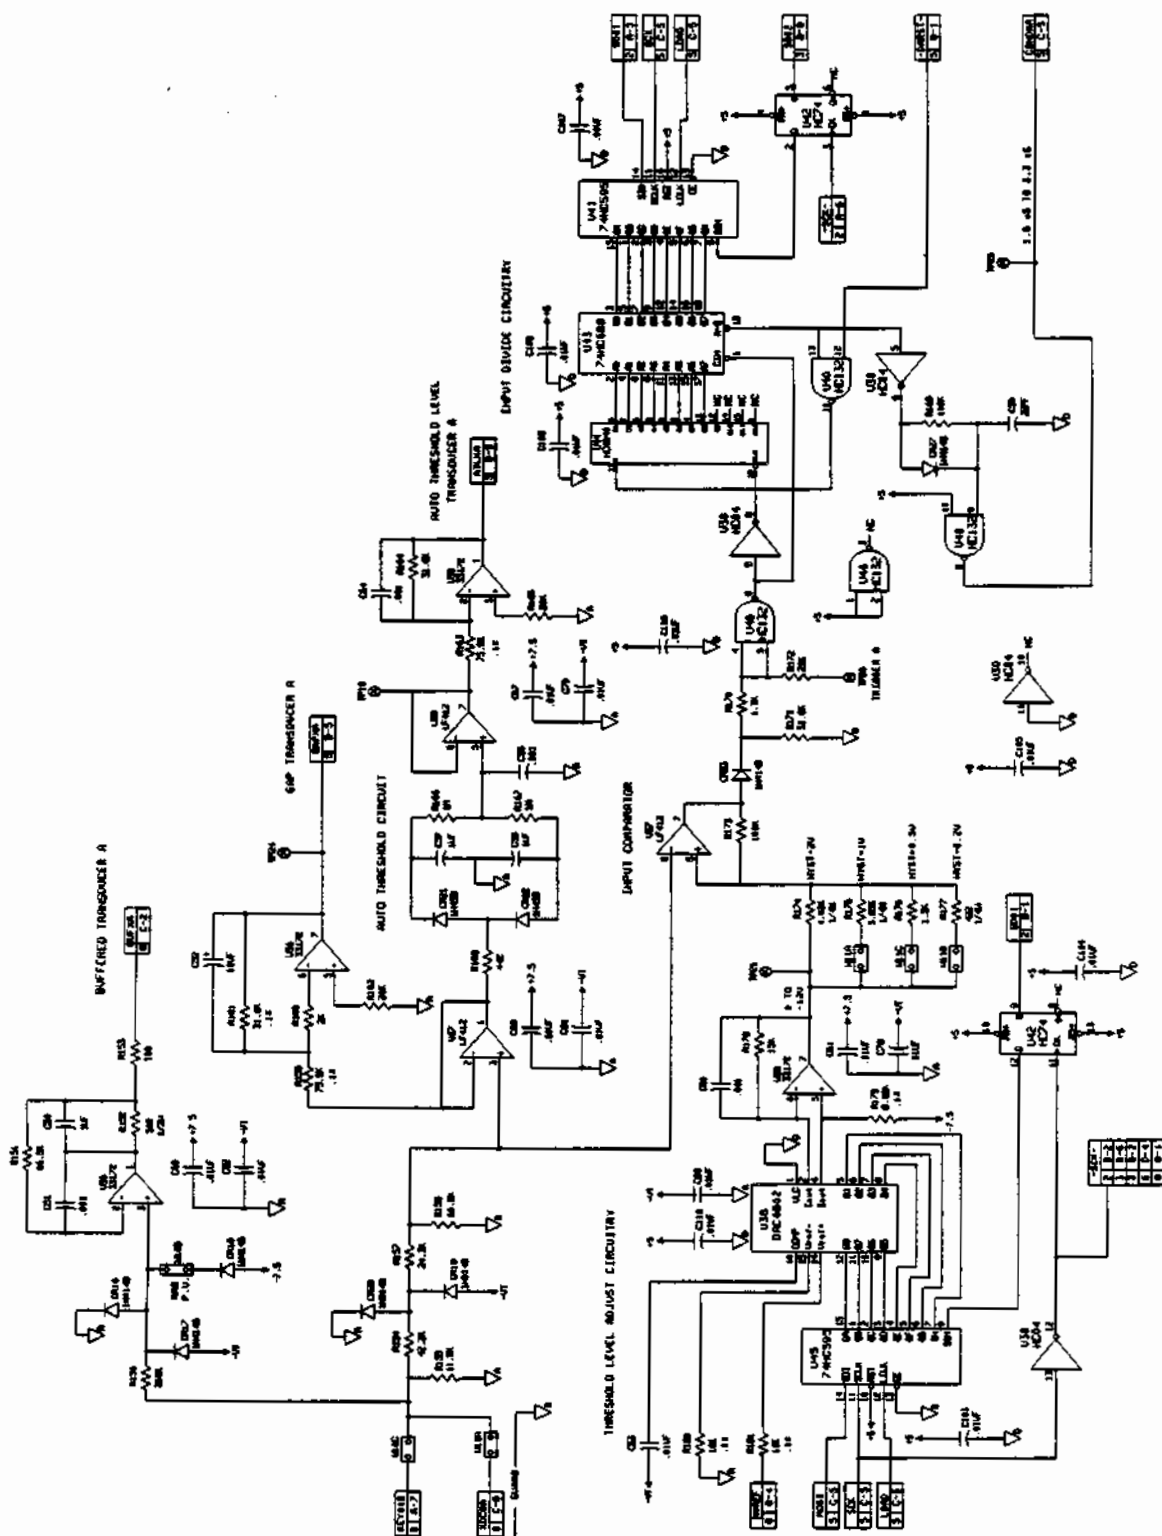



SEE SHEET 1

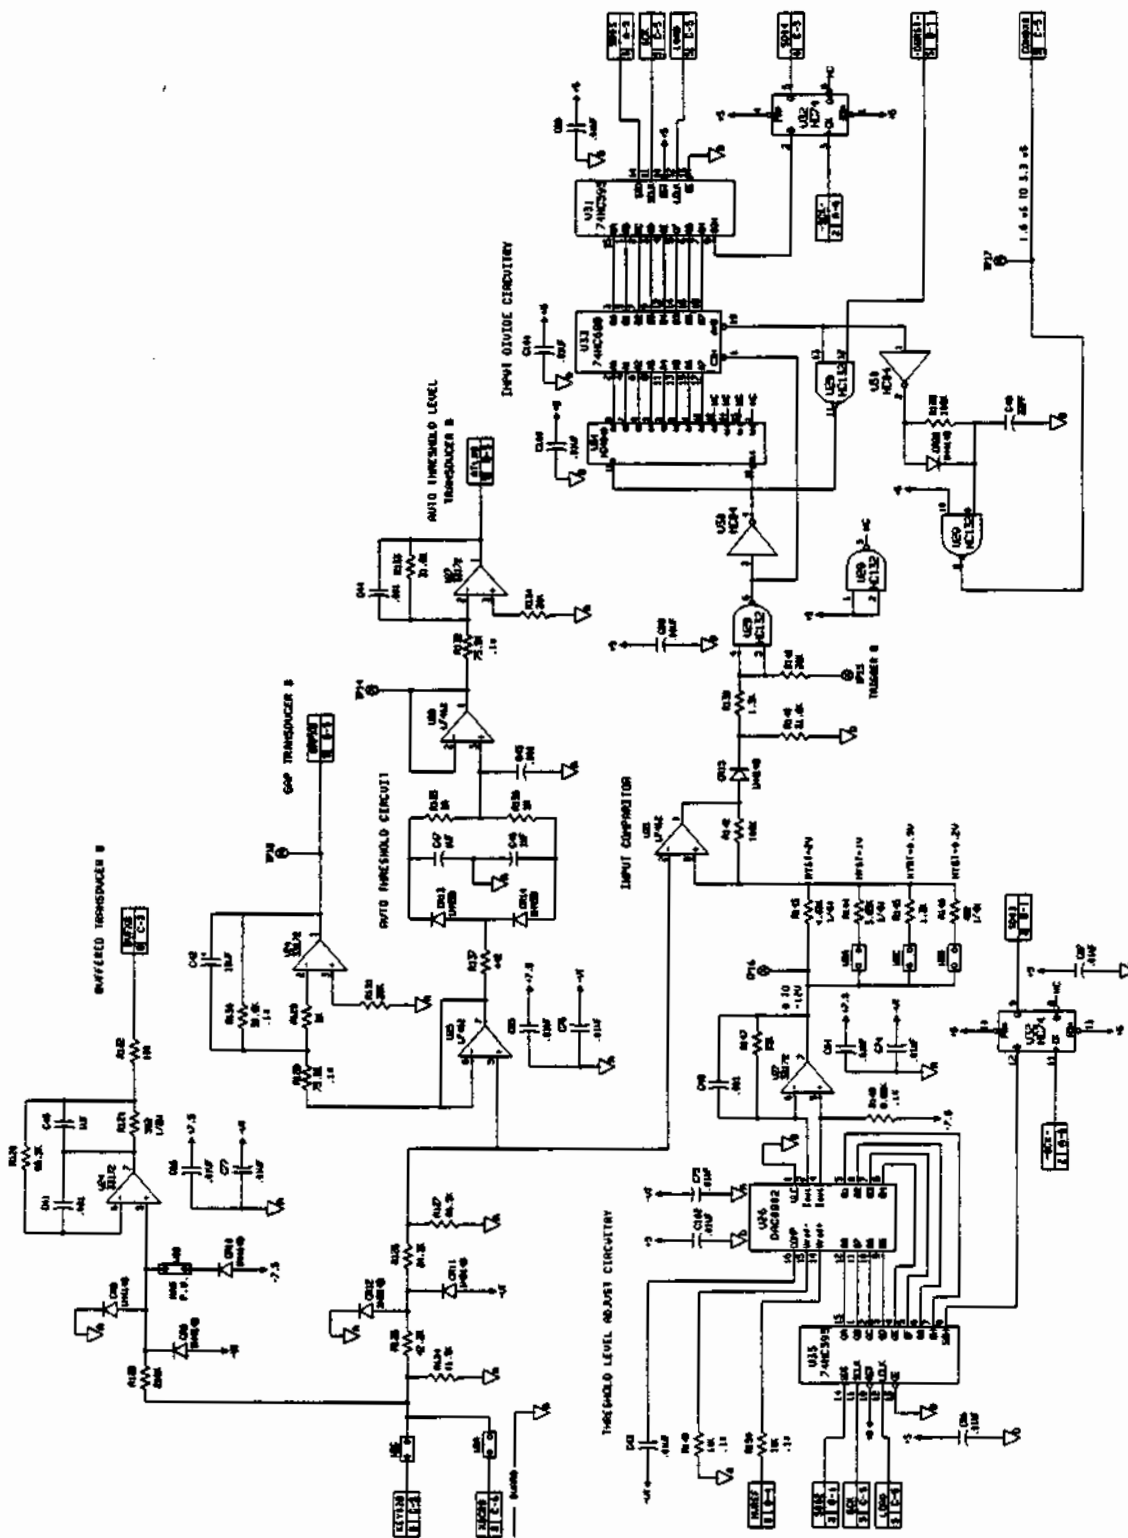


SEE SHEET 1

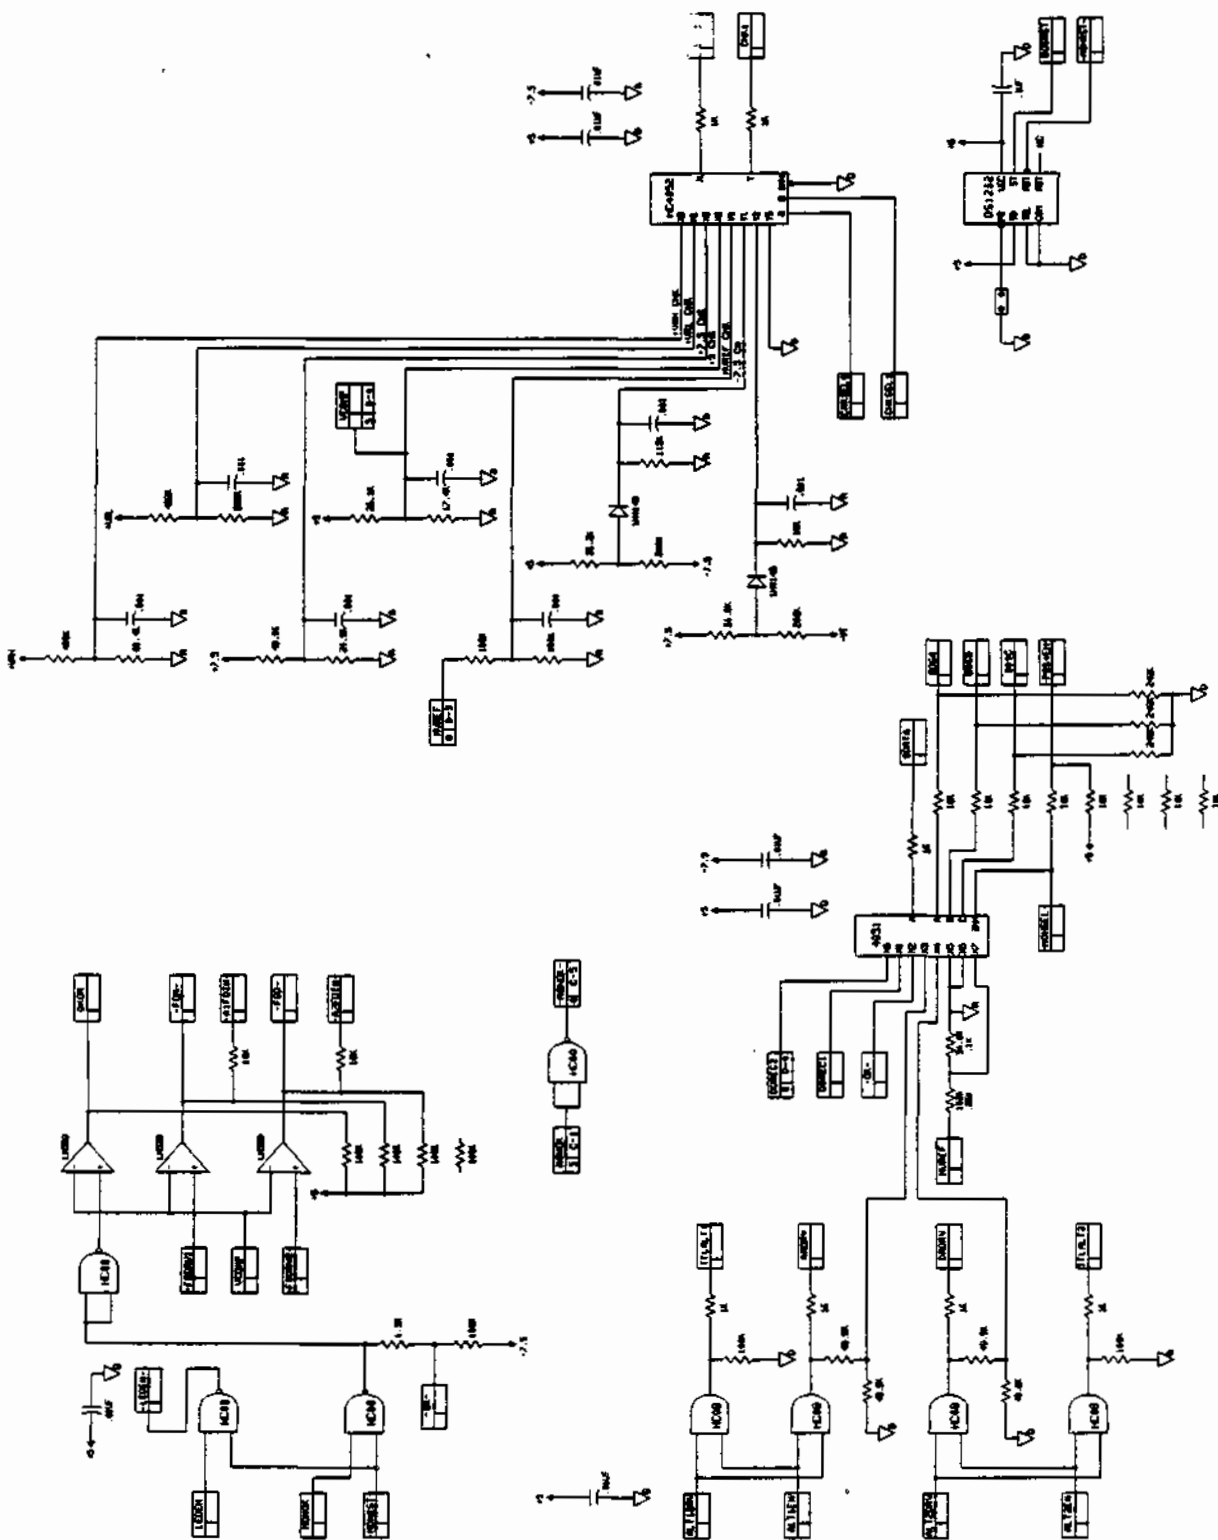

 


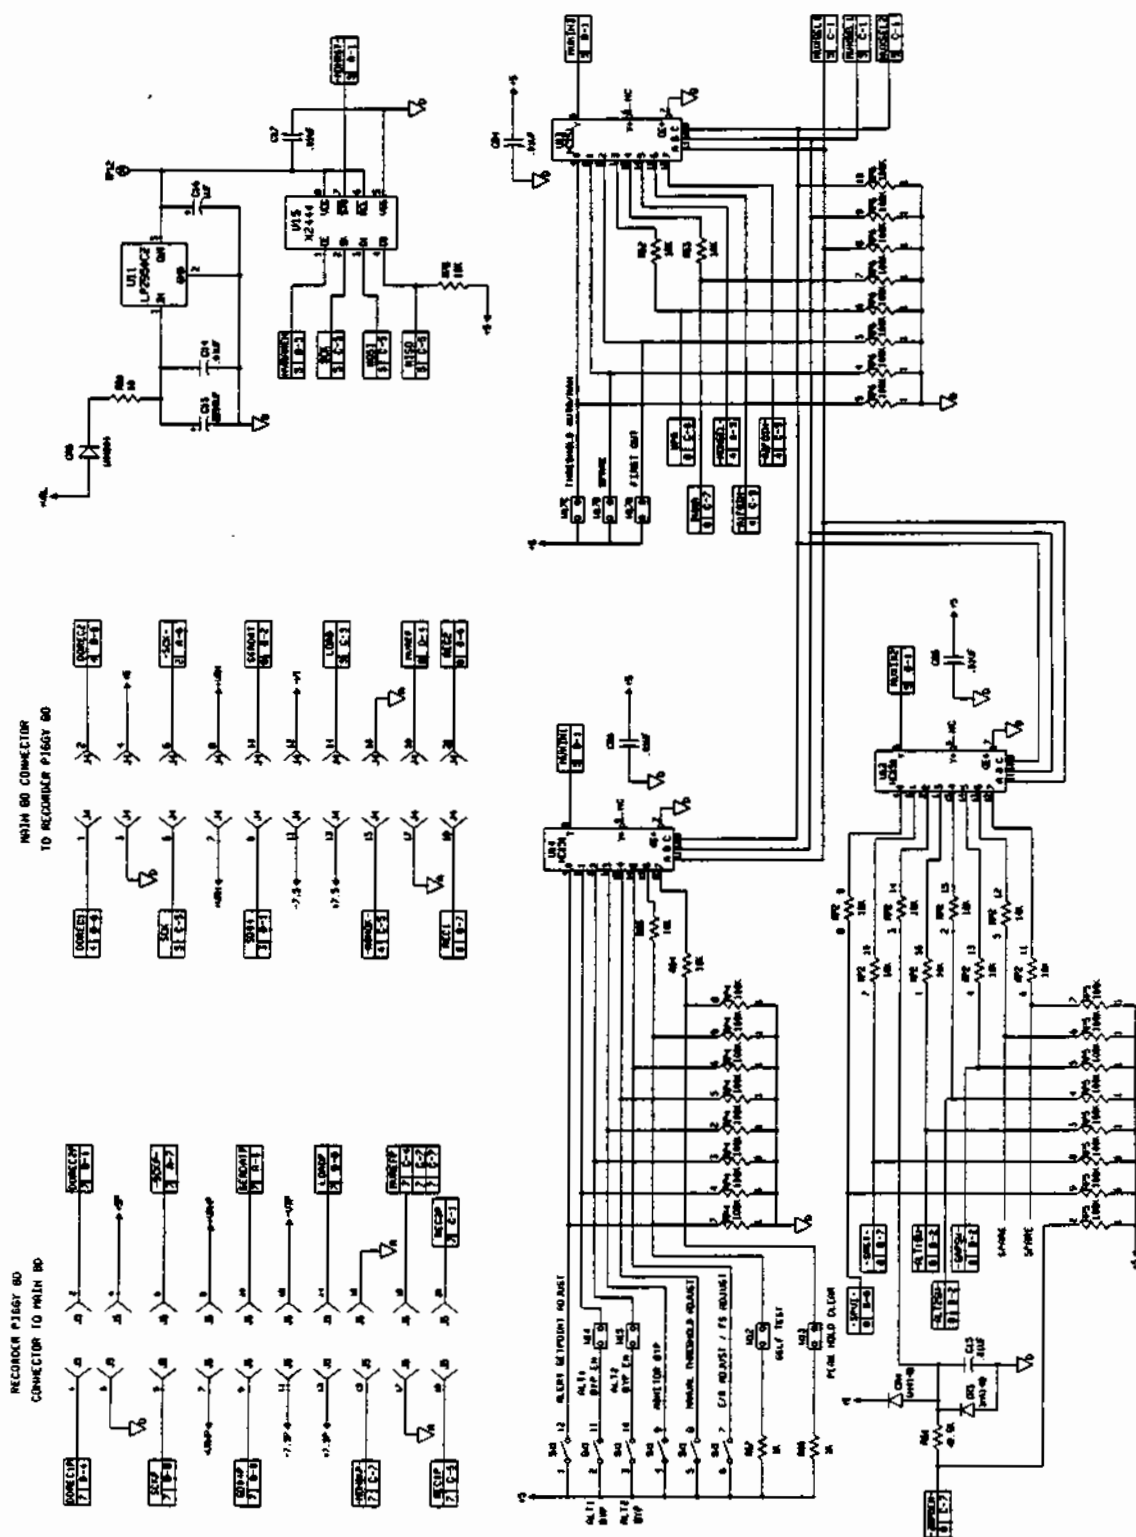


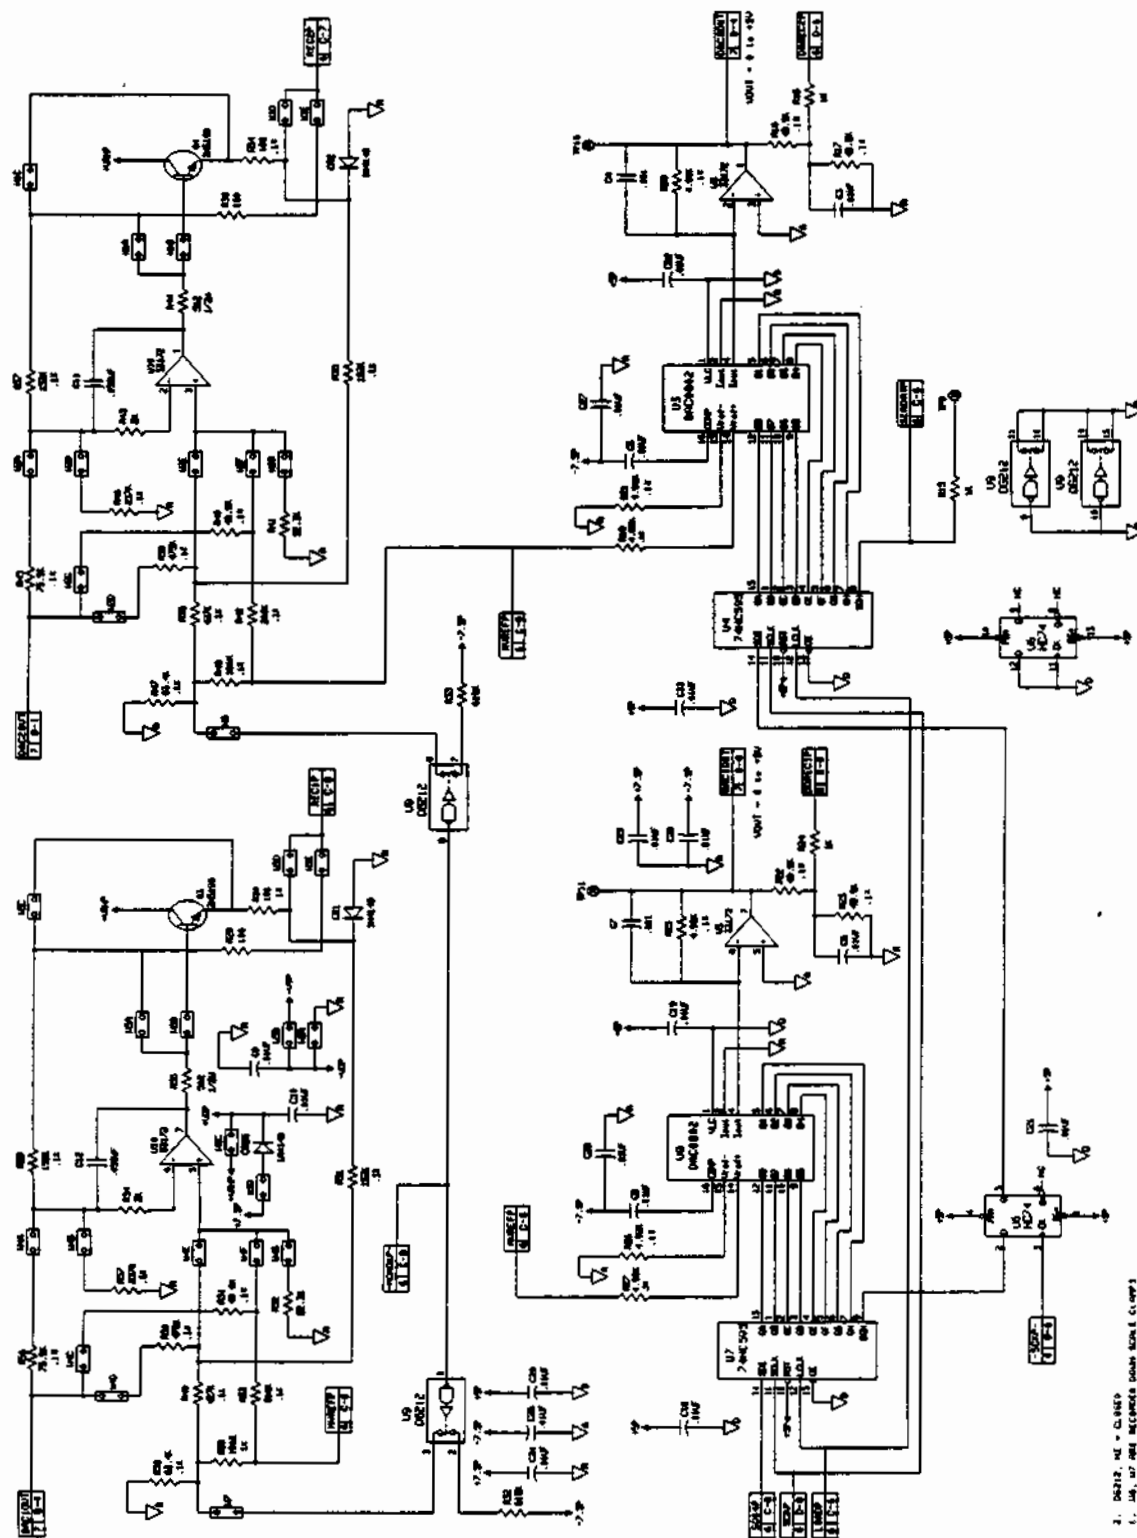


1. D6212, ME = 2.0460
2. ME, ME7 ME8 ME9 ME10 ME11 ME12 ME13 ME14 ME15 ME16 ME17 ME18 ME19 ME20 ME21 ME22 ME23 ME24 ME25 ME26 ME27 ME28 ME29 ME30 ME31 ME32 ME33 ME34 ME35 ME36 ME37 ME38 ME39 ME40 ME41 ME42 ME43 ME44 ME45 ME46 ME47 ME48 ME49 ME50 ME51 ME52 ME53 ME54 ME55 ME56 ME57 ME58 ME59 ME60 ME61 ME62 ME63 ME64 ME65 ME66 ME67 ME68 ME69 ME70 ME71 ME72 ME73 ME74 ME75 ME76 ME77 ME78 ME79 ME80 ME81 ME82 ME83 ME84 ME85 ME86 ME87 ME88 ME89 ME90 ME91 ME92 ME93 ME94 ME95 ME96 ME97 ME98 ME99 ME100 ME101 ME102 ME103 ME104 ME105 ME106 ME107 ME108 ME109 ME110 ME111 ME112 ME113 ME114 ME115 ME116 ME117 ME118 ME119 ME120 ME121 ME122 ME123 ME124 ME125 ME126 ME127 ME128 ME129 ME130 ME131 ME132 ME133 ME134 ME135 ME136 ME137 ME138 ME139 ME140 ME141 ME142 ME143 ME144 ME145 ME146 ME147 ME148 ME149 ME150 ME151 ME152 ME153 ME154 ME155 ME156 ME157 ME158 ME159 ME160 ME161 ME162 ME163 ME164 ME165 ME166 ME167 ME168 ME169 ME170 ME171 ME172 ME173 ME174 ME175 ME176 ME177 ME178 ME179 ME180 ME181 ME182 ME183 ME184 ME185 ME186 ME187 ME188 ME189 ME190 ME191 ME192 ME193 ME194 ME195 ME196 ME197 ME198 ME199 ME200 ME201 ME202 ME203 ME204 ME205 ME206 ME207 ME208 ME209 ME210 ME211 ME212 ME213 ME214 ME215 ME216 ME217 ME218 ME219 ME220 ME221 ME222 ME223 ME224 ME225 ME226 ME227 ME228 ME229 ME230 ME231 ME232 ME233 ME234 ME235 ME236 ME237 ME238 ME239 ME240 ME241 ME242 ME243 ME244 ME245 ME246 ME247 ME248 ME249 ME250 ME251 ME252 ME253 ME254 ME255 ME256 ME257 ME258 ME259 ME260 ME261 ME262 ME263 ME264 ME265 ME266 ME267 ME268 ME269 ME270 ME271 ME272 ME273 ME274 ME275 ME276 ME277 ME278 ME279 ME280 ME281 ME282 ME283 ME284 ME285 ME286 ME287 ME288 ME289 ME290 ME291 ME292 ME293 ME294 ME295 ME296 ME297 ME298 ME299 ME300 ME301 ME302 ME303 ME304 ME305 ME306 ME307 ME308 ME309 ME310 ME311 ME312 ME313 ME314 ME315 ME316 ME317 ME318 ME319 ME320 ME321 ME322 ME323 ME324 ME325 ME326 ME327 ME328 ME329 ME330 ME331 ME332 ME333 ME334 ME335 ME336 ME337 ME338 ME339 ME340 ME341 ME342 ME343 ME344 ME345 ME346 ME347 ME348 ME349 ME350 ME351 ME352 ME353 ME354 ME355 ME356 ME357 ME358 ME359 ME360 ME361 ME362 ME363 ME364 ME365 ME366 ME367 ME368 ME369 ME370 ME371 ME372 ME373 ME374 ME375 ME376 ME377 ME378 ME379 ME380 ME381 ME382 ME383 ME384 ME385 ME386 ME387 ME388 ME389 ME390 ME391 ME392 ME393 ME394 ME395 ME396 ME397 ME398 ME399 ME400 ME401 ME402 ME403 ME404 ME405 ME406 ME407 ME408 ME409 ME410 ME411 ME412 ME413 ME414 ME415 ME416 ME417 ME418 ME419 ME420 ME421 ME422 ME423 ME424 ME425 ME426 ME427 ME428 ME429 ME430 ME431 ME432 ME433 ME434 ME435 ME436 ME437 ME438 ME439 ME440 ME441 ME442 ME443 ME444 ME445 ME446 ME447 ME448 ME449 ME450 ME451 ME452 ME453 ME454 ME455 ME456 ME457 ME458 ME459 ME460 ME461 ME462 ME463 ME464 ME465 ME466 ME467 ME468 ME469 ME470 ME471 ME472 ME473 ME474 ME475 ME476 ME477 ME478 ME479 ME480 ME481 ME482 ME483 ME484 ME485 ME486 ME487 ME488 ME489 ME490 ME491 ME492 ME493 ME494 ME495 ME496 ME497 ME498 ME499 ME500 ME501 ME502 ME503 ME504 ME505 ME506 ME507 ME508 ME509 ME510 ME511 ME512 ME513 ME514 ME515 ME516 ME517 ME518 ME519 ME520 ME521 ME522 ME523 ME524 ME525 ME526 ME527 ME528 ME529 ME530 ME531 ME532 ME533 ME534 ME535 ME536 ME537 ME538 ME539 ME540 ME541 ME542 ME543 ME544 ME545 ME546 ME547 ME548 ME549 ME550 ME551 ME552 ME553 ME554 ME555 ME556 ME557 ME558 ME559 ME560 ME561 ME562 ME563 ME564 ME565 ME566 ME567 ME568 ME569 ME570 ME571 ME572 ME573 ME574 ME575 ME576 ME577 ME578 ME579 ME580 ME581 ME582 ME583 ME584 ME585 ME586 ME587 ME588 ME589 ME590 ME591 ME592 ME593 ME594 ME595 ME596 ME597 ME598 ME599 ME600 ME601 ME602 ME603 ME604 ME605 ME606 ME607 ME608 ME609 ME610 ME611 ME612 ME613 ME614 ME615 ME616 ME617 ME618 ME619 ME620 ME621 ME622 ME623 ME624 ME625 ME626 ME627 ME628 ME629 ME630 ME631 ME632 ME633 ME634 ME635 ME636 ME637 ME638 ME639 ME640 ME641 ME642 ME643 ME644 ME645 ME646 ME647 ME648 ME649 ME650 ME651 ME652 ME653 ME654 ME655 ME656 ME657 ME658 ME659 ME660 ME661 ME662 ME663 ME664 ME665 ME666 ME667 ME668 ME669 ME670 ME671 ME672 ME673 ME674 ME675 ME676 ME677 ME678 ME679 ME680 ME681 ME682 ME683 ME684 ME685 ME686 ME687 ME688 ME689 ME690 ME691 ME692 ME693 ME694 ME695 ME696 ME697 ME698 ME699 ME700 ME701 ME702 ME703 ME704 ME705 ME706 ME707 ME708 ME709 ME710 ME711 ME712 ME713 ME714 ME715 ME716 ME717 ME718 ME719 ME720 ME721 ME722 ME723 ME724 ME725 ME726 ME727 ME728 ME729 ME730 ME731 ME732 ME733 ME734 ME735 ME736 ME737 ME738 ME739 ME740 ME741 ME742 ME743 ME744 ME745 ME746 ME747 ME748 ME749 ME750 ME751 ME752 ME753 ME754 ME755 ME756 ME757 ME758 ME759 ME760 ME761 ME762 ME763 ME764 ME765 ME766 ME767 ME768 ME769 ME770 ME771 ME772 ME773 ME774 ME775 ME776 ME777 ME778 ME779 ME780 ME781 ME782 ME783 ME784 ME785 ME786 ME787 ME788 ME789 ME790 ME791 ME792 ME793 ME794 ME795 ME796 ME797 ME798 ME799 ME800 ME801 ME802 ME803 ME804 ME805 ME806 ME807 ME808 ME809 ME810 ME811 ME812 ME813 ME814 ME815 ME816 ME817 ME818 ME819 ME820 ME821 ME822 ME823 ME824 ME825 ME826 ME827 ME828 ME829 ME830 ME831 ME832 ME833 ME834 ME835 ME836 ME837 ME838 ME839 ME840 ME841 ME842 ME843 ME844 ME845 ME846 ME847 ME848 ME849 ME850 ME851 ME852 ME853 ME854 ME855 ME856 ME857 ME858 ME859 ME860 ME861 ME862 ME863 ME864 ME865 ME866 ME867 ME868 ME869 ME870 ME871 ME872 ME873 ME874 ME875 ME876 ME877 ME878 ME879 ME880 ME881 ME882 ME883 ME884 ME885 ME886 ME887 ME888 ME889 ME890 ME891 ME892 ME893 ME894 ME895 ME896 ME897 ME898 ME899 ME900 ME901 ME902 ME903 ME904 ME905 ME906 ME907 ME908 ME909 ME910 ME911 ME912 ME913 ME914 ME915 ME916 ME917 ME918 ME919 ME920 ME921 ME922 ME923 ME924 ME925 ME926 ME927 ME928 ME929 ME930 ME931 ME932 ME933 ME934 ME935 ME936 ME937 ME938 ME939 ME940 ME941 ME942 ME943 ME944 ME945 ME946 ME947 ME948 ME949 ME950 ME951 ME952 ME953 ME954 ME955 ME956 ME957 ME958 ME959 ME960 ME961 ME962 ME963 ME964 ME965 ME966 ME967 ME968 ME969 ME970 ME971 ME972 ME973 ME974 ME975 ME976 ME977 ME978 ME979 ME980 ME981 ME982 ME983 ME984 ME985 ME986 ME987 ME988 ME989 ME990 ME991 ME992 ME993 ME994 ME995 ME996 ME997 ME998 ME999 ME1000 ME1001 ME1002 ME1003 ME1004 ME1005 ME1006 ME1007 ME1008 ME1009 ME1010 ME1011 ME1012 ME1013 ME1014 ME1015 ME1016 ME1017 ME1018 ME1019 ME1020 ME1021 ME1022 ME1023 ME1024 ME1025 ME1026 ME1027 ME1028 ME1029 ME1030 ME1031 ME1032 ME1033 ME1034 ME1035 ME1036 ME1037 ME1038



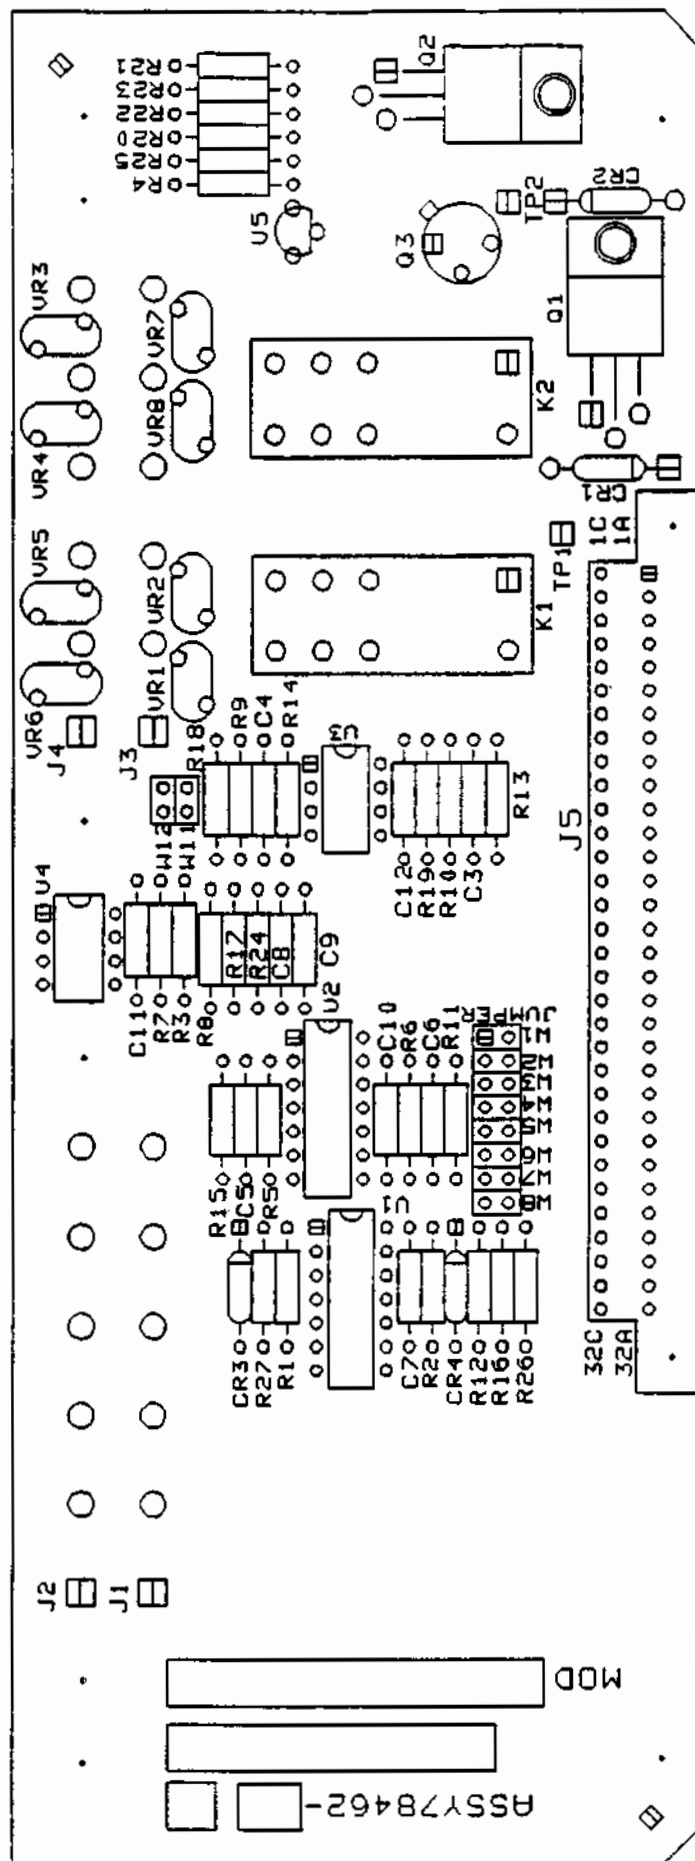

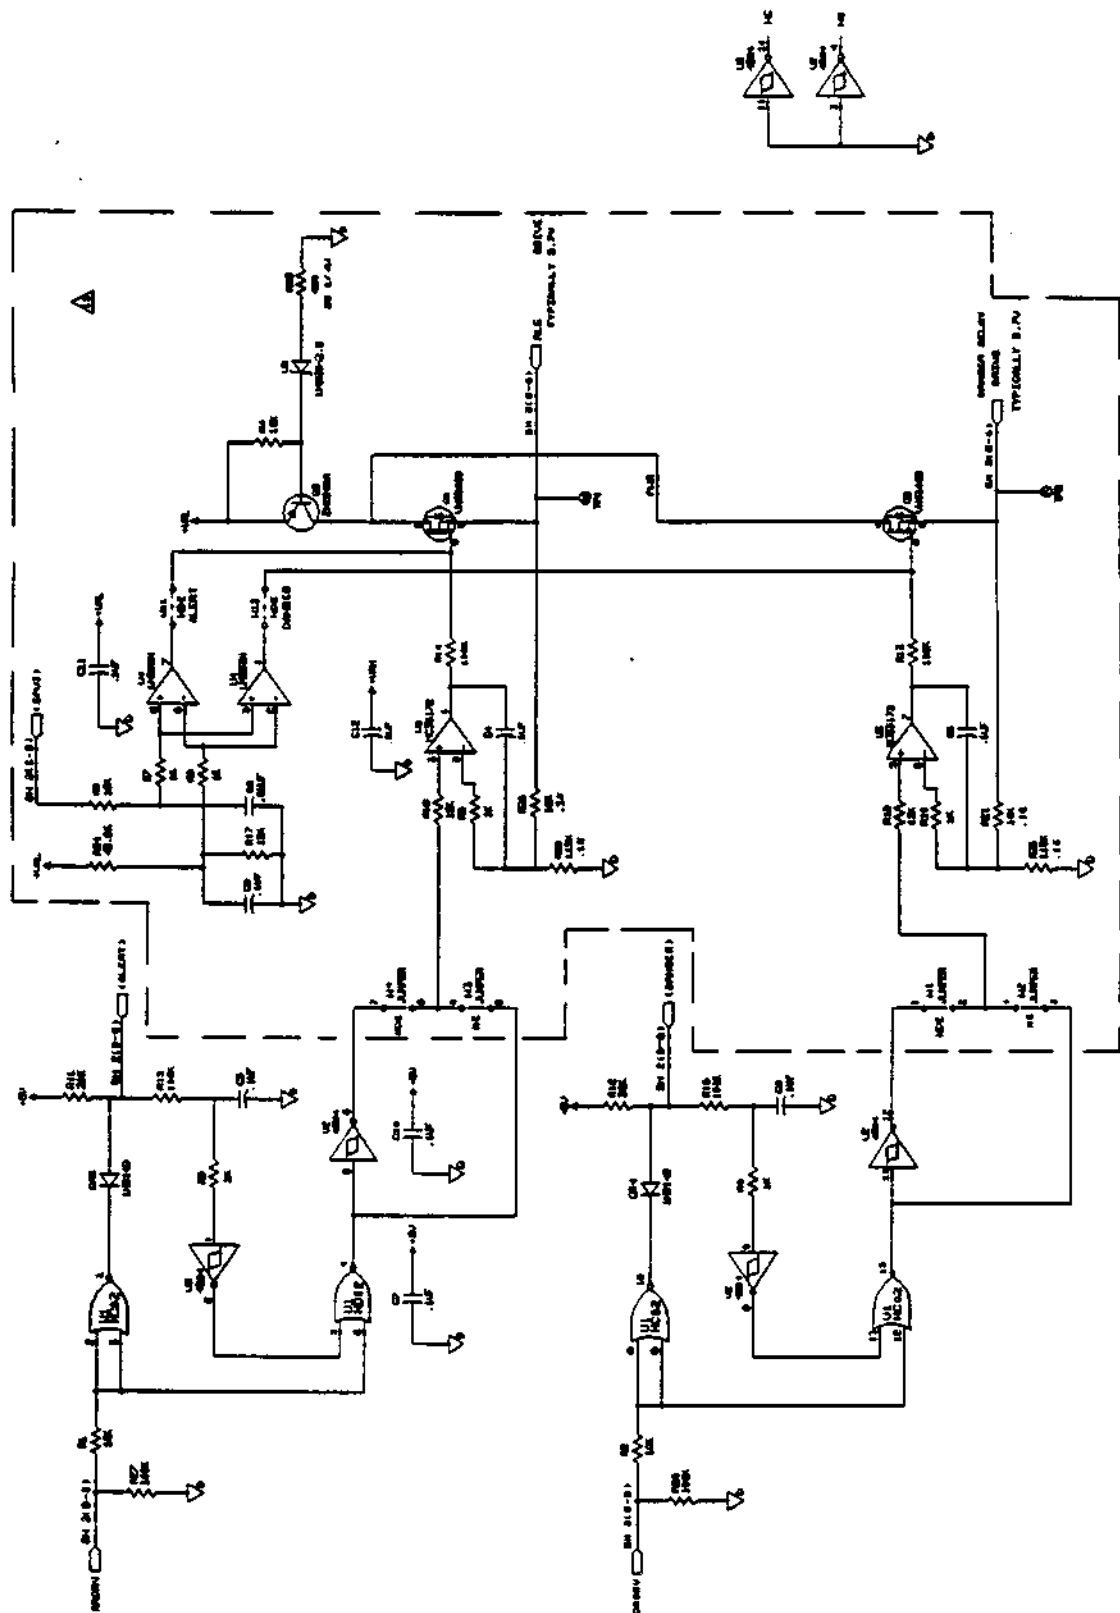

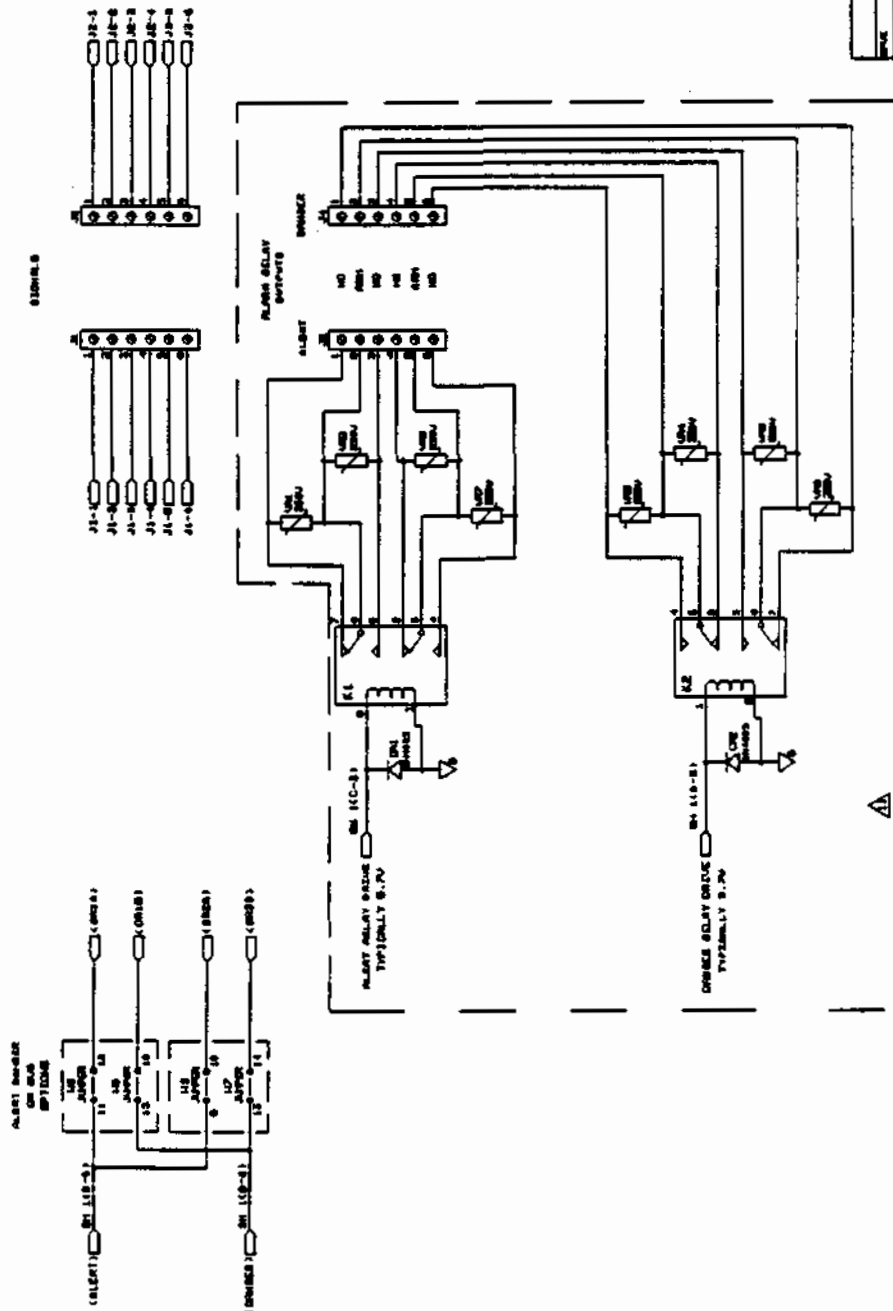

SIGNAL CHART	
ALERT	ON 12-1 FOR 12-1 UP 12-1
CHARGE	ON 12-1 FOR 12-1 UP 12-1
ALERT	ON 12-1 FOR 12-1 UP 12-1
CHARGE	ON 12-1 FOR 12-1 UP 12-1
ALERT	ON 12-1 FOR 12-1 UP 12-1
CHARGE	ON 12-1 FOR 12-1 UP 12-1
ALERT	ON 12-1 FOR 12-1 UP 12-1
CHARGE	ON 12-1 FOR 12-1 UP 12-1
ALERT	ON 12-1 FOR 12-1 UP 12-1
CHARGE	ON 12-1 FOR 12-1 UP 12-1

Artisan Technology Group is an independent supplier of quality pre-owned equipment

Gold-standard solutions

Extend the life of your critical industrial, commercial, and military systems with our superior service and support.

We buy equipment

Planning to upgrade your current equipment? Have surplus equipment taking up shelf space? We'll give it a new home.

Learn more!

Visit us at [artisanth.com](https://www.artisanth.com) for more info on price quotes, drivers, technical specifications, manuals, and documentation.

Artisan Scientific Corporation dba Artisan Technology Group is not an affiliate, representative, or authorized distributor for any manufacturer listed herein.

We're here to make your life easier. How can we help you today?

(217) 352-9330 | sales@artisanth.com | [artisanth.com](https://www.artisanth.com)

